ACTIVITY-BASED SAMPLING SUMMARY REPORT OPERABLE UNIT 4 LIBBY, MONTANA, SUPERFUND SITE

June 2, 2010

Prepared by:
U.S. Environmental Protection Agency
Region 8
Denver, CO



With Technical Assistance from:

SRC, Inc. Denver, CO



APPROVAL PAGE	
This Activity-Based Sampling Summary Report for Operable Unit 4 a Superfund Site has been reviewed by EPA and is approved for exter	•
Victor Ketellapper (EPA Region 8, Libby Site Team Leader)	Jue 2, 2010 Date
David L By	Jun 2, 2010
David Berry (EPA Region 8,/Human Health Risk Assessor)	Date

•

·

	-	

TABLE OF CONTENTS

1	Intro	oduction	1
	1.1	Site Background	1
		Purpose of this Document	
		Document Organization	
2		a Management	
		Sample Collection, Documentation, Handling, and Custody	
		Analytical Results Recording	
		Hard Copy Data Management	
		Electronic Data Management	
3		lysis Methods and Data Reduction	
		Transmission Electron Microscopy Analysis of Air and Dust Samples	
	3.1.	The state of the s	
	3.1.2		
	3.1.3		
	3.1.4	, ,	
	3.1.8		
		Polarized Light Microscopy Analysis of Soil Samples	
	3.2.		
	3.2.2	·· / ··· / ·····	
		Soil Visual Inspection	
4		door Activity-Based Sampling Summary and Evaluation	
		Study Design	
	4.1. ¹ 4.1. ¹	, ,	
	4.1.2 4.1.3		
	4.1.		
		Results	
	4.2.		
	4.2.		
	4.2.3		
	4.2.		
		Evaluation of Results from Clean Fill Areas	
		Evaluation of Unexpected Results	
	4.4.	·	
	4.4.	·	
	4.5	Summary and Discussion	
5		oor Activity-Based Sampling Summary and Evaluation	
		Study Design	
	5.1. ⁻	, ,	
	5.1.2	, ,	
	5.1.3		
	5.1.4	. •	
	5.2	Results Summary and Data Evaluation	
	5.2.	· · · · · · · · · · · · · · · · · · ·	

	5.2.2	LA in Air as a Function of Post-Cleanup Property Category	30
	5.2.3	Correlation of LA in Indoor Air to LA in Indoor Dust	31
	5.2. 4	Correlation of LA in Indoor Air to LA Levels in Outdoor Soil	31
	5.3 Sum	nmary and Discussion	
6	Screeni	ng Level Risk Characterization	35
		Model	
	6.2 Inpu	ts to the Equation	36
	6.2.1	Exposure Point Concentration (EPC)	36
	6.2.2	Time-Weighting Factor (TWF)	
	6.2.3	Inhalation Unit Risk (IURa,d)	
	6.3 Res	ults	39
	6.3.1	Outdoor Exposures During Soil Disturbance Activities	39
	6.3.2	Indoor Exposures	40
	6.3.3	Combined Exposures	40
	6.4 Unc	ertainties in Risk Estimates	41
	6.5 Con	clusions	43
7	Data Qu	ality Assessmentality Assessment	44
	7.1 Aud	its	44
	7.1.1	Field Audits	44
	7.1.2	Laboratory Audits	44
	7.2 Mod	lifications	44
	7.3 Data	a Verification	45
	7.4 Qua	lity Control Sample Summary	46
	7.5 Data	Adequacy Evaluation	46
	7.5.1	Outdoor ABS	47
	7.5.2	Indoor ABS	49
	7.5.3	Data Adequacy Conclusions	52
	7.6 Data	a Quality Conclusions	53
8	Referen	ces	54

		APPENDICES (provided electronically)
	Appendix A	Hard Copy Documentation (includes all FSDS forms, chain of custody forms, and analytical reports)
	Appendix B	Project Database
	Appendix C	Outdoor ABS – Detailed Raw Data
Ω	Appendix D	Evaluation of the Correlation of LA in Outdoor ABS Air to LA in Soil
	Appendix E	Indoor ABS - Detailed Raw Data
	Appendix F	Field and Laboratory Modifications
Π	Appendix G	Data Verification Summary
	Appendix H	Quality Control Evaluation
		ATTACHMENTS (provided electronically)
	Attachment 1	Quantitative Poisson Regression Modeling
\bigcap		

Page iii

ABS Summary Report, OU4

LIST OF TABLES

Table 4-1	Cleanup Status of All Outdoor ABS Properties
Table 4-2	Outdoor ABS Air Data - Round 1 (Summer 2007)
Table 4-3	Outdoor ABS Air Data - Round 2 (Spring 2008)
Table 4-4	Between Activity Correlations
Table 4-5	Between Round Correlations
Table 4-6	Summary of Soil Data for Outdoor ABS Areas
Table 4-7	Overview of Soil Data for Outdoor ABS Study Areas
Table 4-8	Between Round Variability in PLM-VE Results
Table 4-9	Outdoor ABS "Clean Fill" Property Details from Round 1
Table 5-1	Cleanup Status of All Indoor ABS Properties
Table 5-2	Indoor ABS Air Data
Table 5-3	Indoor ABS Dust Data
Table 5-4	Outdoor Soil Data at Indoor ABS Properties
Table 5-5	Multivariate Regression Analysis Results for Indoor ABS Air During Active
	Disturbance Scenario
Table 6-1	Screening-Level Risk Calculations for Outdoor Exposure to ABS Air
Table 6-2	Screening-Level Risk Calculations for Indoor Exposure to ABS Air
Table 6-3	LA Structure Types Observed in Outdoor ABS Air Samples
Table 7-1	Impact Assessment for Field and Laboratory Modifications

LIST OF FIGURES

Figure 4-1	Outdoor Activity Based Sampling Properties
Figure 4-2	Outdoor ABS Air Concentrations Stratified by ABS Scenario and Sampling Round
Figure 4-3	Between Round Variability in Visible Inspection Data
Figure 4-4	Outdoor ABS Air Concentrations Stratified by PLM-VE Results
Figure 4-5	Outdoor ABS Air Concentrations Stratified by PLM-VE/Visible Vermiculite
J	Ranking
Figure 4-6	Outdoor ABS Air Concentrations Stratified by Visible Vermiculite Ranking
Figure 4-7	Outdoor ABS Air Concentrations Stratified by Visual Vermiculite Detection Status
	Across Rounds
Figure 4-8	Outdoor ABS Air Concentrations Stratified by Visible Detection Frequency
5 1	Ranking
Figure 4-9	Outdoor ABS Air Concentrations Stratified by Visible Vermiculite Weighted Score
Figure 4-10	Ranking Outdoor ABS Air Concentrations Stratified by Visible Detection Frequency
Figure 4-11	Outdoor ABS Air Concentrations Stratified by Visible Vermiculite Weighted Score
Figure 4-12	Outdoor ABS Data for Clean Fill Locations
Figure 4-13	Comparison of High Volume and Low Volume Samples
, 3	
Figure 5-1	Indoor Activity Based Sampling Properties
Figure 5-2	Indoor ABS Air Concentrations Stratified by ABS Scenario and Sampling Round
Figure 5-3	Indoor ABS Air Concentrations Stratified by Interior Category
Figure 5-4	Indoor ABS Air Concentrations Stratified by PLM-VE Results
Figure 5-5	Indoor ABS Air Concentrations Stratified by Visible Detection Frequency
Figure 5-6	Indoor ABS Air Concentrations Stratified by Visible Vermiculite Weighted Score
Figure 5-7	Mean Total LA Air Concentration Stratified by NSUA and SUA Visual Detection
Figure 5-8	Frequency Bins Mean Total LA Air Concentration Stratified by NSUA and SUA Visual Score Bins
rigule 5-6	Mean Total EA All Concentration Stratified by 1400A and 50A Visual 500fe bins
Figure 6-1	Distribution of Screening Level Risk Estimates at Outdoor ABS Areas
Figure 6-2	Distribution of Screening Level Risk Estimates (Active Plus Passive) at Indoor
•	ABS Properties
Figure 6-3	Distribution of Screening Level Total Risk Estimates at Properties with Both
	Indoor and Outdoor ABS Data
Figure 6-4	Comparison of Direct and Indirect TEM Results for 31 Air Samples from Libby
Fig 7.4	Comple Departies of C. Allego ADC Ale Consular
Figure 7-1 Figure 7-2	Sample Durations for Outdoor ABS Air Samples
Figure 7-3	Analytical Sensitivities Achieved for Outdoor ABS Air Samples Number of LA Structures Observed in Outdoor ABS Air Samples
Figure 7-3	Sample Durations for Indoor ABS Air Samples
Figure 7-5	Analytical Sensitivities Achieved for Indoor ABS Air Samples
Figure 7-6	Number of LA Structures Observed in Indoor ABS Air Samples

This nage	intentionally	left blank to	facilitate c	louble-sider	Inrintina
Triis page	iriteritiorialiv	ieit biarik to) raciiitate d	ioubie-siaec	ı pririuna

ACRONYMS AND ABBREVIATIONS

		ACKON I NIO AND ADDREVIATIONS
	95UCL	95% upper confidence limit of the sample mean
	ABS	Activity-Based Sampling
	CC	cubic centimeters
\bigcap	CI	Confidence Interval
	cm	centimeter
	CSF	Close Support Facility
	CTE	Central Tendency Exposure
	CV	Coefficient of Variation
	DQA	Data Quality Assessment
	DQO	Data Quality Objectives
	EDD	Electronic Data Deliverable
~~~	EDS	Energy Dispersive Spectroscopy
	EF	Exposure Frequency
	EPA	U.S. Environmental Protection Agency
$\cap$	EPC	Exposure Point Concentration
}}	ERT	Emergency Response Team
	ET	Exposure Time
$\Box$	FSDS	Field Sample Data Sheet
	GO	Grid Opening
U	HV	High Volume
	IUR	Inhalation Unit Risk
	L	liters
	LA	Libby Amphibole Asbestos
	LB	Lower Bound
	LFO	Libby Field Office
	LV	Low Volume
$\bigcap$	N	Number of Structures
	ND	Non-Detect
	NSUA	Non-Specific Use Area
Π	OU	Operable Unit
	PCC	Property Completion Checklist
	PCM	Phase Contrast Microscopy
	PCME	Phase Contrast Microscopy Equivalent
	PLM	Polarized Light Microscopy
	QC	Quality Control
$\bigcap$	RME	Reasonable Maximum Exposure
	s	structures
_	SAED	Selected Area Electron Diffraction
	SAP	Sampling and Analysis Plan
L	SOP	Standard Operating Procedure
	SPP	Soil Preparation Plan
	SQAPP	Supplemental Remedial Investigation Quality Assurance and Project Plan
	SUA	Specific Use Area

# **ACRONYMS AND ABBREVIATIONS (cont.)**

TEM	Transmission Electron Microscopy
TWF	Time Weighting Factor

UB Upper Bound

VCS Vermiculite-Containing Soil VE Visual Area Estimation

#### **EXECUTIVE SUMMARY**

#### Introduction

Libby is a community in northwestern Montana that is located near a large open-pit vermiculite mine. Vermiculite from this mine contains varying levels of a form of asbestos referred to as Libby Amphibole (LA). Starting in 2000, the U.S. Environmental Protection Agency (EPA) began taking a range of cleanup actions at the site to reduce or eliminate sources of LA exposure to residents and workers. In December 2003, EPA developed a protocol (EPA 2003) for investigating sources of LA at homes and workplaces in the main residential and commercial areas of Libby and deciding when to take action. Cleanup actions taken under this protocol typically include removal of unenclosed vermiculite insulation from living spaces and other readily accessible spaces (e.g., unfinished attics), removal of some or all contaminated outdoor soils, and may, in some cases, include cleanup of indoor dusts.

In order to further investigate the residual levels of exposure and risk that may exist at post-cleanup¹ properties, EPA conducted the Indoor and Outdoor Activity-Based Sampling (ABS) programs which were designed to collect data on residual indoor and outdoor exposures (EPA 2007a,b). A brief description of these sampling programs and their findings are summarized below.

## **Outdoor ABS Program**

#### **Program Description**

The Outdoor ABS program was designed to measure LA levels in outdoor air during three residential soil disturbance activities – raking, mowing, and digging. Sampling was conducted at 75 outdoor ABS areas which spanned a range of post-cleanup conditions and soil LA levels. Because the levels of LA in outdoor ABS air generated during soil disturbance scenarios may depend on factors that vary seasonally (e.g., soil moisture, wind speed, humidity), the Outdoor ABS program included two sampling events – one in the summer and one in the spring. During each sampling event, soil samples were collected from each outdoor ABS area and air samples were collected during each disturbance scenario for the analysis of LA.

#### Major Findings

■ There was high variability in the concentration of PCME² LA observed in the outdoor ABS air samples, ranging from non-detect (usually < 0.001 s/cc) to more than 20 s/cc. On average, the concentration values associated with mowing and digging tended to be similar, with the

¹ The term "post-cleanup property" is used to indicate any property where EPA has investigated sources and has either taken cleanup action or else determined that no cleanup action was needed under the current decision-making protocol (EPA 2003).

² Air concentrations used in risk computations are expressed in terms of phase contrast microscopy (PCM) fibers. LA structures that are indentified under transmission electron microscopy (TEM) that meet PCM counting rules are referred to as PCM-equivalent (PCME).

values for raking tending to be somewhat lower. There was relatively high variability between sampling rounds, with Round 1 (summer) tending to yield higher concentration values than Round 2 (spring).

The relationship between LA levels in outdoor ABS air and the level of LA in soil was investigated using several different strategies for characterizing the level of soil contamination. In most cases, the average concentration of PCME LA in ABS air tended to increase as a function of increasing levels of LA in soil, although the strength of the trend varied somewhat between different methods for characterizing the level of soil contamination. No single method appeared to provide results that were inherently superior to others.

## **Indoor ABS Program**

## **Program Description**

The Indoor ABS program was designed to measure LA levels in indoor air during two residential disturbance conditions - active and passive behaviors. During active behaviors, a person may be moving about the building and potentially disturbing indoor sources (e.g., dusting, sweeping, vacuuming). During passive behaviors, a person is engaged in minimally energetic actions that will have low tendency to disturb any indoor sources (e.g., watching television). Sampling was conducted at 80 indoor ABS properties which spanned a range of post-cleanup conditions. Because the levels of LA in indoor air may depend on factors that vary seasonally (e.g., indoor activity patterns, humidity, building ventilation rate), the Indoor ABS program included four sampling events - summer, fall, winter, and spring. During each sampling event, indoor dust samples were collected from each indoor ABS property and air samples were collected during each disturbance condition for the analysis of LA. In addition, prior to the first sampling event, two soil samples were collected from each indoor ABS property for LA analysis. One soil sample was representative of all non-specific use areas (NSUAs) in the yard, and the other soil sample was representative of all specific use areas (SUAs). SUAs include areas such as gardens, flowerbeds, unpaved driveways, and play areas where human exposure is likely to occur on a frequent basis.

#### **Major Findings**

- The concentration of PCME LA observed in the indoor ABS air samples ranged from non-detect (usually < 0.0003 s/cc) to about 0.01 s/cc. On average, the concentration values associated with active behaviors were higher than for passive behaviors, supporting the concept that disturbance of an indoor source such as contaminated indoor dust is one contributing factor to indoor air levels of LA. Indoor air levels of LA tended to be lowest during the winter and highest during the summer for both active and passive behaviors.</p>
- It was not possible to establish a quantitative relationship between LA levels in indoor air and indoor dust because nearly all of the dust samples (326 out of 336) were non-detect for LA (< 3 to 27 s/cm²).</li>

•	A weak correlation could be detected between average indoor air concentrations of PCME
	LA and the level of LA in outdoor soil. These results support the concept that outdoor soil is
	a source that contributes to indoor air contamination. However, regression analysis
	suggests that other sources besides outdoor soil may also be important.

## Screening Level Risk Characterization

In order to help place the ABS results into perspective, screening level estimates of cancer risk were calculated using presently available methods. The screening level risk calculations suggest that residual risks from indoor exposures at post-cleanup properties are likely to be within EPA's acceptable risk range. Residual risks from outdoor exposures to PCME LA in air appeared to depend on the level of residual LA in soil. At ABS areas with no detectable LA in soil, risks tend to be mainly within EPA's acceptable risk range. However, at areas with detectable levels of LA in soil, residual risks may approach or exceed the high end of EPA's acceptable risk range. Because of the high variability in ABS air values and the multiple sources of uncertainty in the process of estimating cancer risks, the boundary between acceptable and unacceptable is difficult to define with confidence.

It is important to note that these preliminary risk calculations are for *screening purposes only*. Results are based on toxicity factors that are presently available, and include the indoor and outdoor ABS air exposure pathways only (i.e., do not account for cumulative exposures). Consequently, these screening level risk calculations are not intended to support final risk management decision-making at any specific locations. Final risk evaluations will be presented in the Human Health Risk Assessment for Libby Operable Unit 4 (OU4).

FINAL	
This page intentionally left blank to facilitate double-sided printing.	

#### 1 Introduction

# 1.1 Site Background

Libby is a community in northwestern Montana that is located near a large open-pit vermiculite mine. Vermiculite from this mine contains varying levels of a form of asbestos referred to as Libby Amphibole (LA). Historic mining, milling, and processing operations at the Site, as well as bulk transfer of mining-related materials, tailings, and waste to locations throughout Libby Valley, are known to have resulted in releases of vermiculite and LA to the environment that have caused a range of adverse health effects in exposed people, including not only workers at the mine and processing facilities (Amandus and Wheeler 1987; McDonald et al. 1986, 2004; Whitehouse 2004; Sullivan 2007), but also in residents of Libby (Peipins et al. 2003, Noonan et al. 2006, Whitehouse et al. 2008).

Starting in 2000, the U.S. Environmental Protection Agency (EPA) began taking a range of cleanup actions at the site to reduce or eliminate sources of LA exposure to residents and workers. In the early stages, efforts were focused mainly on cleanup of locations containing the highest concentrations of LA and vermiculite-containing wastes and soil contamination, such as former vermiculite processing areas, area school running tracks, and some residences. As work progressed, attention shifted to cleanup of homes and workplaces in the main residential and commercial areas of Libby (Operable Unit [OU] 4). The protocol that EPA developed for investigating sources of LA at specific properties and deciding when to take action is detailed in a Technical Memorandum issued in December 2003 (EPA 2003). Cleanup actions taken under this protocol typically include removal of unenclosed vermiculite insulation from living spaces and other readily accessible spaces (e.g., unfinished attics), removal of some or all contaminated outdoor soils, and may, in some cases, include cleanup of indoor dusts.

#### 1.2 Purpose of this Document

The purpose of the Indoor and Outdoor Activity-Based Sampling (ABS) efforts was to evaluate the efficacy and protectiveness of the cleanup strategy taken in OU4 at the Libby Asbestos Site. That is, the following questions were investigated:

- At a property that EPA has investigated and found no reason to take any cleanup actions under the approach described in EPA (2003), are the risks that remain sufficiently small to be considered acceptable?
- At a property where EPA has investigated and determined that one or more sources was present that required cleanup under the approach described in EPA (2003), are the risks that remain after the cleanup is complete sufficiently small to be considered acceptable?

types – ex While prev evaluation Investigation	exposures that may remain at post-cleanup properties ³ may be divided into two main posures that occur inside the building and exposures that occur outside the building rious sampling efforts at the Libby site provide some data that are applicable to an of residual exposures (e.g., the Phase 2 Investigation, the Supplemental Remedial on Quality Assurance and Project Plan [SQAPP] Investigation), these data were d to be too limited to support reliable risk assessment or risk management decisions (a,b).
cleanup pr indoor and asbestos ii disturbanc measured conditions.	further investigate the residual levels of exposure and risk that may exist at post- operties, EPA developed two ABS programs designed to collect data on residual outdoor exposures. In brief, the Outdoor ABS program (EPA 2007a) measured n outdoor air in the immediate vicinity of an active soil disturbance under three soil e scenarios – mowing, raking, and digging. The Indoor ABS program (EPA 2007b) asbestos in indoor air under two dust disturbance scenarios – active and passive . Each ABS program also measured asbestos levels in the source materials that rbed (i.e., dust and soil).
2008. The studies and	r and Outdoor ABS sampling programs were conducted from May 2007 through June purpose of this document is to summarize the results of the Indoor and Outdoor ABS d present estimates of residual exposure and risk that may exist inside and outside at up properties in Libby to evaluate the efficacy and protectiveness of the current rategy.
soil and me feasible, d Instead, it	ment also includes an analysis of the relationship between various metrics of LA in easurements of LA in ABS air. This relationship is important because it is not ue to both time and cost considerations, to perform ABS at every property in Libby. is expected that risk managers will rely upon an extrapolation of ABS results between milar LA contamination in soil to make cleanup decisions.
1.3 D	ocument Organization
In addition	to this introduction, this report is organized into the following sections:
Section 2	This section summarizes data management procedures, including sample collection, documentation, handling, custody, and data management.
Section 3	This section summarizes the analytical methods used for estimating the level of LA ir air, dust, and soil, and the data reduction methods utilized in this report.
Section 4	This section summarizes the data that were collected for outdoor ABS air, including an evaluation of the relationship between the level of LA in outdoor ABS air and in

the soil being disturbed.

³ The term "post-cleanup property" is used to indicate any property where EPA has investigated sources and has either taken cleanup action or else determined that no cleanup action was needed under the current decision-making protocol (EPA 2003).

Section 5	This section summarizes the data that were collected for indoor ABS air, including an evaluation of the relationship between the level of LA in indoor air and in potential source media.
Section 6	This section presents a screening-level risk characterization for residential exposures.
Section 7	This section presents the results of the data quality assessment, including a summary of program audits, modifications, data verification efforts, an evaluation of quality control samples, and a data adequacy assessment.
Section 8	This section provides full citations for all analytical methods, site-related documents, and scientific publications referenced in this document.
	nced tables and figures are provided at the end of this document. All referenced es and attachments are provided electronically on the included CDs.

This page intentionally left blank to	o facilitate double-si	ded printing.	
			·

# 2 Data Management

# 2.1 Sample Collection, Documentation, Handling, and Custody

All air, dust, and soil samples generated as part of the ABS program were collected, documented, and handled in accord with standard operating procedures (SOPs) as specified in the respective Indoor and Outdoor ABS Sampling and Analysis Plans (SAPs) (EPA 2007a,b). All ABS activities were conducted in accord with EPA's Emergency Response Team (ERT) SOP #2084, *Activity-Based Air Sampling for Asbestos*, with project-specific modifications (EPA 2007a,b).

All ABS samples collected were identified with sample index identification numbers (Index IDs) that included a program-specific prefix of "IN" for Indoor ABS program samples or "EX" for Outdoor ABS program samples (e.g., IN-00001, EX-00001). Data on the sample type, location, collection method, and collection date of all samples were recorded both in a field log book maintained by the field sampling team and on a field sample data sheet (FSDS) designed to facilitate data entry into the Libby site database (see below). All samples collected in the field were maintained under chain of custody during sample handling, preparation, shipment, and analysis.

# 2.2 Analytical Results Recording

Standardized data entry spreadsheets (electronic data deliverables, or EDDs) have been developed specifically for the Libby project to ensure consistency between laboratories in the presentation and submittal of analytical data. In general, a unique EDD has been developed for each type of analytical method. Each EDD provides the analyst with a standardized laboratory bench sheet and accompanying data entry form for recording analytical data. The data entry forms contain a variety of built-in quality control functions that improve the accuracy of data entry and help maintain data integrity. These spreadsheets also perform automatic computations of analytical input parameters (e.g., sensitivity, dilution factors, and concentration), thus reducing the likelihood of analyst calculation errors. The EDDs generated by the laboratories are uploaded directly into the Libby site database (see below).

#### 2.3 Hard Copy Data Management

Hard copies of all FSDSs, field log books, and chain of custody forms generated during the ABS sampling program are stored in the CDM field office in Libby, Montana. Appendix A of this report (provided electronically) provides copies of all the FSDS and chain of custody forms for samples collected as part of the ABS program.

Hard copies of all analytical bench sheets are included in the analytical laboratory reports. These analytical reports are submitted to the Libby Laboratory Coordinator and stored at the CDM offices in Denver, Colorado. Appendix A of this report provides copies of all the analytical laboratory reports for analyses performed as part of the ABS program.

2.4	Electro	nic Data	Manag	ement
-----	---------	----------	-------	-------

Sample and analytical electronic data are stored and maintained in the Libby site project database (referred to as the Libby2DB) which is housed on a SQL server at the EPA Region 8 office in Denver, Colorado. Raw data summarized in this report were downloaded from the Libby2DB on December 8, 2009, into a Microsoft Access® database by SRC, Inc. A copy of this Access database is provided in Appendix B of this report. Any changes made to the Libby2DB since this download will not be reflected in the Access database.

(Note: Since the collection of the Indoor and Outdoor ABS data in 2007-2008, addresses recorded in the Libby2DB were updated to reflect street naming conventions and house identifiers in the 911 emergency database (e911). For the purposes of this report, all addresses presented are pre-e911 (i.e., e911 changes are not reflected), to ensure consistency with the hard copy ABS documentation presented in Appendix A. Appendix B provides detailed information on which ABS property addresses have changed due to e911.)

# 3 Analysis Methods and Data Reduction

# 3.1 Transmission Electron Microscopy Analysis of Air and Dust Samples

## 3.1.1 Sample Preparation

If air samples were not deemed to be overloaded by particulates⁴, filters were directly prepared for analysis by transmission electron microscopy (TEM) in accord with the preparation methods provided in ISO 10312 (ISO 1995).

If air samples were deemed to be overloaded, samples were prepared indirectly in accord with the procedures in SOP EPA-LIBBY-08. In brief, in an indirect preparation, rinsate or ashed residue from the original filter is suspended in water and sonicated, and an aliquot of this water is applied to a second filter which is then used to prepare a set of TEM grids. If there was no loose material present in the air cassette or adhering to the cowl, the indirect preparation method was performed as specified in ISO 13794, except that the total solution volume was increased from 40 mL to 100 mL, and a portion of the original filter was retained. If there was loose material present in the air cassette or adhering to the cowl, the indirect preparation procedure was performed as specified in ASTM D-5755, except that an ashing of the primary filter was included. A discussion of the potential influence of indirect preparation techniques on reported TEM air concentrations is presented in Section 6.4.

All dust samples were prepared indirectly (usually without ashing, as determined by the analyst) in accord with the procedures in SOP EPA-LIBBY-08. For dust samples, the indirect preparation procedure is equivalent to the method specified in ASTM D-5755.

#### 3.1.2 Sample Analysis

Air and dust samples collected as part of the ABS program were analyzed by TEM in basic accord with the counting and recording rules specified in ISO 10312 (ISO 1995), and the ABS-specific counting rule modifications specified in the respective Indoor and Outdoor ABS SAPs (EPA 2007a,b). These modifications included changing the recording rule to include structures with an aspect ratio ≥ 3:1. The medium- and task-specific target sensitivities for TEM were specified in the ABS SAPs (EPA 2007a,b).

When a sample is analyzed by TEM, the analyst records the size (length, width) and mineral type of each individual asbestos structure that is observed. Mineral type is determined by Selected Area Electron Diffraction (SAED) and Energy Dispersive Spectroscopy (EDS), and each structure is assigned to one of the following four categories:

⁴ Overloaded is defined as >25% obscuration on the majority of the grid openings (see Libby Laboratory Modification #LB-000016 and SOP EPA-LIBBY-08).

LA	Libby-class amphibole. Structures having an amphibole SAED pattern and an elemental composition similar to the range of fiber types observed in ores from the Libby mine (Meeker et al. 2003). This is a sodic tremolitic solid solution series of minerals including winchite, richterite, and tremolite, with lower amounts of magnesio-arfvedsonite,	[
OA	Other amphibole-type asbestos fibers. Structures having an amphibole SAED pattern and an elemental composition that is not similar to fiber types from the Libby mine. Examples include crocidolite, amosite, and anthophyllite. There is presently no evidence that these fibers are associated with the Libby mine.	
С	Chrysotile fibers. Structures having a serpentine SAED pattern and an elemental composition characteristic of chrysotile. There is presently no evidence that these fibers are associated with the Libby mine.	[
NAM	Non-asbestos material. These may include non-asbestos mineral fibers such as gypsum, glass, or clay, and may also include various types of organic and synthetic fibers derived from carpets, hair, etc.	[
counta	purposes of this report, air concentrations and dust loading values are based on ble LA structures only (i.e., results for other amphibole-type asbestos and chrysotile are cussed). Two alternative estimates of concentration are used in this report:	
•	Total LA. This measure includes all LA structures that satisfy the TEM counting rules specified in the SAP (length > 0.5 um, aspect ratio ≥ 3:1).	
•	PCME LA. This measure includes only a sub-set of the total LA structures that satisfy the counting rules (length > 5 um, width ≥ 0.25 um, aspect ratio ≥ 3:1) used in Phase Contrast Microscopy (PCM). For convenience, structures that are indentified under TEM that meet PCM counting rules are referred to as PCM-equivalent (PCME).	
(air) or PCM o	document, results of TEM analyses are generally expressed in units of PCME LA s/cc PCME LA s/cm ² (dust). This is because asbestos concentrations must be expressed as r PCME in order to perform risk calculations (see Section 6). Tabular data summaries the data expressed in terms of total LA and PCME LA.	
PCME. terms of concer total LA	are two alternative approaches available for deriving concentration values in units of The first (and most direct) approach is to express the concentration of each sample in of the PCME structures observed in that sample. The second approach is to express the stration of LA in each sample in terms of the total LA in that sample, and then multiply the A concentration by a value that represents the average fraction of total LA structures that PCME counting rules. For this evaluation, the first approach was followed.	

# 3.1.3 Calculation of Air Concentration and Dust Loading Values

The concentration of LA in air is given by:

Air Concentration (s/cc) = N · S

where:

N = Number of structures observed

S = Sensitivity (cc⁻¹)

For air, the sensitivity is calculated as:

$$S = \frac{EFA}{GO \cdot Ago \cdot V \cdot 1000 \cdot F}$$

where:

S = Sensitivity for air  $(cc^{-1})$ 

EFA = Effective area of the filter (mm²)
GO = Number of grid openings examined

Ago = Area of a grid opening  $(mm^2)$ 

V = Volume of air passed through the filter (L)

1000 = Conversion factor (cc/L)

F = Fraction of primary filter deposited on secondary filter (indirect preparation only)

For dust, results are expressed as loading (s/cm²), which is calculated as follows:

Dust loading (s/cm²) =  $N \cdot S$ 

For dust, the sensitivity is calculated as:

$$S = \frac{EFA}{GO \cdot Ago \cdot SA \cdot F}$$

where:

S = Sensitivity for dust  $(cm^{-2})$ 

EFA = Effective area of the filter (mm²)
GO = Number of grid openings examined

Ago = Area of a grid opening (mm²) SA = Area of surface collection (cm²)

F = Fraction of primary sample deposited on secondary filter

	3.1.4	Combinina	Results from	Multiple	Samples
--	-------	-----------	--------------	----------	---------

When the exposure metric of concern is the average concentration across a set of multiple samples, the best estimate of the mean concentration is calculated simply by averaging the individual concentration values. Note that samples with a count of zero (and hence a concentration or loading of zero) are evaluated as zero when computing the best estimate of the mean (EPA 2008b). This approach yields an unbiased estimate of the true mean that does not depend on the analytical sensitivity of the samples included in the data set.

## 3.1.5 Estimating Confidence Bounds

#### For an Individual Sample

The uncertainty around a TEM estimate of asbestos concentration in a sample is a function of the number of structures observed during the analysis. The 95% confidence interval around a count of N structures is given by:

```
LB = ½·CHIINV[0.025, 2N+1]
UB = ½·CHIINV[0.975, 2N+1]
```

#### where:

LB = Lower bound on the 95% confidence interval on N

UB = Upper bound on the 95% confidence interval on N

CHIINV = Inverse chi-squared cumulative distribution function

N = Number of structures observed

As N increases, the absolute width of the confidence interval increases, but the relative uncertainty [expressed as the confidence interval (CI) divided by the observed value (N)] decreases.

Using this approach, the equation for calculation of the upper and lower bounds on the air concentration or dust loading of asbestos structures is:

Air Concentration (s/cc) or Dust Loading (s/cm²) = (LB or UB) · S

#### where:

LB or UB = Number of structures based on lower bound (LB) or upper bound (UB) S = Sensitivity (cc⁻¹ for air or cm⁻² for dust)

#### Across Multiple Samples

Calculation of the uncertainty bounds around the average of a group of asbestos samples is complicated by the fact that the between-sample variability in the measured concentration values includes the between-sample variability that arises from both analytical measurement

	FINAL
error in individual samples and from between-sample temporal or spatial variability. EPA not developed a method for calculating uncertainty bounds around the mean of asbestos sets, so no uncertainty bounds are provided in this report for mean values. However, it is important to recognize that the values are uncertain, and that actual values might be eith higher or lower than reported.	
3.2	Polarized Light Microscopy Analysis of Soil Samples
3.2.1	Sample Preparation
Soil sa	mples collected as part of the ABS program were prepared for analysis in accord with

Soil samples collected as part of the ABS program were prepared for analysis in accord with SOP ISSI-LIBBY-01 as specified in the CDM Close Support Facility (CSF) Soil Preparation Plan (SPP) (CDM 2004). In brief, each soil sample is dried and sieved through a ¼ inch screen. Particles retained on the screen (if any) are referred to as the "coarse" fraction. Particles passing through the screen are referred to as the fine fraction, and this fraction is ground by passing it through a plate grinder. The resulting material is referred to as the "fine ground" fraction. The fine ground fraction is split into four equal aliquots; one aliquot is submitted for analysis and the remaining aliquots are archived at the CSF.

# 3.2.2 Sample Analysis

Soil samples collected as part of the ABS program were analyzed using polarized light microscopy (PLM). The coarse fractions were examined using stereomicroscopy, and any particles of asbestos (confirmed by PLM) were removed and weighed in accord with SRC-LIBBY-01 (referred to as "PLM-Grav"). The fine ground aliquots were analyzed using a Libby-specific PLM method using visual area estimation, as detailed in SOP SRC-LIBBY-03. For convenience, this method is referred to as "PLM-VE".

PLM-VE is a semi-quantitative method that utilizes site-specific LA reference materials to allow assignment of fine ground samples into one of four "bins", as follows:

- Bin A (ND): non-detect
- Bin B1 (Trace): detected at levels lower than the 0.2% LA reference material
- Bin B2 (<1%): detected at levels lower than the 1% LA reference material but higher than the 0.2% LA reference material
- Bin C: LA detected at levels greater than or equal to the 1% LA reference material

Of the 412 soil field samples collected during the ABS program, 155 samples had a coarse fraction, and all of these samples were reported as non-detect for LA when analyzed by PLM-Grav. Because of this, this report focuses on the PLM-VE results for the fine ground fraction only.

#### 3.3 Soil Visual Inspection

At the time of soil sample collection for PLM analysis, the sampling team performed a visual inspection of the displaced soil at each sampling point to determine if visible vermiculite was

FINAL
present in accord with SOP CDM-LIBBY-06. A semi-quantitative estimate (none, low, moderate ⁵ , high) of the amount of visible vermiculite present was noted for each sampling point. A count of the number of sampling points assigned to each visible vermiculite ranking was recorded on the FSDS in the sample comments (e.g., 18 none [X], 6 low [L], 4 moderate [M], 2 high [H]).
There are several alternative ways that this visual inspection data can be used to characterize the level of vermiculite contamination (and presumptive LA contamination) in an ABS area. It is not possible to identify, <i>a priori</i> , a preferred visual inspection metric without investigating which may be the most useful predictor of ABS air concentrations (see Sections 4.2.4 and 5.2.4).
Option 1: Present/Absent
The simplest strategy classifies an ABS area either as "Vis –" if all sampling points in the composite were assigned a value of "none", or as "Vis +" if one or more of the sampling points were assigned a value of "low", "moderate", or "high".
A potential limitation to this ranking strategy is that it does not account for differences in the amount or frequency of visible vermiculite detections. For example, an ABS area with 1 "low" point and 29 "none" points and an ABS area with 30 "high" points would both be ranked as "Vis +".
Option 2: Detection Frequency
In this approach, an ABS area is assigned a value equal to the detection frequency by visible inspection. For example, an ABS area with 1 "low" point and 29 "none" points would receive a value of 1/30 (3.3%), while an ABS area with 1 "none" point and 29 "high" points would receive a score of 29/30 (97%).
While it is expected that detection frequency will tend to increase as a function of the level of soil contamination, it is important to note that detection frequency is not sensitive to the levels of contamination observed. For example, an ABS area with 5 "low" points and 25 "none" points would have the same detection frequency (5/30) as an ABS area with 5 "high" points and 25 "none" points.
Option 3: Amount-Weighted Score
In this approach, both the frequency and the level of vermiculite are considered. This is achieved by assigning a weighting factor to each level, where the weighting factors are intended to represent the relative levels of vermiculite in each category. As presented in SOP CDM-LIBBY-06, the guidelines for assigning levels are as follows:

⁵ The visual inspection SOP CDM-LIBBY-06 uses the terminology "intermediate" to refer to the "moderate" classification. For the purposes of this document, the term "moderate" is retained to correspond with the accompanying ABS field documentation.

None =

No flakes of vermiculite detected observed within the inspection point.

Low =

A maximum of a few flakes of vermiculite observed within the inspection

point.

Moderate/High =

Vermiculite easily observed throughout the inspection point, including the

surface. A ranking of High is reserved for samples that are 50% or more

vermiculite. Others (<50%) are assigned a ranking of Moderate.

Based on these descriptions, the weighting factors that were used in this evaluation are as follows:

Visible Vermiculite Level (L _i )	Weighting factor (W _i )
None	0
Low	1
Moderate	3
High	10

The score is then the weighted sum of the observations for the area:

$$Score = \frac{\sum_{i=1}^{30} L_i \cdot W_i}{30}$$

This value can range from zero (all 30 points are "none") to a maximum of 10 (all 30 points are "high"). For example, an ABS area with 1 "low" point and 29 "none" points would receive a score of 1/30 = 0.033, while an ABS area with 25 "moderate" points and 5 "high" would receive a score of (25.3 + 5.10) / 30 = 4.17.

111/12	
This page intentionally left blank to facilitate double-sided printing.	

4 Outdoor Activity-Based Sampling Summary and Evalua	ctivity	Outdoor	4
------------------------------------------------------	---------	---------	---

# 4.1 Study Design

Detailed information on the Outdoor ABS study design and program-specific data quality objectives (DQOs) are provided in the Outdoor ABS SAP (EPA 2007a; 2008a). In brief, the purpose of the study was to obtain sufficient outdoor ABS air data to determine if any of the residual sources of LA contamination in outdoor soil pose an unacceptable risk to human health. The DQOs identified two decisions that were to be addressed by the Outdoor ABS study:

- 1. Is the current strategy for cleaning up outdoor soil in OU4 adequate to provide health protection from exposures that occur when residents disturb the soil?
- 2. If not, what characteristics of the soil (e.g., presence of visible vermiculite and/or PLM VE result) can be used to recognize areas that require further cleanup?

An overview of the study design developed to address these questions is summarized below.

## 4.1.1 Sampling Locations

Sampling locations evaluated as part of the Outdoor ABS program were selected to be representative of the range of types and levels of residual sources that may remain in post-cleanup areas. In brief, outdoor ABS locations were stratified into 5 soil categories based on the existing PLM-VE soil sample results and the existing information on visual presence or absence of vermiculite, as follows:

Soil	Residual Source		
Category	PLM-VE Analysis for LA	Visual Presence of Vermiculite	
1	None (Clean Fill ⁶ )		
2	Bin A (ND)	No	
3		Yes	
4	Bin B1 (Trace)	Either Yes or No	
5	Bin B2 (<1%)	Either Yes or No	

After soliciting cooperation from area residents, a total of 75 outdoor ABS locations were selected for participation in the study, with 14-16 properties per category:

⁶ "Clean fill" is soil material that is brought in from borrow pits located in the Libby Valley and in Eureka, Montana to replace materials that have been removed as part of a soil cleanup. Because these fill materials are not exposed until excavation, it is believed that they are not impacted by mining-related releases.

Category	Number of locations	
1	15	
2	15	
3	15	
4	14	
5	16	
Total	75	

These outdoor ABS sampling locations were selected to provide a reasonable spatial representation in OU4 (i.e., north, central, and south Libby). A total of 75 outdoor ABS locations at 62 different properties were sampled. Figure 4-1 shows the locations of these properties. Table 4-1 provides detailed information on the types of cleanup actions that have been performed at each property.

#### 4.1.2 Disturbance Scenarios

Residents may disturb soil in their yards by a wide variety of activities. Because it is not feasible to evaluate every possible type of disturbance that may occur under residential land use conditions, the Outdoor ABS program focused on three standardized scenarios which are considered to be realistic examples of relatively vigorous soil disturbance activities:

- Raking the lawn or yard with a metal-tined leaf rake
- Mowing the yard with a gasoline-powered rotary lawn mower
- Digging in the soil with a shovel and pail (simulating a child playing)

During each ABS sampling event, soil disturbance activities were performed over a 6-hour time interval, divided into three sub-periods of 2 hours each (one for each disturbance scenario). All soil disturbance activities were performed in accord with a standard ABS "script" by EPA contractor personnel.

## 4.1.3 Sampling Dates

Because the levels of LA in outdoor ABS air generated during soil disturbance scenarios may depend on factors that vary seasonally (e.g., soil moisture, wind speed, humidity), the Outdoor ABS program targeted two sampling periods intended to span a range of soil moisture and meteorological conditions. Outdoor ABS Round 1 (summer) was performed from July to August 2007 and Outdoor ABS Round 2 (spring) was performed from April to June 2008. The same outdoor ABS locations were evaluated in both rounds.

#### 4.1.4 Sample Collection and Analysis

## 4.1.4.1 <u>Air Samples</u>

As noted above, three different disturbance scenarios were evaluated at each outdoor ABS location. During each disturbance scenario, the individual performing the activity wore two

personal air monitors (high volume and low volume) to collect air samples for asbestos analysis. The filter cassette for each monitor was placed such that the samples collected were representative of the breathing zone of the individual performing the disturbance activity (i.e., a hemisphere approximately 6 to 9 inches around an individual's face). All outdoor ABS air samples were collected in basic accord with procedures provided in EPA-LIBBY-01 and ERT SOP#2084.

The high volume sample was collected using a pump with a flow rate of 10 L/min (total air volume of 1,200 L), and the low volume sample was collected using a pump with a flow rate of 3 L/min (total air volume of 360 L) (EPA 2007d). The high volume sample was analyzed in preference to the low volume sample because maximizing the total air volume collected reduced the level of effort needed to achieve the target analytical sensitivity. In cases where the high volume sample was damaged or lost, the low volume was substituted. Unanalyzed low volume samples were archived at the Libby Field Office in Libby, MT. Prepared TEM grids and unused portions of the analyzed filters were archived at the analytical laboratory.

As specified in the Outdoor ABS SAP, each soil disturbance activity was planned to span a 2-hour time interval. However, in Round 1, the laboratories reported that a high number of filters were overloaded and would require indirect preparation. In an attempt to reduce the number of overloaded samples, the sample collection protocol was modified (see Outdoor ABS SAP Mod 1 in Appendix F) to stop the sample collection if the filter became overloaded (based on a visual inspection in the field). This modification was in effect in Round 1 from August 16 through August 24, 2007⁷. Section 7.5.1 discusses the potential impact of air samples with sample durations less than 2 hours on data interpretation. After August 24, 2007 (i.e., in Round 2), this modification was no longer implemented and sampling methods continued in accord with the procedures presented in the Outdoor ABS SAP.

All outdoor air samples were submitted to one of the subcontracted Libby laboratories for asbestos analysis by TEM in basic accord with the counting and recording rules specified in ISO 10312 (ISO 1995), and the ABS-specific counting rule modifications (EPA 2007a). The target analytical sensitivity for all outdoor ABS air samples was 0.001 cc⁻¹.

## 4.1.4.2 Soil Samples

In each sampling round, prior to the start of ABS activities, a qualitative estimate of soil moisture at each ABS location was determined in the field by the "hand appearance" method. A detailed description of this method is provided in the Outdoor ABS SAP. In brief, this procedure is performed by firmly squeezing a handful of soil and observing how easily the soil forms a ball and breaks apart under pressure. This evaluation was performed using a soil sample collected from a minimum of 5 sub-areas representing the ABS area from a depth of 0-2 inches below ground surface. In Round 1, ABS activities were not performed if the soil moisture deficiency was less than 50% or if greater than 1/10-inch of rain had fallen in the previous 36 hours. In Round 2, a strict soil moisture deficiency restriction was not applied; but, ABS activities were not performed in areas with standing water or while it was raining (EPA 2008a).

⁷ Round 1 of sampling ended on August 24, 2007.

In Round 1, one 30-point composite soil sample was collected from each outdoor ABS location. The composite sample was collected such that the entire ABS location was represented by the sample (i.e., the 30 sampling points were spread across the entire ABS area). Upon reviewing the preliminary results from Round 1, it was determined that, while this 30-point composite sample was representative of the areas disturbed during the mowing and raking scenarios, it was not necessarily a reliable indicator of the soil where the digging scenario occurred, since digging was conducted at only two specific sub-areas within the ABS area. To address this issue, two different soil samples were collected from each outdoor ABS location in Round 2 (EPA 2008a). The first soil sample was a 30-point composite sample representative of the entire ABS area utilized in the raking and mowing scenarios (equivalent to what was collected in Round 1). The second soil sample was a 2-point composite sample collected from the two digging sub-areas (1 grab from each sub-area).

All soil samples collected as part of the Outdoor ABS program were sampled in accord with SOP CDM-LIBBY-05, and were prepared (dried, ground, sieved) and submitted for asbestos analysis by PLM. In addition, visual inspection data were collected and reported as described in Section 3.3 above.

### 4.2 Results

Appendix C presents the detailed raw data for all samples collected as part of the Outdoor ABS program.

#### 4.2.1 Overview of the Outdoor ABS Air Data

Results of the ABS air samples, stratified by ABS area and disturbance scenario, are presented in Table 4-2 (Round 1) and Table 4-3 (Round 2). Figure 4-2 displays the PCME LA air concentration data using two different formats to characterize the distribution of values observed. The upper panel presents the data in a "scatterplot" format and the lower panel presents the data as a "box-and-whisker". Note that, in both graphs, air concentration (the y-axis) is presented using a log-scale. Because samples with a concentration of zero cannot be plotted on a log-scale, for plotting purposes only they were assigned a value of 0.0001 s/cc, which is equal to the x-axis in the figure. Because scatterplots are often more difficult to assess and interpret than box-and-whisker graphs, especially when the emphasis is on a statistic rather than individual data points, this document will primarily utilize a box-and-whisker format for data presentation.

One important observation is the high variability between samples. In most cases, the range is at least 3 to 4 orders of magnitude. The cause of such high variability is not certain, but is probably a consequence of random variations in a number of factors that influence the release of LA from soil to air (e.g., concentration of LA in the soil, soil moisture, soil cover, duration and intensity of the disturbance, wind speed) as well as random sampling variation and Poisson counting error.

Although there is substantial overlap between all of the data sets, two trends seem apparent8:

- Within each of the two rounds, air concentrations associated with the mowing and digging scenarios tend to be higher than concentrations associated with raking.
- For all activities, air concentrations in Round 1 (summer) tend to be higher than in Round 2 (spring).

The reason for the generally lower release of LA in Round 2 compared to Round 1 is not known. Two factors that might be important are the moisture content of the soil and the extent of vegetative cover at the time of the ABS event. Data on soil moisture and percent vegetative cover were collected at each ABS study area in both Round 1 and Round 2. Pair-wise comparisons of the data are summarized below:

Round 2 vs.	Metric		
Round 1	Soil	Vegetative	
Round	Moisture	Cover	
Increase	39	16	
Decrease	4	12	
No Change	32	47	
Total	75	75	

As seen, 39 of the outdoor ABS areas were ranked as having higher soil moisture in Round 2 than Round 1, while only 4 ABS areas were ranked as having lower soil moisture in Round 2 than Round 1. This suggests that increased soil moisture might be one factor contributing to the generally lower releases in Round 2 compared to Round 1. Differences in the extent of vegetative cover do not appear to be as important. Defining a meaningful change in grass cover as an increase or a decrease of more than 10%, there were approximately an equal number of ABS areas with increased cover (16) and decreased cover (12) in Round 2 compared to Round 1, with a change of less than 10% in the remaining areas.

## 4.2.2 Correlation of ABS Air Within and Between Rounds

Table 4-4 presents the Pearson product moment and the Spearman rank order correlation coefficients that characterize the degree to which there is a relationship in the ABS air concentrations between ABS samples associated with different activities performed at a location within a sampling round. As seen, for Round 1 there was a fairly high correlation between the ABS air concentrations associated with different activities at a location. This means that if the ABS air sample for one activity at a location was high, then the ABS air samples for the other two activities also tended to be high at that location. In Round 2, the correlations tended to be somewhat lower.

⁸ At present, no statistical method has been developed that is suitable for use with data sets that are similar to those observed in Libby for comparing two asbestos data sets in order to estimate the probability (*p* value) that one set is different from another.

Table 4-5 presents the Pearson and Spearman coefficients that characterize the degree of correlation between ABS air samples for the same activity performed at the same location at different times (Round 1 vs. Round 2). As indicated, the correlations are not strong, especially for the Pearson product moment method. This indicates that the between-round variability at a location is relatively large compared to the between-location variability.

#### 4.2.3 Overview of the Soil Data

## 4.2.3.1 Observed Levels

As discussed above, the level of LA in soil at each ABS study area was characterized using two alternative soil metrics (PLM-VE and visible vermiculite inspection) in both Round 1 and Round 2. Table 4-6 presents the Outdoor ABS soil data.

Table 4-7 summarizes the frequency of soil levels observed in Round 1 and Round 2 based on the 30-point composite samples. As seen, the soil data span a range of levels, although a majority of the samples are at the low end of the range, both for PLM-VE (more than ¾ of the results are Bin A) and for visual inspection score (more than ¾ of the samples have a score < 0.5). This is expected for outdoor areas that have undergone inspection and cleanup.

#### 4.2.3.2 Comparison of PLM-VE Results Between Sampling Rounds

Table 4-8 presents a pair-wise comparison of the PLM-VE results from Round 1 and Round 2. Results were ranked as concordant if both the Round 1 and the Round 2 PLM-VE soil sample results were the same semi-quantitative classification (cells shaded in dark grey). Results were ranked as weakly discordant if the Round 1 result and the Round 2 result differed by one semi-quantitative classification (e.g., Bin A vs. Bin B1) (cells shaded in light grey). Results were ranked as strongly discordant if the results differed by more than one semi-quantitative classification (e.g., Bin A vs. Bin B2) (cells are not shaded).

As seen, 56 of 75 outdoor ABS areas (75%) were ranked as having concordant PLM-VE results. When results were discordant, they were usually only weakly discordant (17 out of 75 = 23%). There were only two samples (<3%) ranked as strongly discordant. The differences noted between sampling rounds may be due to one or more of the following factors: a) authentic changes in soil levels between rounds, b) spatial variability in LA levels within each ABS area, and c) analytical variability associated with the PLM-VE method.

#### 4.2.3.3 Comparison of Visible Vermiculite Data Between Sampling Rounds

Figure 4-3 compares the visible vermiculite results from Round 1 with Round 2. Results based on the detection frequency approach are shown in Panel A, and results based on the visible score are shown in Panel B. The Pearson correlation coefficients are 0.775 for detection frequency and 0.731 for score, both of which are statistically significant (p < 0.001). This indicates that, on average, there is a clear relationship in visible inspection results between rounds. However, there is still substantial between-round variability in individual results, both for detection frequency (Panel A) and visible score (Panel B). This variability is likely due to the

combined effect of two factors: sampling variability and "analytical" variability. Sampling variability arises because vermiculite levels are not uniform over the entire ABS area, and the 30 sampling points selected for examination in Round 2 are not identical to the 30 sampling points selected for examination in Round 1. "Analytical" variability (i.e., differences in the assignment of level [none, low, moderate, high] at each point) arises from the inherently subjective nature of the assignment, as well as variations in site conditions between rounds (e.g., cloud cover vs. sunshine, amount of ground cover, soil moisture, etc.).

## 4.2.3.4 Relative Sensitivity of PLM-VE vs. Visible Inspection

Inspection of the data in Table 4-6 reveals that, if an ABS area contains LA that is detectable by analysis of a 30-point PLM-VE composite sample, it nearly always (43 out of 45 cases) also contains vermiculite that is detectable by visible inspection in soil from one or more inspection points. However, there are a number of ABS sampling locations (44 out of 104 cases) where vermiculite was detected by visible inspection at one or more points, but LA was not detected by PLM-VE analysis of the 30-point composite:

		Visible Inspection		
		Not Detect	Detect	
PLM-VE	Non-Detect	60	44	
FLIVI-VE	Detect	2	43	

These results suggest that visible inspection for vermiculite may be a somewhat more sensitive method for detecting contamination in soil than PLM-VE analysis of 30-point composite sample.

#### 4.2.4 Correlation of LA in ABS Air to LA in Soil

One of the potential uses of the data generated during the outdoor ABS study is to determine if the concentration of LA observed in outdoor air at an ABS study area can be correlated with (and predicted by) the concentration of LA in the soil being disturbed at that ABS study area.

In this regard, the relationship that is most important for the purposes of evaluating human exposure and risk is the correlation between the area-wide average level of vermiculite or LA in soil and the long-term average concentration of PCME LA in ABS air, combining across both activity and time (sampling round). This is because humans are expected to be exposed intermittently over a long period of time via a wide variety of different soil-disturbing activities. For this reason, the analyses that follow focus on the relation between soil and PCME LA ABS air values combined across activities and time. Analyses that display the relation stratified by both activity and round are presented in Appendix D.

Because two soil metrics are available (PLM-VE result and visible inspection data), either metric alone, or a combination of the two metrics, may be used to characterize the level of soil contamination at the time of the ABS event. Because the values of both metrics tended to vary somewhat between rounds (see above), the round-specific data were used rather than attempting to combine the soil metrics across rounds.

Note that the data needed for evaluation of the relationship between soil and ABS air are somewhat different for the digging activity than for the raking and mowing activities. This is because the digging activity occurred only in two discrete sub-locations of each ABS study area, so the area-wide 30-point PLM-VE and visible inspection data may not accurately reflect the conditions at the digging locations. In Round 2, both PLM and visible inspection data were collected for the two sub-locations where digging was performed, and these data are used to characterize the soil levels associated with the digging ABS air values for Round 2. However, in Round 1, soil data were not collected at the specific sub-locations where digging occurred. In the absence of these data, the 30-point PLM-VE and visible inspection data from Round 1 are used as an estimate of the soil level where digging occurred. This approach should be recognized as an approximation, and actual soil levels in Round 1 digging activities might be either higher or lower than the area-wide data indicate.

## 4.2.4.1 Air-Soil Correlation Based on PLM-VE Bins

Figure 4-4 summarizes the PCME LA concentrations measured in outdoor ABS air (combined across all disturbance scenarios), stratified by the PLM-VE bin result for the ABS area. In this figure, because there were only two ABS areas with a result of Bin C, results for Bin B2 and Bin C were combined.

As seen, there is substantial overlap in the distributions of ABS air concentration values for the three PLM-VE bins, but there is an apparent trend toward increased median concentrations in Round 1, Round 2, and both rounds combined. This trend is less apparent based on mean concentrations, principally due to a single high value reported in Bin A in Round 1.

Figure 4-5 shows the same data as Figure 4-4, except that the results for Bin A are stratified into three sub-groups: clean fill, Bin A without visible vermiculite (V-), and Bin A with visible vermiculite (V+). As seen, PCME LA air concentrations at outdoor ABS areas that were clean fill (i.e., where a cleanup had been performed) and at Bin A areas where visible vermiculite was absent (V-) generally tended to be lower than Bin A areas where visible vermiculite was present (V+). When combined across both rounds, a similar pattern is retained, with the mean PCME LA concentration values for clean fill and Bin A (V-) being similar to each other but lower than Bin A (V+).

#### 4.2.4.2 Air-Soil Correlation Based on Visual Vermiculite Observations

# Qualitative Approach

Figure 4-6 summarizes the distribution of PCME LA concentrations measured in ABS air (combined across all disturbance scenarios) stratified into two bins, depending on whether or not visible vermiculite was detected in any one of the soil inspection points assessed (e.g., 30 soil inspection points were evaluated for the 30-point composite soil sample). As seen, although there is substantial overlap of the distributions, the median and the mean both tend to be higher at locations where vermiculite was detected at least once than at locations where it was never detected.

Figure 4-7 presents a variation of this approach, in which each ABS area is stratified according to whether or not visible vermiculite was detected in each inspection round:

Visible Vermic	ulite Detected?	Category
Round 1	Round 1 Round 2	
No	No	Never Detected
No	Yes	Sometimes Detected
Yes	No	Sometimes Detected
Yes	Yes	Always Detected

Similar to the results for Figure 4-6, even though there is substantial overlap of the distributions, there is a tendency for both the median and the mean to increase as a function of between-round detection frequency (never < sometimes < always).

# Semi-Quantitative Approaches

Figure 4-8 presents a graph that shows the distribution of PCME LA concentrations measured in ABS air stratified into four bins, depending on the <u>frequency</u> that visible vermiculite was observed in each ABS area during the visible soil inspection (see Table 4-6). Figure 4-9 presents a similar figure, except that ABS areas are stratified according to the average <u>visible vermiculite score</u> (see Table 4-6) rather than the detection frequency. As seen, in both cases there is a general tendency for the mean concentration of PCME LA in ABS air to increase as the detection frequency or visible vermiculite score in soil increases.

One potential limitation to this semi-quantitative approach is that the choice of bin-widths for use in graphing is arbitrary (e.g., 0, >0 to 0.1, >0.1 to 0.5, etc.), and the statistics (especially the mean) of the bins and the appearance of the graphs may be altered by choosing different bin-widths. Because of this, the results generated using this approach should recognized as potentially variable.

### Quantitative (Regression) Approach

One way to minimize the problems associated with analysis of visible inspection data using a binning approach is to evaluate the data without binning, as shown in Figure 4-10 (based on detection frequency) and Figure 4-11 (based on visible score). Note that the mean PCME LA ABS air concentration values (averaged across scenarios) are plotted on the y-axis using a log-scale.

Inspection of these graphs re-emphasizes the relative high variability in ABS air concentrations that is observed, even when variations in soil concentration are accounted for. However, despite the high variability, there is an apparent upward trend in the data as detection frequency (Figure 4-10) or visible score (Figure 4-11) increases.

One of the potential advantages of plotting the data in this way is that the relationship between ABS air and the visible vermiculite soil metric may be quantified by fitting an appropriate mathematical model to the data. The detailed approach is presented in Attachment 1. In brief,

it is assumed that at any location "j" where the level of LA contamination in soil is " $x_j$ ", the set of ABS air concentrations observed at that location (C1_j, C2_j, C3_j, ...) will be characterized by a right-skewed distribution that is reasonably characterized as a Poisson-gamma distribution, with a mean concentration that tends to increase as the soil level "x" increases. The best fit model parameters for this model based on the combined data from Rounds 1 and 2 are summarized below:

Soil	Parameter Value		
Metric	a (f/cc)	b (f/cc per unit soil contamination)	
Visible detection frequency	0.0089	0.28	
Visible score	0.0093	0.21	

This approach may be used to predict the mean concentration of PCME LA in outdoor ABS air at a location where soil has been characterized by visual inspection, as follows:

Mean Concentration (PCME LA f/cc) = a + b · (Soil metric)

#### 4.3 Evaluation of Results from Clean Fill Areas

As noted above, clean fill is soil material that is brought in from borrow pits to replace materials that have been removed as part of a soil cleanup. Because these fill materials are not exposed until excavation, it is believed that they are not impacted by mining-related releases. There are multiple borrow pits located throughout the Libby Valley that have been used as a clean fill source. In addition, there is a borrow pit located in Eureka, Montana (which is 40 miles northeast of the site and outside the Libby Valley). Outdoor ABS data were collected at 15 ABS areas that were classified as having clean fill. Of these, 13 of the 15 locations had clean fill from borrow pits in the Libby Valley, and 2 locations had clean fill from Eureka.

Figure 4-12 shows the ABS data from these 15 locations, stratified by source of the fill material (Libby = triangles, Eureka = squares) and by the PLM and visual vermiculite observations of the soil at the time of the ABS activity. Contrary to what might have been expected, LA and/or visible vermiculite was observed in ABS areas that had clean fill, both from Libby and Eureka. As shown in the figure, there tends to be wide variability in the ABS results and substantial overlap of the data for Libby and Eureka soils. Mean concentrations of PCME LA in ABS air tend to be higher for locations where soil contamination was detected than for areas where it was not detected. However, in considering this observation, it is important to recognize that mean values can be strongly influenced by a few high data points, and that additional data would be needed to strengthen this conclusion. When results for Libby and Eureka are compared for similar soil levels, the results are generally similar. This suggests that the source of the fill material may not be a critical issue. However, because of the limited size of the dataset for areas with fill from Eureka, it is important to recognize that this conclusion is not certain.

# 4.4 Evaluation of Unexpected Results

During the evaluation of the ABS data and their relationship to soil, several air sample results were reported that were higher than had been anticipated based on the range of air levels measured for EPA workers doing cleanup activities at the site. In order to determine if these sample results were reliable, two follow-up activities were performed, as described below.

# 4.4.1 Sample Reanalysis

There were several outdoor ABS air samples collected in Round 1 where measured PCME LA air concentrations were unexpectedly high. In order to determine if the reported concentrations were in error, ten of the highest samples from Round 1 were re-analyzed to verify the reported concentrations.

Several options were considered for the best way to perform the re-evaluation and to detect any errors that might have occurred. One approach would be to simply re-count the same grids as were analyzed originally. However, if an error occurred at the level of grid identification, recounting the same grids would not reveal the error. Likewise, preparing new grids from the same filter would not detect an error at the level of filter mis-identification or preparation. For these reasons, the re-analysis was based on the low volume (LV) samples collected at the same time as the high volume (HV) samples that were used in the original analysis. Because the only difference between the HV and LV samples is the pump rate (and hence the amount of air passing through the filter), it is expected that the results for both samples should be similar.

Figure 4-13 presents a comparison of the original HV sample results to the corresponding LV re-analysis sample results. In this figure, the error bars represent the 95% CI. LV samples with results that were statistically different from the HV sample are circled. As seen, for 8 of the 10 samples re-analyzed, PCME LA concentrations in the LV sample were not statistically different from the HV sample (this included the four HV samples with the highest reported PCME LA concentrations). For 2 of the 10 samples, the LV result was lower than the HV result. The reason for the difference between the HV and LV results for these samples is not known, but the differences are relatively small and could be attributable to simple random variation. In any event, the results do not suggest that analytical error is a likely explanation for the relatively high and unexpected concentration values observed. In addition, because most LV results were not statistically different from the HV result, use of the LV samples in place of the HV samples would not significantly change estimates of exposure utilized in the screening level risk calculations (see Section 6, below).

#### 4.4.2 Review of Field Documentation

In order to determine if the field crews had observed anything during the sample collection process that might help explain unexpectedly high air values, the field documentation (e.g., field logbooks, cleanup checklists) were reviewed for potentially relevant information on two types of samples: a) the single highest air sample; and b) air samples collected at locations that were classified as "clean fill".

# **Highest Sample**

In Round 1, the highest measured PCME LA air concentration was 21 s/cc for the digging ABS sample (EX-00662) from 241 South Central Road. A review of the field documentation for this sample found that high levels of visible vermiculite were observed in the digging area during Round 1. However, visible levels noted in the corresponding 30-point soil composite were much lower (10-none; 15-low; 5-moderate). As noted previously, a digging-specific soil sample was not collected in Round 1. The field documentation review suggests that the 30-point composite results (both the PLM-VE and visual inspection) are not representative of soil conditions in the digging area. In addition, subsequent outdoor ABS soil sampling at this property conducted in Round 2 showed trace (Bin B1) LA levels in the front yard (in the same location that the Round 1 ABS sampling was performed).

Sample EX-00662 was one of the samples that was reanalyzed in November 2008 (see Section 4.4.1 above). The LV reanalysis reported a PCME LA air concentration of 12 s/cc, which was not statistically different from the original HV analysis. This indicates that the high result is not due to an analytical error in the original analysis.

# Clean Fill

In Round 1, several measured PCME LA air concentrations at outdoor ABS areas designated as "clean fill" were higher than had been expected. In order to determine if the areas where this occurred might have been misclassified (i.e., the ABS area was not entirely clean fill), field sampling conditions (as recorded in the field logbooks) and cleanup details (as recorded in the Property Completion Checklist [PCC]) were reviewed for each of the clean fill areas.

Table 4-9 summarizes the sampling conditions and property cleanup details for each clean fill area. Inspection of this table shows that sampling conditions at several "clean fill" properties may have influenced measured PCME LA concentrations in air.

For 280 South Central Road, inspection of the field documentation revealed that contamination may have migrated into the clean fill area from locations that were not remediated as part of the cleanup. At this property, significant amounts of visible vermiculite (moderate to high levels) were noted in the wooded areas completely surrounding this property. The yard soil cleanup performed at this property in June 2003 extended to the boundary between the wooded area and the maintained grass lawn (i.e., cleanup was not performed in the wooded area). Since the cleanup, the boundary between these areas has eroded back into the wooded area. In May 2008, field teams noted that vermiculite which clearly originated in the wooded area was present about 5-6 feet into the maintained lawn. Prior to the cleanup, LA levels in yard soils at this property were as high as 2% (as measured by PLM NIOSH 9002). In addition, the PCC for this property also noted that soil contamination in and on the side of the road (South Central Road) was not part of the exterior cleanup. Therefore, despite the fact that the 30-point soil sample was reported as non-detect by PLM-VE and "Vis —", it is possible that some portion of the ABS area may have been influenced by vermiculite contamination.

ABS activities at property 281 South Central Road (located across the street from property 280 South Central Road) may have also been influenced by residual soil contamination along the road.

For both of these properties, low levels of visible vermiculite were noted in the sub-locations selected for the digging scenario, despite the fact that the ABS area was ranked as "Vis –" based on the 30-point visual inspection. This soil contamination in the areas of digging may explain the higher than expected air results.

Based on these findings, it is concluded that the ABS air results from some of the clean fill ABS areas may have been influenced by contamination that is not inherently associated with the clean fill material. However, review of the field documentation for a number of other clean fill ABS areas did not reveal any reliable indications of contamination. Consequently, results from the ABS sampling at clean fill properties are used without exclusion of any of the data points.

# 4.5 Summary and Discussion

In this effort, a total 75 outdoor ABS sampling areas at 62 different properties in Libby were investigated. At each outdoor ABS area, 3 outdoor ABS air samples were collected in each of two sampling rounds, generating a total of 450 ABS air samples. Each air sample was analyzed for LA using TEM.

There was high variability in the concentration of PCME LA observed in the outdoor ABS air samples, ranging from non-detect (usually < 0.001 s/cc) to more than 20 s/cc. On average, the air concentration values associated with mowing and digging tended to be similar, with the values for raking tending to be somewhat lower. There was relatively high variability between sampling rounds, with Round 1 (summer) tending to yield higher air concentration values than Round 2 (spring). This between-round variability may be attributable to variability in soil moisture content between rounds.

The relationship between LA levels in outdoor ABS air and the level of LA in soil was investigated using several different strategies for characterizing the level of soil contamination, including:

- Binning based on PLM-VE results
- Binning based on PLM-VE combined with visible vermiculite data
- Binning based on visible vermiculite detection frequency or visible score
- Poisson regression based on visible vermiculite detection frequency or visible score

In most cases, the average level of PCME LA in ABS air tended to increase as a function of increasing levels of LA in soil, although the strength of the trend varied somewhat between different methods for characterizing the level of soil contamination. No single method appeared to provide results that were inherently superior to others.

This page intentionally left blank to	facilitate double-sided pri	nting.	

# 5 Indoor Activity-Based Sampling Summary and Evaluation

# 5.1 Study Design

Detailed information on the Indoor ABS study design and program-specific DQOs are provided in the Indoor ABS SAP (EPA 2007b). In brief, the purpose of the study was to collect data needed to characterize the level of residual exposure and risk from indoor exposures that may remain at post-cleanup properties, and, if some properties had residual risk above a level of concern, to identify the most likely residual source(s) contributing to the contamination so that the cleanup strategy may be revised to increase protectiveness. A secondary goal of the study was to collect sufficient data on the levels of LA in indoor air and in potential source media (e.g., indoor dust, outdoor soil, ambient air) that a quantitative model may be developed to predict indoor air levels from data on source levels with sufficient accuracy to support cleanup and risk management decisions. Based on these objectives, the DQOs identified three decisions that were to be addressed by the Indoor ABS study:

- 1. Are current strategies for cleaning up properties in OU4 adequate to provide health protection from exposure in indoor air?
- 2. If indoor air levels are above a level of concern in some post-cleanup building, what are the residual indoor or outdoor sources most likely to be responsible?
- 3. Do the data indicate a quantifiable relationship between the level and extent of LA in residual sources and the level observed in indoor air? If so, can long-term average exposure levels be predicted with sufficient accuracy to be useful in risk assessment and risk management decision-making?

An overview of the study design developed to address these questions is summarized below.

## 5.1.1 Sampling Locations

Sampling locations evaluated as part of the Indoor ABS program were selected to be representative of the range of types and levels of residual sources that may remain at post-cleanup locations. In brief, post-cleanup properties were to be stratified into 4 categories based on whether or not previous outdoor soil cleanup actions had been taken and on what levels remained in soil post-cleanup as follows:

Category	Did outdoor soil cleanup take	Post-cleanup Surface Soil			
	place?	VCS		PLM	
1	No	-	and	•	
2	INU	+	or	+	
3	Yes	-	and	-	
4	162	+	and	-	

VCS: vermiculite-containing soil is present (+) or absent (-)

PLM: LA result is detect (+) or non-detect (-)

After soliciting cooperation from area residents, a total of 80 indoor ABS properties (with one extra property selected as a backup in Category 2) were selected for participation in the study, with 19-21 properties per category:

Category	Number of properties	
1	19	
2	21	
3	20	
4	20	
Total	80	

These properties were selected to provide a reasonable spatial representation in OU4 (i.e., north, central, and south Libby). Figure 5-1 shows the locations of the properties that were sampled as part of the Indoor ABS program. Table 5-1 provides detailed information on the types of indoor and outdoor cleanup actions that have been performed at each property.

### 5.1.2 Disturbance Scenarios

Conceptually, indoor air samples could be collected under a wide range of differing activity patterns. For the purposes of this effort, indoor ABS samples were collected under two representative conditions:

- <u>Active behaviors</u> This category includes indoor activities in which a person is moving about the building and potentially disturbing indoor sources. For example, walking from room to room, sitting down on upholstered chairs, sweeping, and vacuuming would all be included.
- <u>Passive behaviors</u> This category includes activities such as sitting and reading a book, watching television, and working at a desk. The key attribute is that the person is engaging in minimally energetic actions that will have low tendency to disturb any indoor source materials.

During each sampling event, indoor disturbance activities were performed over an 8-hour time interval divided into two sub-periods of 4 hours each (one for each disturbance scenario) ⁹. All active and passive disturbance activities were performed by EPA contractor personnel. Residents did not participate in the disturbance activities and were required to leave the house during the time period of indoor sample collection.

# 5.1.3 Sampling Times

Human health risk from exposure to LA in indoor air is related to the long-term average concentration in indoor air. Because the levels of LA in indoor air may depend on factors that vary seasonally (e.g., indoor activity patterns, humidity, building ventilation rate), the Indoor ABS

⁹ Depending on what is most convenient for the resident, sampling either occurred over one 8-hour time interval or was divided into two 4-hour samples on two sequential days.

program was performed four times at intervals that provided good seasonal representativeness, as follows:

- Round 1 (summer): July to August 2007¹⁰
- Round 2 (fall): September 2007 to January 2008
- Round 3 (winter): January to April 2008
- Round 4 (spring): April to June 2008

The same properties were evaluated in each round, although the backup property in Category 2 was removed from the program after the first round of sampling.

# 5.1.4 Sample Collection and Analysis

#### **5.1.4.1** Air Samples

During each disturbance scenario, EPA contractors wore personal air monitors placed such that the samples collected were representative of the breathing zone of the individual performing the disturbance activity (i.e., a hemisphere approximately 6 to 9 inches around an individual's face). All indoor ABS air samples were collected in basic accord with procedures provided in EPA-LIBBY-01 and ERT SOP#2084.

Two personal air monitoring samples were collected for each scenario – a high volume sample and a low volume sample. The high volume sample was collected using a pump with a flow rate of 10 L/min (total air volume of 2,400 L), and the low volume sample was collected using a pump with a flow rate of 3 L/min (total air volume of 720 L) (EPA 2007d). The high volume sample was analyzed in preference to the low volume sample because maximizing the total air volume collected reduced the level of effort needed to achieve the target analytical sensitivity. In cases where the high volume sample was damaged, the low volume was substituted. Unanalyzed low volume samples were archived at the Libby Field Office in Libby, MT. Prepared TEM grids and unused portions of the analyzed filters were archived at the analytical laboratory.

In order to ensure that each air sample is spatially representative of the home, the 4-hour time period for the disturbance scenario was divided evenly among the total number of rooms in which routine living activities occur. If both active and passive ABS scenarios were performed on the same day, the passive ABS scenario was performed first, to minimize the likelihood of cross-contamination between the ABS scenarios. When activities were conducted over two days, the order of the activities was randomized to equally represent the morning and afternoon sampling periods over the four rounds.

All indoor air samples were submitted to one of the subcontracted Libby laboratories for asbestos analysis by TEM in basic accord with the counting and recording rules specified in ISO 10312 (ISO 1995), and the ABS-specific counting rule modifications (EPA 2007b). The target analytical sensitivity for all indoor ABS air samples was 0.0002 cc⁻¹.

¹⁰ Date range represents when air samples were collected in Round 1; soil samples were collected at Indoor ABS properties in May-June 2007.

# 5.1.4.2 Indoor Dust Samples

For each indoor ABS property, a single 10-point composite indoor dust sample was collected in accord with SOP CDM-LIBBY-10 using a microvacuum sampling technique during each round of sampling¹¹. The 10 dust sampling points which were composited were representative of 4 accessible areas (e.g., window sills, flooring in living areas), 4 infrequently accessed areas (e.g., top of refrigerator or bookcase, beneath bed), and 2 inaccessible areas (e.g., beneath refrigerator or washing machine, inside air vents) within the rooms where the ABS activities were performed. At each dust sampling point, the sample was collected by vacuuming a 10 cm x 10 cm area (100 cm²). Therefore, the total sampling area of each dust composite sample was 1,000 cm². All dust samples were collected prior to the commencement of indoor ABS activities.

All indoor dust samples were submitted to one of the subcontracted Libby laboratories for asbestos analysis by TEM in basic accord with the counting and recording rules specified in ISO 10312 (ISO 1995), and the ABS-specific counting rule modifications (EPA 2007b). The target analytical sensitivity for all indoor ABS dust samples was 20 cm⁻².

## 5.1.4.3 Soil Samples

At each indoor ABS property, two 30-point composite soil samples were collected prior to the first round of indoor ABS sampling. One soil sample was representative of all non-specific use areas (NSUAs) on the property, and the other soil sample was representative of all specific use areas (SUAs). SUAs include areas such as gardens, flowerbeds, unpaved driveways, and play areas where human exposure is likely to occur on a frequent basis. NSUAs include general areas of the yard where human exposure likely to occur less frequently. Each 30-point composite included soil sampling points that were representative of and distributed equally throughout the entire NSUA or SUA.

All soil samples collected as part of the Indoor ABS program were sampled in accord with SOP CDM-LIBBY-05, and were prepared (dried, ground, sieved) and submitted for asbestos analysis by PLM. In addition, visual inspection data were collected and reported as described in Section 3.3 above.

# 5.2 Results Summary and Data Evaluation

Appendix E presents the detailed results for all samples collected as part of the Indoor ABS program. Table 5-2 summarizes the results for air, stratified by ABS property, sampling round, and disturbance scenario (active and passive).

¹¹ In Round 1, multiple composite dust samples (1 sample per floor) were collected at 14 of the 80 indoor ABS properties, rather than a single composite sample representative of all floors as specified in the Indoor ABS SAP. These samples were averaged to generate a value that is analogous to a physical composite across all floors. This issue was resolved in subsequent sampling rounds.

# 5.2.1 LA in Air as a Function of Disturbance Scenario and Season

Figure 5-2 presents the indoor ABS PCME LA air concentration data using a "box-and-whisker" format that characterizes the distribution of values observed. Note that indoor air concentration (the y-axis) is presented using a log-scale. Because samples with a concentration of zero cannot be plotted on a log-scale, for plotting purposes only they were assigned a value of 0.00001 s/cc, which is equal to the x-axis in the figure.

Inspection of Figure 5-2 reveals that air concentrations tended to be lower for the passive scenario compared to the active scenario. In addition, air concentrations in both scenarios showed seasonal variability, with the highest concentrations measured in the summer (Round 1) and the lowest concentrations in the winter (Round 3).

The observation that indoor air collected during active behaviors tends to contain more LA than air collected during passive behaviors is expected, and is consistent with the concept that active indoor behaviors tend to disturb LA structures that are present in or on reservoirs such as bare surfaces, carpets, or upholstery.

The reason that indoor air concentrations tend to be lower in winter than summer is not certain, but may be related to a decreased rate of track-in of contaminated soil from outdoor sources in winter than in summer, or to decreased aerial deposition of structures in indoor dust from outdoor ambient air, since this also tends to be lower in winter than in summer (EPA 2009). Other unknown factors may also be involved.

# 5.2.2 LA in Air as a Function of Post-Cleanup Property Category

As noted above, properties that were selected for evaluation in the Indoor ABS program were chosen based on a 4-category system for classifying the status of outdoor soil (see Section 5.1.1, above). During the ABS program, additional soil samples were collected, and some Category 4 properties were identified in which some LA was detectable by PLM. Based on this, Category 4 was re-defined as shown below:

Category	Did outdoor soil cleanup take	Post-cleanup Surface Soil			
	place?	Visible		PLM	
1	No	-	and	-	
2	140	+	or	+	
3	Yes	_	and	-	
4	163	+	or	+	

Visible: Visible vermiculite is present (+) or absent (-)

PLM: LA result is detect (+) or non-detect (-)

Figure 5-3 presents the indoor ABS PCME LA air concentration data stratified by the postcleanup category assignments above. As seen, under active conditions, mean indoor air concentrations for post-cleanup properties in Category 1 (where no outdoor soil cleanup was performed and soil levels are non-detect) tended to be lower than properties in the other three

categories. Under passive conditions, with the exception of Category 2 (which is influenced by a single high value), mean air concentrations tend to be generally similar across categories.

#### 5.2.3 Correlation of LA in Indoor Air to LA in Indoor Dust

One potential use of the data from the Indoor ABS study was to determine if indoor air concentration values of LA can be correlated with (and predicted by) any measure of LA contamination in potential source media. One of these potential source media is indoor dust.

Table 5-3 presents the indoor dust data collected during the indoor ABS program. The results are summarized below:

Round	Dust	Detect	Total LA	PCME LA
Round	Samples	Samples	Structures	Structures
1	96	1	1	0
2	80	8	9	3
3	80	1	4	0
4	80	0	0	0

As shown, both total LA and PCME LA were rarely detected in indoor dust. Of the 336 indoor dust samples collected, only 10 samples (< 3%) had detectable levels of total LA and only 3 samples had detectable PCME LA. Because of this very high rate of non-detects, the data are not adequate to support any meaningful effort to establish a quantitative relationship between LA in indoor air and indoor dust.

Although high levels of LA in dust were not expected (recall that all homes evaluated are post-cleanup), the very high non-detect rate in dust samples is somewhat unexpected, since the analytical sensitivity was set so that loadings of 20-30 s/cm² would usually be detected. In addition, the observation that active behaviors tend to increase the level of LA in indoor air (see Figure 5-2) strongly suggests that indoor dust is an important contributor to indoor air. One possible interpretation is that dust at levels below the analytical sensitivity are the main contributors to indoor air during active scenarios. An alternative interpretation is that the dust composite samples collected (typically including 10 templates derived from 4 accessible areas, 4 infrequently accessed areas, and 2 inaccessible areas) may not be representative of the main indoor reservoirs of LA.

#### 5.2.4 Correlation of LA in Indoor Air to LA Levels in Outdoor Soil

Based on the expectation that LA contamination in outdoor soil might be a contributor to indoor dust and/or indoor air contamination, data on the levels of LA in outdoor soil at each indoor ABS property were collected using both PLM-VE and visible vermiculite inspection. This section investigates whether any relationship between outdoor soil and indoor air can be detected using these data. Table 5-4 presents soil PLM-VE results and visible vermiculite inspection data for SUAs and NSUAs for all indoor ABS properties.

# 5.2.4.1 Based on PLM-VE Data

Figure 5-4 presents the indoor ABS PCME LA air concentration data, stratified by disturbance scenario (active and passive), as a function of the PLM-VE values for SUA soil (Panel A) and for NSUA soil (Panel B). As seen in Panel A, the mean PCME LA air concentrations for both active and passive air samples tend to be somewhat higher for properties where the PLM-VE result for SUA soil was Bin B1 than for properties where the SUA result was Bin A. Results are less consistent for NSUA soil (Panel B). These results suggest that LA levels in soil that are detectable by PLM-VE are associated with increased levels of LA in indoor air, both for the active and the passive scenarios.

# 5.2.4.2 Based on Visual Vermiculite Data

Figure 5-5 presents the indoor ABS PCME LA air concentration data, stratified by disturbance scenario (active and passive), as a function of the <u>detection frequency</u> of visible vermiculite in SUA areas (Panel A) and NSUA areas (Panel B). As seen, there is a tendency for the mean indoor ABS PCME LA air concentration to be slightly higher when the detection frequency exceeds 10% than when the detection frequency is between 0 and 10%, including SUA soil (Panel A) and NSUA soil (Panel B).

Figure 5-6 is a similar plot, except that properties are stratified based on <u>visible score</u> rather than visible detection frequency. As seen, there is a tendency for the mean indoor ABS PCME LA air concentration to be slightly higher when the visible score exceeds 0.1 than when the score is below 0.1, including SUA soil (Panel A) and NSUA soil (Panel B).

These results are consistent with the hypothesis that contaminated outdoor soil serves as a source of LA in indoor air, although the transport pathway (direct track-in, deposition from outdoor air) cannot be determined.

#### Multivariate Semi-Quantitative Approach

One potential limitation of the correlations presented above is that they are based on a simple monovariate analysis (i.e., correlations are evaluated based on either SUA soil or NSUA soil individually). However, if LA contamination in outdoor soil is a contributor to indoor air contamination, it is likely that both SUA and NSUA soils will contribute. This potential for contribution likely differs for SUAs and NSUAs as determined by a number of factors, including area size, soil contamination levels, soil conditions (e.g., moisture, cover, particle size), and human use patterns.

Figure 5-7 presents a 3-dimensional graph that shows the mean PCME LA concentrations measured in ABS indoor air stratified based on the frequency that visible vermiculite was observed in NSUA and SUA soils. The <u>visible detection frequency</u> for each soil type is stratified into three bins: 0, >0 to 0.1, and >0.1. In this figure, Panel A presents mean air concentrations based on the active scenario and Panel B presents mean air concentrations based on the passive scenario.

Figure 5-8 presents a similar figure, except that mean PCME LA concentrations measured in
ABS indoor air are stratified according to the visible vermiculite score rather than the detection
frequency. As seen, in both cases there is a general tendency for the mean concentration of
PCME LA in ABS air to increase as the detection frequency or visible vermiculite score in soil
increases. This trend is present for both active and passive scenarios.

Multivariate Quantitative (Regression) Approach

As noted previously, one potential limitation to binning soils based on visible vermiculite inspection data is that the choice of bin-widths for use in graphing are arbitrary, and the appearance of a graph may be altered by choosing different bin widths. One way to minimize this is to evaluate the data using a regression approach.

In this approach, the concentration of PCME LA in indoor air is assumed to be influenced by SUA soil, non-SUA soil, and by other factors. The model is as follows:

$$C_a = b_0 + b_1 \cdot NSUA + b_2 \cdot SUA$$

where:

 $C_a$  = mean indoor air concentration  $b_0$  = air concentration from other non-soil sources  $b_1$  = soil to air factor for NSUAs NSUA = soil metric for NSUA  $b_2$  = soil to air factor for SUAs SUA = soil metric for SUA

This regression analysis was performed by minimization of square errors. Table 5-5 shows the best fit model parameters and the percent contribution of NSUA soils, SUA soils, and other sources to the mean indoor air concentration under active disturbance scenarios. As seen, sources other than soil ( $b_0$ ) appear to be the largest contributor, with lower contributions for SUA soil and NSUA soil, respectively. This is true for both soil metrics (detection frequency and visible score).

# 5.3 Summary and Discussion

In this effort, the level of LA was measured in indoor air at 80 different post-cleanup properties at four different times of year (summer, fall, winter, spring). In each sampling round at each property, one air sample was collected that represented "passive" indoor activities, and another air sample was collected during "active" behaviors. This resulted in a total of 640 indoor ABS air samples collected. Each air sample was analyzed for LA using TEM.

The concentration of PCME LA observed in the indoor ABS air samples ranged from non-detect (usually < 0.0003 s/cc) to about 0.01 s/cc. On average, the concentration values associated with active behaviors were higher than for passive behaviors, supporting the concept that disturbance of an indoor source such as contaminated indoor dust is one contributing factor to

FINAL
indoor air levels of LA. Indoor air levels of PCME LA tended to be lowest during the winter and highest during the summer for both active and passive behaviors. The reason for this seasonal pattern is not certain, but might be related to a higher rate of transport of LA into the indoor environment in the summer, either through track-in of contaminated outdoor soil, and/or by deposition of LA in outdoor ambient air. Other unknown factors may also be involved.
Although composite dust samples were collected in each round at every property, it was not possible to establish a quantitative relationship between LA levels in indoor air and indoor dust because nearly all of the dust samples were non-detect (usually < 20 s/cm²). However, a weak correlation could be detected between average indoor air levels of PCME LA and the level of LA in outdoor soil, using either PLM-VE or visible inspection to characterize the soil. The relation was clearer for SUA soil than for NSUA soil, although the pattern was usually similar for both. These results support the concept that outdoor soil is a source that contributes to indoor air contamination. However, regression analysis suggests that other sources besides outdoor soil may also be important.

LIMAT	
This page intentionally left blank to facilitate double-sided printing.	

# 6 Screening Level Risk Characterization

This section presents a preliminary characterization of the excess cancer risks associated with the levels of LA that have been observed in outdoor and indoor ABS air at post-cleanup properties. The purpose of this screening level assessment is to provide initial estimates of the range of risk estimates that may result during indoor and outdoor activities at post-cleanup properties in order to help provide a frame of reference for the ABS results.

These preliminary risk calculations are for *screening purposes only*, and are not intended to support final risk management decision-making at any specific locations. Final risk evaluations will be presented in the Human Health Risk Assessment for Libby OU4, and the results may be different than the screening level values presented here.

In addition, it is important to stress that most people who live or work in Libby may be exposed to LA by a number of different exposure pathways, and that risk management decision-making must consider the sum of the risks across all pathways, not just those evaluated in this report.

### 6.1 Risk Model

Inhalation exposure to asbestos increases the risk of both non-cancer effects (asbestosis, pleural changes) and cancer effects (lung cancer and mesothelioma) in humans (EPA 1986, ATSDR 2001). At present, no approved method is available for quantifying risks of non-cancer effects. Therefore, risks of non-cancer effects are not evaluated in this document. However, EPA has developed a method for estimating excess risk of death from cancer due to inhalation exposure to asbestos, as described in the following sections.

The basic equation used to estimate excess lifetime cancer risk is (EPA 2008b):

Risk = EPC · TWF · IUR_{a.d}

where:

Risk = Probability of developing cancer as a consequence of the asbestos exposure being evaluated

EPC = Exposure Point Concentration of asbestos in inhaled air (PCM or PCME s/cc)

TWF = Time Weighting Factor to account for less than continuous exposure (unitless)

IUR_{a,d} = Inhalation Unit Risk (PCM s/cc)⁻¹ based on continuous exposure beginning at age "a" and continuing for duration "d" years

The level of cancer risk that is of concern is a matter of personal, community, and regulatory judgment. In general, EPA considers excess cancer risks that are below about 1E-06 to be so small as to be negligible, and risks above 1E-04 to be sufficiently large that some sort of remediation is desirable. Excess cancer risks that range between 1E-04 and 1E-06 are generally considered to be acceptable (EPA 1991), although this is evaluated on a case-by-case basis, and EPA may determine that risks lower than 1E-04 are not sufficiently protective

and warrant remedial action. Note that risk management decisions generally consider the sum of all the risks contributed by differing exposure scenarios into account, rather than simply evaluating each one independently.

# 6.2 Inputs to the Equation

# 6.2.1 Exposure Point Concentration (EPC)

An exposure point is a location where exposure and risk are to be evaluated, and an exposure point concentration (EPC) is an estimate of the long-term average concentration of PCME LA in air at that location.

In this screening level assessment, an exposure point is taken to be a residence. That is, the exposures that are being evaluated include the outdoor and indoor activities that occur at a person's home. This strategy is based on the concept that most area residents are likely to have a majority of their soil-related and indoor exposures at their own homes. To the extent that some individuals may have outdoor or indoor exposures at other locations, this needs to be evaluated separately and the risks combined, as appropriate.

## 6.2.1.1 EPC for Outdoor Air

For outdoor exposures during soil disturbance activities, the EPC is the average of the ABS air concentrations, combining across activity (mowing, raking, and digging) and across time (Round 1 and Round 2). This is because the goal is to estimate the average concentration over many years of various types of outdoor activities.

There are two alternative strategies for estimating the outdoor air EPC for a particular location. The first is to use only the ABS air data from that location. The second approach is to combine the ABS data from all locations that have the same or similar levels of soil contamination. In this screening level assessment, the second approach is used. This is based on the expectation that the many random variables that influence release of LA from soil to air will tend to average out over time, and that it is soil level alone, rather than any other attribute of a property, that will determine the long term average concentration in ABS air.

### 6.2.1.2 EPC for Indoor Air

For indoor air, two EPC values are needed. The first is the long-term average concentration of LA in indoor air during passive behaviors, and the second is the long-term average concentration in indoor air during active behaviors.

As above, two strategies are available for estimating the EPCs for indoor air at a location. The first is to use the data from that location alone, and the second is to combine data from all locations that are judged to be similar. In this case, because no relation could be established between indoor air and indoor dust, there is no reliable basis for defining residences that are "similar" based on indoor dust. Although only weak associations were detected between indoor air and outdoor soil, ABS data from all properties that have the same or similar levels of soil

contamination were combined. All calculations of EPCs for indoor air were averaged over time (Rounds 1 to 4).

# 6.2.1.3 Concentration Units of the EPC

As noted above, all indoor and outdoor ABS air samples were analyzed for LA using TEM. However, the risk model described above requires that asbestos concentration to be expressed in terms of PCM fibers, referred to as PCME (EPA 2008b). In accord with the PCM method (NIOSH 7400), a PCME structure is defined as a structure with length > 5 um, width  $\geq$  0.25 um, and an aspect ratio (length:width)  $\geq$  3:1. The EPC is expressed as PCME LA s/cc.

## 6.2.1.4 Uncertainty in the EPC

Ideally, the EPC used in the risk calculations for each exposure location would be the true average concentration value of PCME LA structures, averaged across the exposure duration "d". However, the true average concentration at a location can only be approximated from a finite set of measurements, and the observed sample mean might be either higher or lower than the true mean. In order to minimize the chances of underestimating the true level of exposure and risk, EPA generally recommends that risk calculations be based on the 95% upper confidence limit (95UCL) of the sample mean (EPA 1992), and has developed a software application (ProUCL) to assist with the calculation of UCL values (EPA 2007c). However, the equations and functions in ProUCL were not designed to work well for asbestos data sets, and application of ProUCL to asbestos data sets may not yield reliable results.

Because the 95UCL cannot presently be calculated with confidence, risk calculations presented in this report utilize the sample mean only. Consequently, the risk estimates presented here are uncertain, and true risks may be either higher or lower than presented. However, it is not possible to estimate the potential magnitude of the under- or over-estimation.

## 6.2.2 Time-Weighting Factor (TWF)

The value of TWF ranges from zero to one, and describes the average fraction of full time that exposure occurs in the time interval being evaluated. The general equation is (EPA 2008b):

TWF =  $ET/24 \cdot EF/365$ 

where:

ET = Average exposure time (hrs/day) on days when exposure is occurring

EF = Average exposure frequency (days/year) in years when exposure is occurring

For example, if a person were exposed to asbestos 10 hours per day for 200 days per year, the value of TWF would be:

TWF =  $10/24 \cdot 200/365 = 0.228$ 

Not all individuals within a group will have equal values for ET and EF. To account for this variability in exposure between different individuals, EPA focuses on individuals who have central tendency exposures (CTE) and on those who have reasonable maximum exposures (RME).

At present, no site-specific data are available on the activity patterns of residents of Libby, so screening-level exposure parameters were selected based on information in EPA's Exposure Factors Handbook (EPA 1997) and on professional judgment.

Relevant data items available from EPA (1997) for estimating exposure times (ET) are summarized below:

- Hrs/day at residence = 16.4 (CTE) to 23.3 (RME) (page 5-17)
- Hrs/day spent house cleaning = 1.3 (CTE) to 5.6 (RME) (Table 15-71)
- Hrs/day doing yard work = 2.5 (CTE) to 7.8 (RME) (*Table 15-92*)

Indoor activities are conservatively assumed to occur with an exposure frequency (EF) of 365 days/year. Data on the frequency of outdoor yard care activities were not located, but EPA (1992) recommends assuming about 1-2 days per week during warm weather. In Libby, assuming outdoor yard work is likely to occur mainly between May and September (about 20 weeks per year), the total number of days/year spend doing yard work is estimated to be about 20 to 40.

Based on these data, the parameters selected for use in this screening assessment are as summarized below:

Source		CTE			RME	
Source	ET	EF	TWF	ET	EF	TWF
Indoor Passive	15	365	0.625	17.5	365	0.729
Indoor Active	1.3	365	0.054	5	365	0.208
Outdoor Active	2	20	0.005	7.7	40	0.035
Total hrs/day	16.4			23.3		

### 6.2.3 Inhalation Unit Risk (IURa,d)

Values of IURa,d for a wide range of values for "a" (age at first exposure) and "d" (exposure duration) are given in EPA (2008b). This document also gives an equation for computing IURa,d for any combination of "a" and "d" that are not included in EPA (2008b). At present, no site-specific data exist to estimate values of "a" and "d" for exposure of area residents. In the absence of data, conservative values were assumed, as follows:

Receptor	а	d	IURa,d
CTE	0	30	0.17
RME	0	50	0.21

# 6.3 Results

# 6.3.1 Outdoor Exposures During Soil Disturbance Activities

Figure 6-1 presents the distribution of screening level estimated excess cancer risk values for each of the 75 outdoor ABS areas. In this assessment, the EPC (PCME s/cc) for each outdoor ABS area was calculated as the mean of the six outdoor ABS air samples (3 scenarios x 2 rounds) available for the area. As seen, for a CTE receptor, most of the areas are below the upper end of EPA's acceptable risk range (1E-04), but about 10% of the properties equal or exceed the risk range. For an RME receptor, about 40% of the areas exceed 1E-04. These results suggest that excess cancer risks may remain within a range of potential concern at some post-cleanup properties. However, this conclusion is not certain, for several reasons, including:

- Exposure and risk at a property depends on the yard-wide average concentration. In
  most cases, the ABS study areas do not represent a yard-wide average concentration at
  a property, but only a sub-area of a property. Consequently, the distribution of risks at
  ABS areas is not equivalent to the distribution of risks at the 62 properties where outdoor
  ABS samples were collected.
- 2. At each ABS area, the risk calculations are based on the mean of six outdoor ABS samples. Because of the high variability between samples, six samples may not provide an accurate estimate of the true long-term average concentration. In general, it would be expected that, if additional samples had been collected at each location, the width of the distribution of means would tend to narrow, which would tend to decrease the number of ABS areas that exceed a risk level of 1E-04.

Other potential uncertainties in these risk estimates are described in detail in Section 6.4 below. However, despite these considerations, it seems likely that at least some post-cleanup locations may exceed EPA's risk range if repeated outdoor soil disturbance activities occur.

A key question is whether or not such properties can be reliably recognized without having to perform multiple ABS activities at each property. The traditional approach for doing this is to establish a relationship between the concentration of contaminant in the source material (soil) and the level of risk that exists due to exposure to that source material (via soil disturbance scenarios that result in inhalation exposure of LA).

Table 6-1 presents screening level excess cancer risk estimates for CTE and RME residential exposure to outdoor air during soil disturbance scenarios, evaluated using a range of alternative strategies for estimating the relationship between PCME LA in ABS air and LA in the soil. As seen, the results depend somewhat on the method used to evaluate the relationship between soil and outdoor ABS air. However, taken together, the results suggest that risks to residents from typical (CTE) soil disturbance activities may be in the range of about 7E-06 to 7E-05 at locations where soils are at the low end of the contamination range (including clean fill), and may range from about 9E-05 to 5E-04 for locations where soils are near the high end of the range that may remain at some post-cleanup properties. Likewise, risks to residents from high end (RME) soil disturbance activities may be in the range of about 6E-05 to 7E-04 at locations

where soil are at the low end of the contamination range (including clean fill), and may range
from about 8E-04 to 4E-03 for locations where soils are near the high end of the range that may
remain at some post-cleanup properties.

These results suggest that excess cancer risks to residents may remain at or above the high end of EPA's risk range at properties where residual soil contamination remains, as determined by PLM-VE analysis and/or by inspection for visible vermiculite.

# 6.3.2 Indoor Exposures

Figure 6-2 presents the distribution of screening level estimated excess cancer risk values for residents at each of the 80 post-cleanup properties where indoor ABS air data were collected in all four sampling rounds. In this assessment, the EPC (PCME s/cc) for each activity level (active, passive) at each property was calculated as the mean of the four indoor ABS air samples for that activity at that property. Risks were calculated using the active and passive exposure parameters described above, and then risks were summed across active and passive behaviors to yield the total risk.

As seen, risks from indoor exposure are within EPA's acceptable risk range (1E-06 to 1E-04) for both CTE and RME receptors at more than 95% of the properties evaluated. This suggests that risks from indoor air are likely to be of relatively low concern at most post-cleanup properties. However, risks approach or exceed the upper end of the risk range (5E-05 to 4E-04) at about 5% of the properties.

As noted above, a weak relationship appears to exist between indoor air levels and the level of LA in outdoor soil. Table 6-2 presents screening level excess cancer risk estimates for CTE and RME residential exposure to indoor air during active and passive behavior activities, evaluated using several alternative strategies for estimating the relationship between PCME LA in indoor ABS air and LA in outdoor soil.

As seen, in all approaches the combined risks (active plus passive) to residents from typical (CTE) indoor activities appear to be about 6E-06 at locations where soil are at the low end of the contamination range (including clean fill), but may range up to about 6E-05 for locations where soils are near the higher end of the range that may remain at some post-cleanup properties. For an RME receptor, risks at low soil locations are about 2E-05, ranging up to 1E-04 at higher soil locations.

#### 6.3.3 Combined Exposures

Most residents are likely to be exposed to LA both indoors and outdoors during soil disturbance activities. Figure 6-3 displays the distribution of total risks (outdoor, indoor active, indoor passive) at 38 properties where both outdoor and indoor ABS data are available. As seen, nearly all properties are within EPA's risk range for CTE receptors, and about 25% of the locations exceed the upper end of the risk range for RME receptors. These total risks are determined mainly by the contribution of the outdoor soil disturbance pathway, although indoor

exposures (both active and passive) contribute to the total. Average contributions across the 38 properties are summarized below:

Poportor	Outdoor	Indoor	Indoor
Receptor	Active	Passive	Active
CTE	65%	15%	20%
RME	75%	9%	17%

As noted previously, a property-specific assessment of potential risks based on measured ABS results is not feasible at Libby, where there are more than 4,000 properties, due to both time and cost considerations. Therefore, it is expected that risk managers will tend to rely upon an extrapolation of ABS results between areas of similar LA contamination in soil to make cleanup decisions.

#### 6.4 Uncertainties in Risk Estimates

There are a number of sources of uncertainty in the risk calculations presented in this report. The most important of these include:

- Uncertainty in true long-term average LA concentrations in air. As discussed above, there is usually high variability in measured ABS air concentrations, and this results in uncertainty in the true long-term average concentration. Use of the sample mean concentration for use in risk calculations may either underestimate or overestimate the true risk. However, EPA has not yet developed a statistical method for characterizing the magnitude of the uncertainty in the mean concentration.
- Uncertainty arising from use of an indirect preparation technique. During TEM analysis of the ABS personal air samples, the analytical laboratories noted that a majority of the air filters were significantly overloaded with particulates. As a result, these samples were analyzed using an indirect preparation method after ashing. For chrysotile asbestos, indirect preparation often tends to increase structure counts due to dispersion of bundles and clusters (Hwang and Wang 1983; HEI-AR 1991; Breysse 1991). For amphibole asbestos, the effects of indirect preparation are generally much smaller (Bishop et al., 1978; Sahle and Laszlo, 1996; Harris 2009).

The expectation that indirect preparation is a minor source of uncertainty in estimates of LA concentration is supported by a Libby-specific study conducted in 2005. This study compared the results for 31 samples analyzed for LA using both direct and indirect preparation methods (EPA 2007e). Figure 6-4 presents the paired results from this study. As shown in Panel A, some samples were statistically lower, some were not statistically different, and some were statistically higher when analyzed by an indirect method compared to a direct method. Although the difference was 10-15 fold in a few samples, these samples tended to be from areas outside of OU4 (i.e., from Rainy Creek Road). For the subset of samples from OU4 (see Panel B), the difference between the two results was minor (i.e., the average indirect to direct ratio was about 1.2).

This relative insensitivity in LA concentration estimates to preparation method is likely
due to the fact that complex structures (bundles, clusters, etc.) that might be subject to
dispersal during an indirect preparation are generally minor in most Libby air samples.
Table 6-3 shows the frequency that different LA structure types were observed in
outdoor ABS air samples by analysis preparation method. As shown, in direct
preparation analyses, more than 90% of all structures recorded were free fibers or a
single fiber protruding from a matrix (shaded grey in the table), and bundles and clusters
are not common.

Based on these considerations, it is concluded that analysis of samples for LA using an indirect preparation method is a relatively minor source of uncertainty. EPA is in the process of conducting two Libby-specific studies to evaluate the potential effects of indirect preparation methods on ABS air samples. Results from these studies will inform uncertainty evaluations in future risk assessment reports.

- Uncertainty in the relationship between LA in air and LA in soil. As discussed in Section 4, the concentration of PCME LA in ABS air tends to increase as the level of LA contamination is soil increases, but development of reliable quantitative or semi-quantitative models to predict mean air concentrations from measured soil levels is not straightforward. For this reason, the calculations presented in this screening assessment utilize several alternative means of relating air levels to soil levels, and the variation in results between methods provides one measure of the uncertainty associated with the soil to air transfer pathway.
- Uncertainty in outdoor exposure patterns. To the extent that there may be significant
  differences in exposure between different outdoor disturbance activities, and accepting
  that some individuals may engage in one activity more than others, there is uncertainty
  in risk estimates derived using the average concentration across all outdoor ABS
  activities. Thus, risk calculations for any given individual may be either higher or lower,
  but the magnitude and direction of any differences is not known.
- Uncertainty in Libby-specific human exposure patterns. Risk calculations require knowledge of the duration, frequency, and age at which exposure occurs. As noted above, no data on human exposure parameters are available that are specific to the residents of Libby, so the values used in this screening assessment were selected using professional judgment, incorporating information that is available from studies in other locations. The values used in the risk calculations may be either higher or lower than the true Libby-specific values, but the magnitude and direction of any differences is unknown.
- Uncertainty in the cancer exposure-response relationship. Available data from studies in both animals and humans suggest that the risk of cancer from inhalation exposure to asbestos may depend in part on the type of asbestos (chrysotile vs. amphibole) and on the dimensions (length and width) of the inhaled fibers. Evaluations performed to date suggest that amphibole asbestos is somewhat more potent than chrysotile (e.g., Hodgson and Darnton 2000; Berman and Crump 2008a,b), although quantification of the

difference remains difficult. Because the current EPA method for estimating cancer risk does not differentiate between the mineral forms, the potency estimates based on the current EPA method are uncertain, and may be somewhat low for use at a site such as Libby where exposure is to amphibole asbestos only. Development of site-specific unit risk factors is being addressed as part of the Libby Action Plan. It is also important to note that the current EPA method for estimating cancer risk is based on the best estimate of the cancer potency factors for lung cancer and mesothelioma, and that the true value of the potency factors might be up to 10-times higher or lower than the best estimates (EPA 1986). Consequently, true risks might be up to 10-times higher or lower than the values reported here.

- Lack of an approved method for assessing non-cancer risks. As noted above, EPA has not yet developed national guidance for evaluating the risk of non-cancer effects from inhalation exposure to asbestos. However, numerous studies of former workers and area residents provide strong evidence that exposure to LA results in an increased incidence of non-cancer adverse effects, and that these effects occur in some individuals who appear to have had only low exposure. It is not presently known whether exposure levels that protect against cancer risk will also protect against non-cancer risk from asbestos.
- Uncertainty associated with cumulative exposures. As noted above, most people who
  live or work in Libby may be exposed to LA by a number of different pathways. Because
  this screening level assessment evaluates only some of these pathways, the risk
  estimates presented here are likely to underestimate the total risks to some people.
  However, until risk assessments are completed for all potentially significant exposure
  pathways, the magnitude of the risks cannot be reliably estimated.

Because of these uncertainties, all screening level risk estimates for exposure to asbestos presented here should be considered to be uncertain, and actual risks may be either higher or lower than estimated.

#### 6.5 Conclusions

One of the main objectives of the ABS program was to determine if residual human health risks are acceptable at post-cleanup properties in Libby. Based on the data currently available, it appears that residual risks from indoor exposures at post-cleanup properties are likely to be within EPA's acceptable risk range, but that some post-cleanup locations may remain where excess cancer risks from repeated outdoor soil disturbances could approach or exceed the upper end of EPA's acceptable risk range. Identifying these properties is not simple. However, it appears that if outdoor soil does not contain a level of LA that is detectable by PLM-VE, and if vermiculite is not detectable by visible inspection, then risks are likely to be within EPA's acceptable risk range. If soil contains detectable levels of LA by PLM-VE and/or if the soil contains visible vermiculite, risks tend to be somewhat higher. However, because of the high variability in ABS air values and the multiple sources of uncertainty in the process of estimating cancer risks, the boundary between acceptable and unacceptable is difficult to define with confidence.

This page intentionally left	blank to facilitate dou	uble-sided printing.	

# 7 Data Quality Assessment

Data quality assessment (DQA) is the process of reviewing existing data to establish the quality of the data and to determine how any data quality limitations may influence data interpretation (EPA 2006).

#### 7.1 Audits

# 7.1.1 Field Audits

Field audits are conducted to evaluate field personnel in their day-to-day activities and ensure all processes and procedures are performed in accord with the applicable field guidance documents (or approved Libby Field Office [LFO] modification forms) to make certain that samples collected are correct and consistent. All aspects of data documentation and sample collection, as well as sample handling, custody, and shipping are evaluated. If any issues are identified, field personnel are notified and retrained as appropriate.

A field audit was performed on October 10, 2007, to evaluate field procedures for air and dust samples collected as part of the ABS program. The auditor concluded that the field personnel were very effective and efficient at implementing sampling and reporting ABS program requirements and commended the field personnel and staff for their efforts in maintaining an effective field program and their persistent focus on detail and quality (Updike 2007).

# 7.1.2 Laboratory Audits

Laboratory audits are conducted to evaluate laboratory personnel to ensure that samples are handled and analyzed in accord with the program-specific documents and analytical method requirements (or approved Libby laboratory modification forms) to make certain that analytical results reported are correct and consistent. All aspects of sample handling, preparation, and analysis are evaluated. If any issues are identified, laboratory personnel are notified and retrained as appropriate. A series of laboratory audits was performed in the Summer/Fall of 2008 to evaluate all of the Libby laboratories. No critical deficiencies were noted during the laboratory audits that would be expected to impact data quality.

### 7.2 Modifications

During a large-scale sampling program, such as the ABS program, deviations from the original SAP may occur and/or it may be necessary to modify procedures identified in the original SAP to optimize sample collection. At the Libby Site, all field and laboratory modifications are recorded in site-specific modification forms. These forms provide a standardized format for tracking procedural changes in sample collection and analysis and allow project managers to assess potential impacts on the quality of the data being collected.

During the ABS program, a number of field and laboratory modifications were created that document changes from sample collection and analysis methodology specified in the Indoor and

Outdoor ABS SAPs (EPA 2007a,b). In addition, a number of laboratory modifications were created that apply to the analysis of samples from the ABS program. Copies of all modification forms are provided in Appendix F.

Table 7-1 summarizes the modifications that are applicable to the ABS program and notes the impact of each on the quality and usability of the data. As indicated, most of the modifications are not expected to have an impact on data quality or usability. Modifications which may have influenced analytical preparation techniques for air samples or the achieved analytical sensitivities could have potential impacts on data quality and interpretation. These potential impacts are discussed in more detail in the data adequacy evaluation (Section 7.5) below.

#### 7.3 Data Verification

The Libby2DB has a number of built-in quality control checks to identify unexpected or unallowable data values during upload into the database. Any issues identified by these automatic upload checks were resolved by consultation with the field teams and/or analytical laboratory before entry of the data into the database. After entry of the data into the database, several additional data verification steps were taken to ensure the data were recorded and entered correctly.

In order to ensure that the Libby2DB accurately reflects the original hard copy documentation, all data downloaded from the database were examined to identify data omissions, unexpected values, or apparent inconsistencies. In addition, 100% of all samples and analytical results underwent a detailed verification. In brief, verification involves comparing the data for a sample in the Libby2DB to information on the original hard copy FSDS form and on the original hard copy analytical bench sheets for that sample. Any omissions or apparent errors identified during the verification were submitted to the field teams and/or analytical laboratories for resolution and rectification in the Libby2DB and in the hard copy documentation.

<u>FSDS Review.</u> Hard copy FSDS forms were reviewed for a total of 1,839 ABS samples as part of the data verification effort. Appendix G presents a summary of the findings of the FSDS review for the ABS program. In general, most of the critical issues identified were important for the purposes of sample tracking (e.g., scenario description, high volume/low volume pump type), but would not have influenced the quantitative analytical results reported for the sample. The critical error rate based on a review of the FSDS forms was about 3%.

<u>TEM Review.</u> A total of 1,427 TEM analyses were reviewed as part of the data verification effort. Appendix G presents a summary of the findings of the TEM data verification for the ABS program. In general, the laboratories showed a decrease in the error frequency as the ABS program progressed (20% error rate in Round 1 compared to 1-3% error rate in Rounds 2 through 4). However, it is important to note that not all errors identified were critical in nature (i.e., critical errors are those that would influence the quantitative results). Almost half of all TEM recording issues were due to the analyst incorrectly or inconsistently applying Libby

	FINAL
	atory Modification #LB-000066 ¹² , which would not be deemed a critical error for the ses of this report.
The d	Review. A total of 412 PLM analyses were reviewed as part of the data verification effort ata verification only identified a single error in the reported PLM-VE bin for one soil samp rate of <0.1%).
analyt (includ	ues identified during the data verification effort were submitted to the field teams and/or ical laboratories for resolution and rectification. All tables, figures, and appendices ding all hard copy documentation and the Libby2DB [provided in Appendix A and B]) ated for this report reflect corrected data.
7.4	Quality Control Sample Summary
charad based detaile	aber of Quality Control (QC) samples were collected as part of the ABS program to help cterize the accuracy and precision of the data obtained. QC samples included both field-samples (which are submitted blind to the laboratories) and laboratory-based samples. Red evaluation of these QC samples is provided in Appendix H. Based on the results of the valuation, it is concluded that:
•	Inadvertent contamination of air, dust, or soil field samples with LA is not of significant concern, either in the field or the laboratory.
•	Transmission electron microscopy (TEM) precision is generally good, as indicated by high agreement rates between field samples and field duplicates (dust only), between original and re-preparation analyses, and between original and recount analyses (i.e., samples where the same grid openings are evaluated twice).
•	Polarized light microscopy (PLM) precision is generally good, as indicated by high concordance rates between field samples and matched field duplicates, preparation splits, laboratory duplicates, and interlabs.
•	PLM accuracy is also good, as indicated by the concordance rates when analyzing performance evaluation samples.
7.5	Data Adequacy Evaluation

¹² This modification requires TEM analysts to note information on the levels (presence/absence) of the sodium and potassium peaks observed in the EDS spectrum for the recorded LA structure in the EDD comment field.

# 7.5.1 Outdoor ABS

# 7.5.1.1 Spatial and Temporal Representativeness

The goal of the outdoor ABS program was to evaluate 15 sampling locations for each of 5 soil category types (N total = 75 outdoor ABS locations), encompassing the range of types and levels of residual sources that may remain at post-cleanup locations, and providing a reasonable spatial representation of OU4. Target and actual numbers of ABS locations are summarized below.

Soil	Number of Outdoor ABS Locations		
Category	Target	Actual	
1	15	15	
2	15	15	
3	15	15	
4	15	14	
5	15	16	
Total	75	75	

As seen, the number of outdoor ABS locations sampled met the specified goal for nearly all soil categories, and achieved the target total number of locations (N=75). Inspection of the map of outdoor ABS locations (see Figure 4-1) shows that the selected locations were spread throughout Libby and are generally representative of OU4. All 75 outdoor ABS locations were evaluated in both summer and spring, which are the two seasons where soil disturbance activities are likely to be highest. Based on this, the outdoor ABS data collected are deemed to be spatially and temporally representative.

# 7.5.1.2 Air Samples

### Sample Completeness

Completeness is defined as the fraction of samples that were planned that were successfully collected and analyzed. As described above, three different disturbance scenarios were evaluated at each outdoor ABS location – mowing, raking, and digging. During each disturbance scenario, the individual performing the activity wore two personal air monitors (high volume and low volume) to collect air samples for asbestos analysis. The high volume sample was analyzed in preference to the low volume sample (the low volume sample was analyzed only if the high volume sample was damaged or lost). The target number of personal air samples for the outdoor ABS program was 450 samples (75 ABS locations x 3 scenarios x 2 rounds). All of these samples were successfully collected and analyzed (i.e., 100% completeness). There was only one case where the high volume sample was damaged and the low volume sample was analyzed instead.

# Sample Duration

As specified in the Outdoor ABS SAP, each soil disturbance activities was planned to span a 2-hour time interval. This time was selected to help ensure that samples captured a sufficiently long sampling interval that the sample would be a reliable measure of the long term mean concentration during an ABS activity, and would not be unduly influenced by short-term (minute to minute) spikes and dips in the concentration.

However, in Round 1 the laboratories reported that a high number of filters were overloaded and would require indirect preparation. In an attempt to reduce the number of overloaded samples, the sample collection protocol was modified (see Outdoor ABS SAP Mod 1 in Appendix F) to stop the sample collection if the filter became overloaded (based on a visual inspection in the field). This modification was in effect between August 16-24, 2007.

Shortening sampling duration is not expected to have a significant effect on data quality unless sampling durations become so short that sample results may be dominated by short term fluctuations. In this event, the chief effect that would be expected is increased variability in the samples, which in turn tends to increase uncertainty in the mean concentration. It is not known how short the duration would need to be before this becomes a concern, but it seems unlikely that it would be an important factor for samples that are 30 minutes or longer. As shown in Figure 7-1, 399 out of 450 samples (89%) had a sample duration of 30 minutes or more, while 34 had a duration of 15-30 minutes and 17 had a duration of less than 15 minutes. Thus, the fraction of samples in the dataset that might tend to have limited temporal representativeness is small. In addition, the short duration samples tended to span all ABS activity scenarios and all outdoor ABS area categories (as shown in the tables below the graph), which shows that a systematic bias is not expected. Therefore, the overall effect of the short duration samples on data quality is not likely to be significant.

#### Analytical Sensitivity

As specified in the Outdoor ABS SAP, the target analytical sensitivity for all outdoor air samples was 0.001 cc⁻¹. In the SAP, it was assumed that this sensitivity could be achieved by counting 30 grid openings (GOs) (assuming the target air volume was achieved and direct preparation was possible). However, as discussed above, in some instances the total air volume achieved was less than the target and some samples needed to be prepared indirectly due to filter overloading. Based on this, the TEM analysis stopping rules were modified (see Outdoor ABS SAP Mod 1 in Appendix F) to allow the TEM analysis to stop (even if the target sensitivity was not achieved) if either 50 LA structures were recorded or if 100 GOs were examined.

Figure 7-2 summarizes the analytical sensitivities achieved for all outdoor ABS air samples. As seen, about 50% of all samples achieved the target sensitivity of 0.001 cc⁻¹. When samples did not achieve the target sensitivity, the TEM analysis was stopped based on GOs examined in 184 samples (41%) and based on LA structure count in 38 samples (8%).

Halting a TEM analysis prior to achieving the target analytical sensitivity is likely to have little impact on uncertainty in the reported air concentration in cases where the number of LA

structures counted is above 10-20 structures. Figure 7-3 summarizes the total number of LA structures recorded for outdoor ABS air samples where the target analytical sensitivity was not achieved because the analysis was halted based on the 100 GO stopping rule. As seen, 113 of these samples (25% of the total) have fewer than 10 LA structures recorded, and 76 samples (17%) have fewer than 5 LA structures recorded.

The consequence of this is that the concentration estimates for samples with low count due to stopping before the target sensitivity is achieved will have somewhat higher uncertainty than would have been achieved if the samples had been analyzed until the analytical sensitivity was achieved. The magnitude of the effect can be assessed by noting that the expected coefficient of variation (CV = standard deviation / mean) around a count of N is equal to  $1/N^{0.5}$ . For example, a sample with a count of 5 has an expected CV of 44%, while a sample with a count of 20 has an expected CV of 22%. Note that the effect of low count is to increase uncertainty, but no bias is introduced. Because the frequency of samples with low count (e.g., < 5) that did not achieve target sensitivities is relatively low (17%), it is expected that the overall impact of this modification on data quality is not significant.

# 7.5.1.3 Soil Samples

## Sample Completeness

Based on the Outdoor ABS SAP, for each outdoor ABS location, a 30-point soil composite sample was to be collected in both Round 1 and Round 2 for PLM analysis. In addition, visual inspection for vermiculite was to be performed at each of the 30 inspection points in both Rounds 1 and 2. In Round 2, a 2-point soil composite sample was also collected which was representative of the sub-areas where the digging scenario occurred. Based on this, the target number of soil PLM-VE samples and visible inspection surveys for the outdoor ABS program was 225 (75 ABS locations x 3 samples).

The outdoor ABS program was able to collect and perform PLM analyses for all of the target number of soil samples (i.e., 100% completeness). Completeness was also high for visible inspection, with only one case in Round 1 where the visual vermiculite inspection results were not recorded for the 30-point composite. This single omission is not expected to limit or bias the data evaluation.

#### 7.5.2 Indoor ABS

### 7.5.2.1 Spatial and Temporal Representativeness

The goal of the indoor ABS program was to evaluate 20 properties for each of 4 post-cleanup types (N total = 80 indoor ABS properties), encompassing the range of types and levels of residual sources that may remain at post-cleanup locations, and providing a reasonable spatial representation of OU4. Target and actual numbers of ABS locations are summarized below.

Category	Number of Outdoor ABS Locations	
	Target	Actual
1	20	19
2	20	21
3	20	20
4	20	20
Total	80	80

As seen, the number of indoor ABS properties sampled met or exceeded the specified goal for nearly all soil categories, and met the target total number of locations (N=80). Inspection of the map of indoor ABS properties (see Figure 5-1) shows that the selected properties were spread throughout Libby and are generally representative of OU4. All indoor ABS properties were evaluated in all four sampling rounds¹³ (i.e., data are representative of each season). Based on this, the indoor ABS data collected are deemed to be spatially and temporally representative.

# 7.5.2.2 Air Samples

# Sample Completeness

Two different scenarios were evaluated at each indoor ABS property – during active and passive behaviors. During each scenario, the individual performing the activity wore two personal air monitors (high volume and low volume) to collect air samples for asbestos analysis. The high volume sample was analyzed in preference to the low volume sample (the low volume sample was analyzed only if the high volume sample was damaged or lost). The target number of personal air samples for the indoor ABS program was 640 samples (80 ABS locations x 2 scenarios x 4 rounds). Nearly all of these samples were successfully collected and analyzed (i.e., >99% completeness). There were only two samples where the where the high volume sample was damaged; in one instance, the low volume sample was analyzed instead, in the other, the low volume sample was also damaged and no analysis could be performed.

### Sample Duration

As specified in the Indoor ABS SAP, each scenario was planned to span a 4-hour time interval. This time was selected to help ensure that samples captured a sufficiently long sampling interval that the sample would be a reliable measure of the long term mean concentration during the ABS activity, and would not be unduly influenced by short-term (minute to minute) spikes and dips in the concentration.

Shortening sampling duration is not expected to have a significant effect on data quality unless sampling durations become so short that sample results may be dominated by short term fluctuations. In this event, the chief effect that would be expected is increased variability in the samples, which in turn tends to increase uncertainty in the mean concentration. It is not known

¹³ Property 628 Avenue B was identified as a backup property for Category 2. This property was only sampled in Round 1 (summer) and is not included in the summary table.

how short the duration would need to be before this becomes a concern, but it seems unlikely
that it would be an important factor for samples that are 1 hour or longer. As shown in Figure 7-
4, only 4 samples had sample durations of less than 3 hours. Thus, the fraction of samples in
the data that might tend to have limited temporal representativeness is small, and the overall
effect on data quality is not likely to be significant.

# Analytical Sensitivity

As specified in the Indoor ABS SAP, the target analytical sensitivity for all indoor air samples was 0.0002 cc⁻¹. In the SAP, it was assumed that this sensitivity could be achieved by counting about 80 GOs (assuming the target air volume was achieved and direct preparation was possible). However, as discussed above, in some instances the total air volume achieved was less than the target and some samples needed to be prepared indirectly due to filter overloading. Based on this, the TEM analysis stopping rules were modified (see Libby Laboratory Modification #LB-000079 in Appendix F) to allow the TEM analysis to stop, even if the target sensitivity was not achieved, if either 50 LA structures were recorded or if 100 GOs were examined.

Figure 7-5 summarizes the analytical sensitivities achieved for all indoor ABS air samples. As seen, about 85% of all samples achieved the target sensitivity of 0.0002 cc⁻¹. When samples did not achieve the target sensitivity, the TEM analysis was stopped based on GOs examined for all but 2 samples.

Halting a TEM analysis prior to achieving the target analytical sensitivity is likely to have little impact on uncertainty in the reported air concentration in cases where the number of LA structures counted is above 10-20 structures. Figure 7-6 summarizes the total number of LA structures recorded for indoor ABS air samples where the target analytical sensitivity was not achieved because the analysis was halted based on the 100 GO stopping rule. As seen, 89 of these samples (89% of the total) have fewer than 10 LA structures recorded, and 72 samples (72%) have fewer than 5 LA structures recorded.

The consequence of this is that the concentration estimates for these samples have somewhat higher uncertainty than would have been achieved if the samples had been analyzed until the analytical sensitivity was achieved. However, it is not expected that this modification leads to any bias in the data, and this only impacts less than 15% of all indoor ABS samples (those that did not achieve the target sensitivity and had a low structure count), so the overall impact on data quality is not expected to be significant.

#### 7.5.2.3 Dust Samples

### Sample Completeness

According to the Indoor ABS SAP, for each indoor ABS property, a single 10-point composite indoor dust sample was to be collected during each round of sampling which was representative of 4 accessible areas, 4 infrequently accessed areas, and 2 inaccessible areas within the rooms

FINAL	
where the ABS activities were performed. The target number of dust samples was 320 (80 properties x 4 rounds).	
The actual number of dust samples (N=336) collected was higher than the target. This is because in Round 1 multiple composite dust samples (1 sample per floor) were collected at 1 of the indoor ABS properties, rather than a single composite sample representative of all floor These samples were averaged to generate a value that is analogous to a physical composite across all floors. This issue was resolved in subsequent sampling rounds.	rs.
There are only two cases where dust samples are not available for all rounds from all properties. Property 628 Avenue B was only sampled in Round 1, and the dust sample from Round 1 was lost for property 105 West Oak Street.	
Analytical Sensitivity	
As specified in the Indoor ABS SAP, the target analytical sensitivity for all indoor dust samples 20 cm ⁻² . With one exception, all dust samples achieved the target analytical sensitivity achieved for the one sample that did not meet the target was 27 cm ⁻² .	•
7.5.2.4 Soil Samples	
Sample Completeness	
Based on the Indoor ABS SAP, for each ABS property, two 30-point soil composite samples were to be collected in Round 1 for PLM analysis – one from an SUA and one from a NSUA. addition, visual inspection for vermiculite was to be performed at each of the 30 inspection points for both samples. Based on this, the target number of soil PLM samples and visible inspection surveys for the indoor ABS program was 160 (80 ABS locations x 2 samples).	In
The indoor ABS program was able to collect and perform PLM analyses and visible vermiculi inspection data for all of the target number of soil samples (i.e., 100% completeness).	ite
(Note: A number of soil samples were collected, as part of the initial property selection procedure for the Indoor ABS program, for properties that were not ultimately selected for incABS. These data are not presented in this report.)	rook
7.5.3 Data Adequacy Conclusions	
Based on the data adequacy assessment presented above it is concluded that the data	

generated during the OU4 ABS programs meet the DQOs stated in the respective SAPs and

results are adequate to support the data evaluations presented in this report.

7.6 Data Quality Conclusions	7.6	Data	Quality	Conclusions
------------------------------	-----	------	---------	-------------

Taken together, these results indicate that TEM and PLM data collected at the Libby site as part of the OU4 ABS program are representative, of acceptable quality, and considered to be reliable and appropriate for use without qualification.

8	References
	Amandus HE, Wheeler R. 1987. The Morbidity and Mortality of Vermiculite Miners and Millers Exposed to Tremolite-Actinolite: Part II. <i>Mortality. Am. J. Ind. Med.</i> 11:15-26.
а	ATSDR. 2001. Toxicological Profile for Asbestos. Atlanta, GA: Agency for Toxic Substances and Disease Registry, U.S. Department of Health and Human Services, Public Health Service. September 2001. <a href="http://www.atsdr.cdc.gov/toxprofiles/tp61.html">http://www.atsdr.cdc.gov/toxprofiles/tp61.html</a>
	Berman DW, Crump KS. 2008a. A Meta-Analysis of Asbestos-Related Cancer Risk That Addresses Fiber Size and Mineral Type. <i>Crit. Rev. Tox.</i> 38(S1):49–73.
	Berman DW, Crump KS. 2008b. Update of Potency Factors for Asbestos-Related Lung Cancer and Mesothelioma. <i>Crit. Rev. Tox.</i> 38(S1):1–47.
	Bishop K, Ring S, Suchanek R, Gray D. 1978. Preparation Losses and Size Alterations for Fibrous Mineral Samples. Scanning Electron Microsc. 1:207.
	Breysse PN. 1991. Electron Microscopic Analysis of Airborne Asbestos Fibers. <i>Crit. Rev. Analyt. Chem.</i> 22:201-227.
	CDM. 2004. Close Support Facility, Soil Preparation Plan, Libby Montana Asbestos Project Sample Processing. March 2004.
A	EPA. 1986. Airborne Asbestos Health Assessment Update. U.S. Environmental Protection Agency, Office of Health and Environmental Assessment. EPA 600/8-84/003F. June 1986. http://cfpub.epa.gov/ncea/cfm/recordisplay.cfm?deid=35551
٧	EPA. 1991. Role of the Baseline Risk Assessment in Superfund Remedy Selection Decisions. Vashington, DC. OSWER Directive #9355.0-30. <a href="http://www.epa.gov/oswer/riskassessment/baseline.htm">http://www.epa.gov/oswer/riskassessment/baseline.htm</a>
F	PA. 1992. U.S. Environmental Protection Agency, Office of Solid Waste and Emergency Response. Supplemental Guidance to RAGS: Calculating the Concentration Term. Publication 9285.7-081. <a href="http://www.deq.state.or.us/lq/pubs/forms/tanks/UCLsEPASupGuidance.pdf">http://www.deq.state.or.us/lq/pubs/forms/tanks/UCLsEPASupGuidance.pdf</a>
	EPA. 1997. Exposure Factors Handbook, Volumes I, II, and III. U.S. Environmental Protection agency, Office of Research and Development. EPA/600/P-95/002Fa.
C	EPA. 2003. Libby Asbestos Site, Residential/Commercial Cleanup Action Level and Clearance Criteria Technical Memorandum. Draft Final. U.S. Environmental Protection Agency, Region 8. December 15, 2003.

EPA. 2006. Data Quality Assessment: A Reviewer's Guide. EPA QA/G-9R. U.S. Environmental Protection Agency, Office of Environmental Information. EPA/240/B-06/002. February 2006. <a href="http://www.epa.gov/QUALITY/qs-docs/g9r-final.pdf">http://www.epa.gov/QUALITY/qs-docs/g9r-final.pdf</a>
EPA. 2007a. Sampling and Analysis Plan for Activity-Based Outdoor Air Exposures, Operable Unit 4, Libby, Montana, Superfund Site. Final. U.S. Environmental Protection Agency, Region 8. July 6, 2007.
EPA. 2007b. Sampling and Analysis Plan for Activity-Based Indoor Air Exposures, Operable Unit 4, Libby, Montana, Superfund Site. Final. U.S. Environmental Protection Agency, Region 8. July 6, 2007.
EPA. 2007c. ProUCL Version 4.00.02 User Guide. U.S. Environmental Protection Agency, Office of Research and Development, National Exposure Research Laboratory. EPA/600/R-07/038. April 2007. <a href="http://www.epa.gov/esd/tsc/TSC_form.htm">http://www.epa.gov/esd/tsc/TSC_form.htm</a>
EPA. 2007d. Libby Sampling and Quality Assurance Project Plan Field Modification LFO 000114. Prepared by N. Bein, CDM Field Team Leader, 09/19/07.
EPA. 2007e. Effect of Indirect Preparation on LA Structure Count in Air Samples from Libby, MT, Appendix 3.1 of the Summary Report for Data Collected Under the Supplemental Remedial Investigation Quality Assurance Project Plan (SQAPP). U.S. Environmental Protection Agency, Region 8 with technical assistance from SRC, Inc. October 23, 2007.
EPA. 2008a. Libby Sampling and Quality Assurance Project Plan Field Modification LFO 000128. Prepared by N. Bein, CDM Field Team Leader, 04/21/08.
EPA. 2008b. Framework for Investigating Asbestos-Contaminated Sites. Report prepared by the Asbestos Committee of the Technical Review Workgroup of the Office of Solid Waste and Emergency Response, U.S. Environmental protection Agency. OSWER Directive #9200.0-68. <a href="http://epa.gov/superfund/health/contaminants/asbestos/pdfs/framework_asbestos_guidance.pdf">http://epa.gov/superfund/health/contaminants/asbestos/pdfs/framework_asbestos_guidance.pdf</a>
EPA. 2009. Summary of Outdoor Ambient Air Monitoring for Asbestos at the Libby Asbestos Site, Libby, Montana (October 2006 to June 2008). Prepared by U.S. Environmental Protection Agency, Region 8, with technical support from SRC, Inc. February 9, 2009.
Harris. 2009. TEM Observations of Amphiboles from El Dorado Hills Study. Geological Society of America Abstracts with Programs, October 21, 2009. Vol. 41, No. 7, p. 703.
HEI-AR (Health Effects Institute – Asbestos Research). 1991. Asbestos in Public and Commercial Buildings: A Literature Review and Synthesis of Current Knowledge. Health Effects Institute – Asbestos Research. Cambridge, Massachusetts.
Hodgson JT, Darnton A. 2000. The Quantitative Risks of Mesothelioma and Lung Cancer in Relation to Asbestos Exposure. Ann. Occup. Hyg. 44:565–601.

ISO. 1995. International Organization for Standardization Ambient Air. Determination of asbestos fibres – Direct-transfer transmission electron microscopy method. ISO 10312:1995(E).  McDonald JC, McDonald AD, Armstrong B, Sebastien P. 1986. Cohort study of mortality of vermiculite miners exposed to tremolite. <i>Brit. J. Ind. Med.</i> 43:436-444.  McDonald JC, Harris J, Armstrong B. 2004. Mortality in a cohort of vermiculite miners exposed to fibrous Amphibole in Libby, Montana. <i>Occup. Environ. Med.</i> 61:363-366.  Meeker GP, Bern AM, Brownfield IK, Lowers HA, Sutley SJ, Hoeffen TM, Vance JS. 2003. The Composition and Morphology of Amphiboles from the Rainy Creek Complex, Near Libby, Montana. <i>American Mineralogist</i> 88:1955-1969.  Noonan CW, Pfau JC, Larson TC, Spence MR. 2006. Nested cased-control study of autoimmune disease in an asbestos-exposed population. <i>Environ. Health Perspect.</i> 114:1243-1247.  Peipins LA, Lewin M, Campolucci S, Lybarger JA, Miller A, Middleton D, et al. 2003. Radiographic abnormalities and exposure to asbestos-contaminated vermiculite in the community of Libby, Montana, USA. <i>Environ. Health Perspect.</i> 111:1753-1759.  Sahle W and Laszlo I. 1996. Airborne Inorganic Fibre Monitoring by Transmission Electron Microscope (TEM): Comparison of Direct and Indirect Sample Transfer Methods. <i>Ann. Occup.</i>		LIMAL	
asbestos fibres – Direct-transfer transmission electron microscopy method. ISO 10312:1995(E).  McDonald JC, McDonald AD, Armstrong B, Sebastien P. 1986. Cohort study of mortality of vermiculite miners exposed to tremolite. <i>Brit. J. Ind. Med.</i> 43:436-444.  McDonald JC, Harris J, Armstrong B. 2004. Mortality in a cohort of vermiculite miners exposed to fibrous Amphibole in Libby, Montana. <i>Occup. Environ. Med.</i> 61:363-366.  Meeker GP, Bern AM, Brownfield IK, Lowers HA, Sutley SJ, Hoeffen TM, Vance JS. 2003. The Composition and Morphology of Amphiboles from the Rainy Creek Complex, Near Libby, Montana. <i>American Mineralogist</i> 88:1955-1969.  Noonan CW, Pfau JC, Larson TC, Spence MR. 2006. Nested cased-control study of autoimmune disease in an asbestos-exposed population. <i>Environ. Health Perspect.</i> 114:1243-1247.  Peipins LA, Lewin M, Campolucci S, Lybarger JA, Miller A, Middleton D, et al. 2003. Radiographic abnormalities and exposure to asbestos-contaminated vermiculite in the community of Libby, Montana, USA. <i>Environ. Health Perspect.</i> 111:1753-1759.  Sahle W and Laszlo I. 1996. Airborne Inorganic Fibre Monitoring by Transmission Electron Microscope (TEM): Comparison of Direct and Indirect Sample Transfer Methods. <i>Ann. Occup. Hyg.</i> 40:29-44.  Sullivan PA. 2007. Vermiculite, respiratory disease, and asbestos exposure in Libby, Montana: update of a cohort mortality study. <i>Environ. Health Perspect.</i> 115:579-585.  Updike, DJ. 2007. Quality Assurance Field Audit Report – 2007, Interior/Exterior Activity-Based Sampling, Libby, Montana. November 20, 2007.  Whitehouse AC. 2004. Asbestos-related pleural disease due to tremolite associated with progressive loss of lung function: serial observations in 123 miners family members, and residents of Libby, Montana. <i>Am. J. Ind. Med.</i> 46:219-225.  Whitehouse AC, Black CB, Heppe MS, Ruckdeschel J, Levin SM. 2008. Environmental	Hwang and Wang. 1983. Comparison Environ. Health 38:5-10.	n of Methods of Assessing Fiber Concentrations. And	ch.
vermiculite miners exposed to tremolite. <i>Brit. J. Ind. Med.</i> 43:436-444.  McDonald JC, Harris J, Armstrong B. 2004. Mortality in a cohort of vermiculite miners exposed to fibrous Amphibole in Libby, Montana. <i>Occup. Environ. Med.</i> 61:363-366.  Meeker GP, Bern AM, Brownfield IK, Lowers HA, Sutley SJ, Hoeffen TM, Vance JS. 2003. The Composition and Morphology of Amphiboles from the Rainy Creek Complex, Near Libby, Montana. <i>American Mineralogist</i> 88:1955-1969.  Noonan CW, Pfau JC, Larson TC, Spence MR. 2006. Nested cased-control study of autoimmune disease in an asbestos-exposed population. <i>Environ. Health Perspect.</i> 114:1243-1247.  Peipins LA, Lewin M, Campolucci S, Lybarger JA, Miller A, Middleton D, et al. 2003. Radiographic abnormalities and exposure to asbestos-contaminated vermiculite in the community of Libby, Montana, USA. <i>Environ. Health Perspect.</i> 111:1753-1759.  Sahle W and Laszlo I. 1996. Airborne Inorganic Fibre Monitoring by Transmission Electron Microscope (TEM): Comparison of Direct and Indirect Sample Transfer Methods. <i>Ann. Occup. Hyg.</i> 40:29-44.  Sullivan PA. 2007. Vermiculite, respiratory disease, and asbestos exposure in Libby, Montana: update of a cohort mortality study. <i>Environ. Health Perspect.</i> 115:579-585.  Updike, DJ. 2007. Quality Assurance Field Audit Report – 2007, Interior/Exterior Activity-Based Sampling, Libby, Montana. November 20, 2007.  Whitehouse AC. 2004. Asbestos-related pleural disease due to tremolite associated with progressive loss of lung function: serial observations in 123 miners family members, and residents of Libby, Montana. <i>Am. J. Ind. Med.</i> 46:219-225.	asbestos fibres - Direct-transfer transm		
to fibrous Amphibole in Libby, Montana. <i>Occup. Environ. Med.</i> 61:363-366.  Meeker GP, Bern AM, Brownfield IK, Lowers HA, Sutley SJ, Hoeffen TM, Vance JS. 2003. The Composition and Morphology of Amphiboles from the Rainy Creek Complex, Near Libby, Montana. <i>American Mineralogist</i> 88:1955-1969.  Noonan CW, Pfau JC, Larson TC, Spence MR. 2006. Nested cased-control study of autoimmune disease in an asbestos-exposed population. <i>Environ. Health Perspect.</i> 114:1243-1247.  Peipins LA, Lewin M, Campolucci S, Lybarger JA, Miller A, Middleton D, et al. 2003. Radiographic abnormalities and exposure to asbestos-contaminated vermiculite in the community of Libby, Montana, USA. <i>Environ. Health Perspect.</i> 111:1753-1759.  Sahle W and Laszlo I. 1996. Airborne Inorganic Fibre Monitoring by Transmission Electron Microscope (TEM): Comparison of Direct and Indirect Sample Transfer Methods. <i>Ann. Occup. Hyg.</i> 40:29-44.  Sullivan PA. 2007. Vermiculite, respiratory disease, and asbestos exposure in Libby, Montana: update of a cohort mortality study. <i>Environ. Health Perspect.</i> 115:579-585.  Updike, DJ. 2007. Quality Assurance Field Audit Report – 2007, Interior/Exterior Activity-Based Sampling, Libby, Montana. November 20, 2007.  Whitehouse AC. 2004. Asbestos-related pleural disease due to tremolite associated with progressive loss of lung function: serial observations in 123 miners family members, and residents of Libby, Montana. <i>Am. J. Ind. Med.</i> 46:219-225.  Whitehouse AC, Black CB, Heppe MS, Ruckdeschel J, Levin SM. 2008. Environmental	•	•	
Composition and Morphology of Amphiboles from the Rainy Creek Complex, Near Libby, Montana. <i>American Mineralogist</i> 88:1955-1969.  Noonan CW, Pfau JC, Larson TC, Spence MR. 2006. Nested cased-control study of autoimmune disease in an asbestos-exposed population. <i>Environ. Health Perspect.</i> 114:1243-1247.  Peipins LA, Lewin M, Campolucci S, Lybarger JA, Miller A, Middleton D, et al. 2003. Radiographic abnormalities and exposure to asbestos-contaminated vermiculite in the community of Libby, Montana, USA. <i>Environ. Health Perspect.</i> 111:1753-1759.  Sahle W and Laszlo I. 1996. Airborne Inorganic Fibre Monitoring by Transmission Electron Microscope (TEM): Comparison of Direct and Indirect Sample Transfer Methods. <i>Ann. Occup. Hyg.</i> 40:29-44.  Sullivan PA. 2007. Vermiculite, respiratory disease, and asbestos exposure in Libby, Montana: update of a cohort mortality study. <i>Environ. Health Perspect.</i> 115:579-585.  Updike, DJ. 2007. Quality Assurance Field Audit Report – 2007, Interior/Exterior Activity-Based Sampling, Libby, Montana. November 20, 2007.  Whitehouse AC. 2004. Asbestos-related pleural disease due to tremolite associated with progressive loss of lung function: serial observations in 123 miners family members, and residents of Libby, Montana. <i>Am. J. Ind. Med.</i> 46:219-225.  Whitehouse AC, Black CB, Heppe MS, Ruckdeschel J, Levin SM. 2008. Environmental	_		t
autoimmune disease in an asbestos-exposed population. <i>Environ. Health Perspect.</i> 114:1243-1247.  Peipins LA, Lewin M, Campolucci S, Lybarger JA, Miller A, Middleton D, et al. 2003. Radiographic abnormalities and exposure to asbestos-contaminated vermiculite in the community of Libby, Montana, USA. <i>Environ. Health Perspect.</i> 111:1753-1759.  Sahle W and Laszlo I. 1996. Airborne Inorganic Fibre Monitoring by Transmission Electron Microscope (TEM): Comparison of Direct and Indirect Sample Transfer Methods. <i>Ann. Occup. Hyg.</i> 40:29-44.  Sullivan PA. 2007. Vermiculite, respiratory disease, and asbestos exposure in Libby, Montana: update of a cohort mortality study. <i>Environ. Health Perspect.</i> 115:579-585.  Updike, DJ. 2007. Quality Assurance Field Audit Report – 2007, Interior/Exterior Activity-Based Sampling, Libby, Montana. November 20, 2007.  Whitehouse AC. 2004. Asbestos-related pleural disease due to tremolite associated with progressive loss of lung function: serial observations in 123 miners family members, and residents of Libby, Montana. <i>Am. J. Ind. Med.</i> 46:219-225.  Whitehouse AC, Black CB, Heppe MS, Ruckdeschel J, Levin SM. 2008. Environmental	Composition and Morphology of Amphi	boles from the Rainy Creek Complex, Near Libby,	he
Radiographic abnormalities and exposure to asbestos-contaminated vermiculite in the community of Libby, Montana, USA. <i>Environ. Health Perspect.</i> 111:1753-1759.  Sahle W and Laszlo I. 1996. Airborne Inorganic Fibre Monitoring by Transmission Electron Microscope (TEM): Comparison of Direct and Indirect Sample Transfer Methods. <i>Ann. Occup. Hyg.</i> 40:29-44.  Sullivan PA. 2007. Vermiculite, respiratory disease, and asbestos exposure in Libby, Montana: update of a cohort mortality study. <i>Environ. Health Perspect.</i> 115:579-585.  Updike, DJ. 2007. Quality Assurance Field Audit Report – 2007, Interior/Exterior Activity-Based Sampling, Libby, Montana. November 20, 2007.  Whitehouse AC. 2004. Asbestos-related pleural disease due to tremolite associated with progressive loss of lung function: serial observations in 123 miners family members, and residents of Libby, Montana. <i>Am. J. Ind. Med.</i> 46:219-225.  Whitehouse AC, Black CB, Heppe MS, Ruckdeschel J, Levin SM. 2008. Environmental	autoimmune disease in an asbestos-ex	•	-
Microscope (TEM): Comparison of Direct and Indirect Sample Transfer Methods. <i>Ann. Occup. Hyg.</i> 40:29-44.  Sullivan PA. 2007. Vermiculite, respiratory disease, and asbestos exposure in Libby, Montana: update of a cohort mortality study. <i>Environ. Health Perspect.</i> 115:579-585.  Updike, DJ. 2007. Quality Assurance Field Audit Report – 2007, Interior/Exterior Activity-Based Sampling, Libby, Montana. November 20, 2007.  Whitehouse AC. 2004. Asbestos-related pleural disease due to tremolite associated with progressive loss of lung function: serial observations in 123 miners family members, and residents of Libby, Montana. <i>Am. J. Ind. Med.</i> 46:219-225.  Whitehouse AC, Black CB, Heppe MS, Ruckdeschel J, Levin SM. 2008. Environmental	Radiographic abnormalities and exposi	ure to asbestos-contaminated vermiculite in the	
update of a cohort mortality study. <i>Environ. Health Perspect.</i> 115:579-585.  Updike, DJ. 2007. Quality Assurance Field Audit Report – 2007, Interior/Exterior Activity-Based Sampling, Libby, Montana. November 20, 2007.  Whitehouse AC. 2004. Asbestos-related pleural disease due to tremolite associated with progressive loss of lung function: serial observations in 123 miners family members, and residents of Libby, Montana. <i>Am. J. Ind. Med.</i> 46:219-225.  Whitehouse AC, Black CB, Heppe MS, Ruckdeschel J, Levin SM. 2008. Environmental		<u> </u>	).
Sampling, Libby, Montana. November 20, 2007.  Whitehouse AC. 2004. Asbestos-related pleural disease due to tremolite associated with progressive loss of lung function: serial observations in 123 miners family members, and residents of Libby, Montana. <i>Am. J. Ind. Med.</i> 46:219-225.  Whitehouse AC, Black CB, Heppe MS, Ruckdeschel J, Levin SM. 2008. Environmental	•		ıa:
progressive loss of lung function: serial observations in 123 miners family members, and residents of Libby, Montana. <i>Am. J. Ind. Med.</i> 46:219-225.  Whitehouse AC, Black CB, Heppe MS, Ruckdeschel J, Levin SM. 2008. Environmental	•	· · · · · · · · · · · · · · · · · · ·	ed
	progressive loss of lung function: serial	observations in 123 miners family members, and	
		•	

		$\bigcap$
		$\bigcap$
		$\mathcal{I}$

<u></u>	
~	
. ~	
Ü	
- 14	
Š	
$\overline{}$	
$\overline{}$	
)	
ن	
$\overline{}$	
Ų	
U	
~	
ب	
ال	
ا	
<u> </u>	
ب	
77	
_	

.

			$\Box$
			<i>L. J.</i>
			$\widehat{}$
			\ i
			$\overline{}$
			~1
			Ü
			$\overline{\ }$
			ن
			$\bigcap$
			J
			$\bigcap$
			۲.,
			$\bigcap$
		•	٢
			Ų
:			
			ب
ı			
			( )
i			~
			ٺ
			$\neg$
			ك
			$\overline{}$
			u
			~~
			u
			<b>;</b> 7
			<u> </u>
			- 1
			u
			$\cup$
•			

# TABLE 4-1 CLEANUP STATUS OF ALL OUTDOOR ABS PROPERTIES

		T		Re	emoval Acti	vity Summa	ary	
ABS Area	Address	Interior Cleanup Date	Exterior Cleanup Date	VCI Removal	Interior Cleaning	Exterior Soil Removal	Building Materials	
1	10 Park St	9/21/2006	9/29/2006	Х	X	Х		
2	1016 Nevada Ave							
3	1021 Nevada Ave							
4	1022 Utah Ave							
5	1037 California Ave		8/16/2006			X		
6	1047 Sheldon Flats Rd							
7	105 W Oak St							
8	106 Voves Ave	7/10/2003	7/10/2003	X	Х	Х		
9	109 Post St	6/23/2008	6/25/2008	Х		Χ		
10	120 Manor Dr							
11,12	1222 Dakota Ave							
13	1302 Airth Ave		9/3/2003			Х	_	
14	1313 Renwood Dr							
15	1314 Dakota Ave	6/28/2005	6/27/2005	Х		X		
16	1339 Highway 37 N	<u> </u>						
17	1414 Main Ave	10/18/2006	7/14/2006	Χ		X		
18,19	1455 Cabinet Heights Rd		9/24/2008			X		
20	156 S Central Rd	8/7/2002	8/7/2002	Х	X	X		
21	1573 Kootenai River Rd		8/13/2003			X		
22	1621 Main Ave	1/7/2004	11/17/2003	X	X	X		
23	1761 Highway 2 S	1 .,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	5/22/2007			X		
24	1915 Kootenai River Rd	<del>                                     </del>	0,22,200.					
25,26,27	208 W Cedar St		6/23/2008			X		
28	21 Voves Ave	6/5/2006	6/8/2006	Х		X		
	22 Evergreen St	7/29/2008	7/14/2008	X	X	X	Х	
32	226 Spencer Rd	10/30/2007	771-72000	X	X		<del>^</del>	
33	2293 Kootenai River Rd	6/12/2003	6/12/2003	<u>x</u>	<u> </u>	Х		
34	2297 Kootenai River Rd	12/3/2008	0,12,2003	X	X	X	Х	
35	2375 Kootenai River Rd	12/3/2008			^			
36	241 S Central Rd							
37	2411 Kootenai River Rd			,				
38	25 Evans Rd							
39,40	2669 Highway 37 N	<del> </del>	7/11/2008			X		
41	269 N Central Rd	<del> </del>	//11/2008		-	^		
42	280 S Central Rd	6/17/2003	6/17/2003	X	x	X		
43	281 S Central Rd	0,17,2003	8/12/2003			X		
44	284 Taylor Rd	<del>                                     </del>	0/12/2003					
45	<del></del>	-	10/9/2004			v		
	292 Spencer Rd	10/4/2004	10/8/2004			X		
46	304 Spencer Rd	10/4/2004	10/4/2004	X	X	X		
47 48	32 Burr Ave 321 Bowen Hill Rd	8/13/2009	8/3/2009	X	X	X		

TABLE 4-1
CLEANUP STATUS OF ALL OUTDOOR ABS PROPERTIES

				Re	emoval Acti	vity Summa	ıry
50 3 51 3 52 3 53 4 54,55,56 4 57 4 58 4 59,60 5 61,62 5 63 6 64 6 65,66 6 67 6 68 6 69 8 70 8 71 8 72 8 73 8 74 9	Address	Interior Cleanup Date	Exterior Cleanup Date	VCI Removal	Interior Cleaning	Exterior Soil Removal	Building Materials
49	3652 Kootenai River Rd						
50	3652 Kootenai River Rd						
51	3796 Highway 2 S	9/16/2003	9/16/2003	Х	X	Х	
52	3798 Highway 2 S	9/16/2003	9/16/2003	Х	X	X	
53	420 Indian Head Rd		6/18/2008			Х	
54,55,56	45 Rose St W	7/25/2008	7/11/2008		X	X	
57	46 Timber Ln	10/10/2008	10/8/2008		X	Х	
58	460 Woodland Heights Rd		_				
59,60	545 Granite Ave		6/19/2008			Х	
61,62	546 Granite Ave	9/21/2005	9/21/2005		Х	X	
63	600 Granite Ave						
64	610 Granite Ave						
65,66	626 W 2nd St Ext						
67	6555 Kootenai River Rd						
68	6797 Farm to Market Rd						
69	813 Wisconsin Ave		7/13/2005			Х	
70	827 Greers Ferry Rd						
71	87 Yellowtail Rd	9/11/2003	9/3/2003		X	Х	
72	8801 Highway 2 S						
73	899 Farm to Market Rd						
74	912 California Ave						
75	99 Post St		9/29/2008			Х	

VCI = vermiculite-containing insulation

Table 4-2. Outdoor ABS Air Data - Round 1 (Summer 2007)

1   19 Per B.   1										ROUND							
1   1   1   1   2   2   2   2   2   2	ABS Area	Address		N Struct		Air Concentr	ration (s/cc)		N Str.			tration (s/cc)		N Struc		Air Concent	ration (s/cc)
1					1										İ	1	Total LA
3	1	10 Park St	0.00752	1	4	0.00752	0.03009	0.00662	5	6	0.03311	0.03973	0.00110	1	<del></del>	0.00110	0.00773
4 1022 Date And Display   0.00000   0.00000   0.00000   0.000000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.000000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000																	0.00363
5         DSO Celebrain And         ODIGINATION         3         0,00000         ORMAN         0,00000         0,00000         0,00000         0,00000         0,00000         0,00000         0,00000         0,00000         0,00000         0,00000         0,00000         0,00000         0,00000         0,00000         0,00000         0,00000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,000000         0,0000000         0,0000000         0,0000000         0,0000000         0,00000000000000000000000000000000000													·				0.00890
B   Str   Shedon Flam Rg   0.07700   0   3   0.0000   0.00001   1   2   0.00001   0.00001   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.000000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.000000   0.000000   0.00000   0.00000   0.000000   0.000000   0.00000													ı—				0.00941
8 00 Vivens Ave													1				0.01175
9 PR PRESE													<del></del>				0.07061
10   10   Niser Dr													<i></i>				0.08290
11   1222   Debeto-Ave     0.00854   15   51   0.77811   1.88988   0.00900   14   50   0.00904   0.34516   0.00858   24   31   0.12872   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.22   1.2	<u> </u>	·											<del></del>				0.00000
13   152 Amh Ane	11	1222 Dakota Ave	0.03854	15	51		1.96558	0.00690	14		0.09664	0.34516	0.00539	24		0.12927	0.28547
14   151   Serviced D												<del></del>	<del></del>				0.01231
15   15   15   15   15   15   15   15																	0.00000
17													<del></del>				0.00000
14   MS Cambert Hagen Rd										<del></del>			<del></del>				0.01291
19		<del></del>		<u>-</u>													0.00000
20   15   S. German Rev Per													<del></del>				0.00697
22 1781 (gray 2 S	<del></del>				5								0.00100	2			0.00398
23 191 Fighway 2 S													ļ				0.03230
24   915 Koomen Reverted													<del></del>				0.34131
28 OR W. Corder St. 0.0017 0 0 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.000000																	0.00000
27   28 M Coder St	<del></del>				4						0.00174		·			0.00099	0.00099
22   22 Feynews St.   0.00991   0   0.00000   0.00903   0   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.000000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.000000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.00000   0.000000   0.000000   0.000000   0.000000   0.000000   0.000000   0.000000   0.000000   0.000000   0.000000   0.000000   0.000000   0.000000   0.0000000   0.000000   0.000000   0.000000   0.000000   0.000000   0.00													<del></del>				0.00192
22   Exergreen St													·				0.05285
31 22 Exegramen SI																	0.15380
222 Spentors Red													<del></del>				0.35525
33 2289 Kootman River Rd 0.00177 1 1 1 0.00177 0.00094 0 0 0.00000 0.00008 0 0 0.00000 0.00088 0 0 0.000000 0.0008 0 1 2 2 0.00180 0 0 0 0.00000 0.00090 0.00090 0.00090 0 0.00090 0.00090 0 0.00090 0 0.00090 0.00090 0 0.00090 0 0.00090 0.00090 0 0.00090 0.00090 0 0.00090 0.00090 0 0.00090 0.00090 0 0.00090 0.00090 0.00090 0 0.00090 0.00090 0 0.00090 0.00090 0.00090 0.00090 0.00090 0 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.00090 0.000		·											1				0.00000
34 2297 Koolman River Rd 0.00195 0 0 0.00000 0.00100 0 0 0.00100 0.00100 0.00100 1 2 0.00100 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.000000		<b></b> '											·				0.00000
241 S. Cantral Ref			0.00195	0	0	0.00000	0.00000	0.00180	0	0	0.00000	0.00000	0.00180	1	2	0.00180	0.00359
37 2411 Nocemen Rev 0.00477 5 8 0.0238 0.03818 0.00004 0 2 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.000000													+				0.01997
25 Fuers Rd													ł				0.35459
40 2898 Hjymey 27 N 0.00238 30 51 0.07138 0.12134 0.00212 3 7 0.00637 0.01487 0.00105 10 16 0.01002 0.0 41 289 N. Central Rd 0.00150 1 1 0.09100 0.00100 0.00100 2 4 0.00221 0.00902 0.00098 0 0 0.00000 0.0 42 281 S. Central Rd 0.00278 1 2 52 0.08199 0.35140 0.02808 11 39 0.28800 1.0719 0.00005 2 21 0.00160 0.0 43 281 S. Central Rd 0.00279 4 17 0.11170 0.47474 0.00272 1 3 0.00272 0.00815 0.00055 1 3 0.00935 0.0 44 281 S. Central Rd 0.00279 4 17 0.11170 0.47474 0.00272 1 3 0.00272 0.00815 0.00055 1 3 0.00935 0.0 45 282 Spencer Rd 0.00473 0 0 0.00090 0.00000 0.00000 0.00000 0.00000 0.00000 0 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.000000																_ <del></del>	0.02578
41 299 K. Cantaal Rd																	0.18748
42   280 S. Central RCf													<del> </del>				0.01700
45 292 Spennor Rd		<del></del>						-							~		0.00000
45 292 Spencer Rd	43	281 S. Central Rd				0.11170		0.00272						1		0.00935	0.02804
46 90 Spencer Rd		<del> '</del>												<del></del> -			0.00098
48 321 Bowen Hill Rd																	0.00000
49 3852 Kootenai River Rd													<del></del>				0.02821
S0   3652 Koolenal River Rd   0.00753   9   26   0.06781   0.19588   0.00772   11   38   0.08491   0.29332   0.00732   6   25   0.04389   0.1													·				0.00000
51 3796 Highway 2 S																	0.02421
52 3798 Highway 2 S													·			•	0.18288
54 45 Rose St W 0.01316 21 48 0.27638 0.63172 0.00276 1 8 0.00276 0.02209 0.00100 16 46 0.01605 0.0 55 45 Rose St W 0.02387 4 17 0.09546 0.40571 0.01460 3 24 0.04381 0.35050 0.00090 2 7 0.00180 0.0 56 45 Rose St W 0.04235 9 50 0.38113 2.11741 0.06012 14 51 0.84174 3.06633 0.02392 13 52 0.31093 1.2 57 46 Timber Ln 0.47670 0 0 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.000000		·			1				0		0.00000		0.00097				0.00000
55 45 Rose St W 0.02387 4 17 0.09546 0.40571 0.01460 3 24 0.04381 0.35050 0.00090 2 7 0.00180 0.0 5 5 45 Rose St W 0.04235 9 50 0.38113 2.11741 0.06012 14 51 0.84174 3.08633 0.02392 13 52 0.31093 1.2 57 46 Timber Ln 0.47670 0 0 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.													·				0.07920
56         45 Rose St W         0.04235         9         50         0.38113         2.11741         0.06012         14         51         0.84174         3.06833         0.02392         13         52         0.31093         12           57         46 Timber Ln         0.47670         0         0         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.								-					{				0.04613
57 46 Timber Ln 0.47670 0 0 0.00000 0.00000 0.00092 0 0 0.00000 0.00000 0.00090 2 2 0.00180 0.0 58 460 Woodland Heights Rd 0.00100 0 0 0.00000 0.00000 0.00009 0 0 0 0.00000 0.00000 0.00097 1 1 0.000097 0.0 59 545 Granite Ave 0.00085 6 10 0.00507 0.00846 0.00084 0 0 0.00000 0.00000 0.00000 1 2 0.00000 0.0 60 545 Granite Ave 0.00091 3 22 0.00273 0.02000 0.00381 14 52 0.04319 0.16040 0.00091 0 5 0.00000 0.0 61 546 Granite Ave 0.00191 0 2 0.00000 0.00383 0.00100 4 11 0.00399 0.01097 0.00098 0 1 0.00000 0.0 65 546 Granite Ave 0.00191 0 2 0.00000 0.0333 0.00100 4 11 0.00399 0.01097 0.00098 0 1 0.00000 0.0 65 546 Granite Ave 0.00185 14 23 0.02307 0.03790 0.00176 13 26 0.02285 0.04599 0.01097 0.00098 0 1 0.00000 0.0 65 546 Granite Ave 0.00557 4 24 0.02226 0.13359 0.00526 7 37 0.03679 0.19448 0.00530 2 14 0.01061 0.0 64 610 Granite Ave 0.00057 4 24 0.02226 0.13359 0.00526 7 37 0.03679 0.19448 0.00530 2 14 0.01061 0.0 64 610 Granite Ave 0.00090 0 0 0.00000 0.00000 0.00008 0 0 0.00000 0.00000 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0.00001 0		· <del></del>	-										<del></del>				1.24371
59         545 Granite Ave         0.00085         6         10         0.00507         0.00846         0.00084         0         0         0.00000         0.00000         0.00090         1         2         0.00090         0.0           60         545 Granite Ave         0.00091         3         22         0.00273         0.02000         0.00388         14         52         0.04319         0.16040         0.00091         0         5         0.00000         0.0           61         546 Granite Ave         0.00191         0         2         0.00000         0.0383         0.00100         4         11         0.03999         0.01097         0.00098         0         1         0.00000         0.0           62         546 Granite Ave         0.00165         14         23         0.02397         0.03790         0.00176         13         26         0.02285         0.04569         0.00181         8         11         0.01446         0.0           63         600 Granite Ave         0.00590         0         0         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000         0.00000	57	46 Timber Ln				0.00000	0.00000							2	2		0.00180
60 545 Granite Ave 0.00091 3 22 0.00273 0.02000 0.00308 14 52 0.04319 0.16040 0.00091 0 5 0.00000 0.0 61 546 Granite Ave 0.00191 0 2 0.00000 0.00383 0.00100 4 11 0.00399 0.01097 0.00098 0 1 0.00000 0.0 62 546 Granite Ave 0.00165 14 23 0.02307 0.03790 0.00176 13 26 0.02285 0.04569 0.00181 8 11 0.01446 0.0 63 600 Granite Ave 0.00557 4 24 0.02226 0.13359 0.00526 7 37 0.03679 0.19448 0.00530 2 14 0.01061 0.0 64 610 Granite Ave 0.00090 0 0 0.00000 0.00000 0.00088 0 0 0.00000 0.00001 0.00091 0 0 0.00000 0.0 65 626 W. 2nd St Ext 0.00396 3 6 0.01187 0.02374 0.0384 10 21 0.03841 0.08065 0.02029 1 5 0.02029 0.1 66 626 W. 2nd St Ext 0.00880 5 7 0.04399 0.06159 0.02000 22 54 0.43992 1.07981 0.00224 6 14 0.01346 0.0 67 6555 Kootenai River Rd 0.00207 17 27 0.03521 0.05592 0.00204 11 14 0.02249 0.02863 0.00085 0 0 0.00000 0.0 68 6797 Farm to Market Rd 0.00102 1 3 0.00102 0.00305 0.00101 0 1 0.00000 0.00101 0.00100 1 1 0.00100 0.0 69 813 Wisconsin Ave 0.00984 0 0 0.00000 0.00000 0.00008 0 1 0.00000 0.00098 0 1 0.00000 0.0 70 827 Greens Ferry Rd 0.00183 4 12 0.00731 0.02194 0.00098 0 1 0.00000 0.00199 0.00098 1 3 0.00094 0.0 71 87 Yellowfail Rd 0.00085 1 1 0.00095 0.00000 0.00000 0.00000 0.00000 0.00098 0 0 0 0.00000 0.00000 0.00000 0.00000 0.00000 0.00098 0 0 0 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00098 0 0 0 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.0000																	0.00097
61         546 Granite Ave         0.00191         0         2         0.00000         0.00383         0.00100         4         11         0.00399         0.01097         0.00098         0         1         0.00000         0.0           62         546 Granite Ave         0.00165         14         23         0.02307         0.03790         0.00176         13         26         0.02285         0.04569         0.00181         8         11         0.01446         0.0           63         600 Granite Ave         0.00557         4         24         0.02226         0.13359         0.00526         7         37         0.03679         0.19448         0.00530         2         14         0.01061         0.0           64         610 Granite Ave         0.00090         0         0.00000         0.00000         0.00088         0         0         0.00000         0.00091         0         0.00000         0.0           65         626 W. 2nd St Ext         0.00386         3         6         0.01187         0.02374         0.00384         10         21         0.03841         0.00209         1         5         0.02029         1         5         0.02029         0         1         5<																	0.00179
63 600 Granite Ave 0.00557 4 24 0.02226 0.13359 0.00526 7 37 0.03679 0.19448 0.00530 2 14 0.01061 0.0 64 610 Granite Ave 0.00090 0 0 0.00000 0.00000 0.00008 0 0 0.00000 0.00000 0.00091 0 0 0.00000 0.0 0.0 0.0 0.0 0.0 0.0 0.													+				0.00098
64 610 Granite Ave 0.00090 0 0 0.00000 0.00000 0.00088 0 0 0.000000 0.00000 0.00091 0 0 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.000000																	0.01989
65 626 W. 2nd St Ext 0.00396 3 6 0.01187 0.02374 0.00384 10 21 0.03841 0.08065 0.02029 1 5 0.02029 0.1 66 626 W. 2nd St Ext 0.00880 5 7 0.04399 0.06159 0.02000 22 54 0.43992 1.07981 0.00224 6 14 0.01346 0.0 67 6555 Kootenai River Rd 0.00207 17 27 0.03521 0.05592 0.00204 11 14 0.02249 0.02863 0.00085 0 0 0.00000 0.0 68 6797 Farm to Market Rd 0.00102 1 3 0.00102 0.00305 0.00101 0 1 0.00000 0.00101 0.00100 1 1 0.00100 1 1 0.00100 0.0 69 813 Wisconsin Ave 0.00094 0 0 0.00000 0.00000 0.00008 0 1 0.00000 0.00094 1 2 0.00094 0.0 70 827 Greers Ferry Rd 0.00183 4 12 0.00731 0.02194 0.00093 1 1 0.00000 0.00098 0.00091 0 0 0.00091 0 0 0.00000 0.0017 87 Yellowtait Rd 0.00097 0 0 0.00000 0.00000 0.00100 0 2 0.00000 0.00199 0.00098 1 3 0.00098 0.0 72 8801 Highway 2 S 0.00955 1 1 0.00955 0.00955 0.00955 0.00959 0 1 0.00000 0.00098 0 0 0 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.00000 0.000000				<del></del>									+				0.07424
66 626 W. 2nd St Ext 0.00880 5 7 0.04399 0.06159 0.02000 22 54 0.43992 1.07981 0.00224 6 14 0.01346 0.0 67 6555 Kootenai River Rd 0.00207 17 27 0.03521 0.05592 0.00204 11 14 0.02249 0.02863 0.00085 0 0 0.00000 0.0 0.0 0.0 0.0 0.0 0.0 0.								<b>-</b>					<del> </del>				0.10147
68 6797 Farm to Market Rd 0.00102 1 3 0.00102 0.00305 0.00101 0 1 0.00000 0.00101 0.00100 1 1 0.00100 0.0 69 813 Wisconsin Ave 0.00094 0 0 0.00000 0.00000 0.00098 0 1 0.00000 0.00098 0 0.00094 1 2 0.00094 0.0 70 827 Greers Ferry Rd 0.00183 4 12 0.00731 0.02194 0.00093 1 1 0.00000 0.00093 0.00093 0.00091 0 0 0.00000 0.0 71 87 Yelkowtail Rd 0.00097 0 0 0.00000 0.00000 0.00100 0 2 0.00000 0.00199 0.00098 1 3 0.00098 0.0 72 8801 Highway 2 S 0.00955 1 1 0.00955 0.00955 0.00959 0 1 0.00000 0.00000 0.00000 0.00000 0.0 73 899 Farm to Market Rd 0.00207 3 4 0.00621 0.00828 0.00201 0 0 0.00000 0.00000 0.00000 0.00000 0.00098 0 0 0 0.00000 0.0 74 912 California Ave 0.01464 18 50 0.26358 0.73217 0.85655 22 61 14.44402 40.04934 0.01172 11 51 0.12897 0.5					7					54	_			<u>-</u>			0.03140
69 813 Wisconsin Ave 0.00094 0 0 0.00000 0.00008 0 1 0.00000 0.00098 0 0.00094 1 2 0.00094 0.0 70 827 Greers Ferry Rd 0.00183 4 12 0.00731 0.02194 0.00093 1 1 0.00000 0.00093 0.00093 0.00091 0 0 0.00000 0.0 71 87 Yelikuwtail Rd 0.00097 0 0 0.00000 0.00000 0.00100 0 2 0.00000 0.00199 0.00098 1 3 0.00098 0.0 72 8801 Highway 2 S 0.00955 1 1 0.00955 0.00955 0.00959 0 1 0.00000 0.00000 0.00000 0.0 73 899 Farm to Market Rd 0.00207 3 4 0.00621 0.00828 0.00201 0 0 0.00000 0.00000 0.00000 0.00098 0 0 0 0.00000 0.0 74 912 California Ave 0.01464 18 50 0.26358 0.73217 0.65655 22 61 14.44402 40.04934 0.01172 11 51 0.12897 0.5																	0.00000
70         827 Greers Ferry Rd         0.00183         4         12         0.00731         0.02194         0.00093         1         1         0.00093         0.00093         0.00091         0         0         0.00000         0.0           71         87 Yelkowtail Rd         0.00097         0         0         0.00000         0.00000         0.0100         0         2         0.00000         0.00199         0.00098         1         3         0.00098         0.0           72         8801 Highway 2 S         0.00955         1         1         0.00955         0.00959         0         1         0.00000         0.00959         0.01005         0         3         0.00000         0.0           73         899 Farm to Market Rd         0.00207         3         4         0.0621         0.00828         0.00201         0         0.00000         0.00000         0.00000         0.00000         0.00098         0         0         0.00000         0.00000         0.00098         0         0         0.00000         0.0         0.00000         0.00000         0.00000         0.0         0.00000         0.00000         0.0         0.00000         0.00000         0.00000         0.0         0.00000																	0.00100
71 87 Yelkowtaii Rd 0.00097 0 0 0.00000 0.00000 0.00100 0 2 0.00000 0.00199 0.00098 1 3 0.00098 0.0 72 8801 Highway 2 S 0.00955 1 1 0.00955 0.00955 0.00959 0 1 0.00000 0.00959 0.01005 0 3 0.00000 0.0 73 899 Farm to Market Rd 0.00207 3 4 0.00621 0.00828 0.00201 0 0 0.00000 0.00000 0.00098 0 0 0 0.00000 0.0 74 912 California Ave 0.01464 18 50 0.26358 0.73217 0.65655 22 61 14.44402 40.04934 0.01172 11 51 0.12897 0.5		<del></del>															0.00000
73 899 Farm to Market Rd 0.00207 3 4 0.00621 0.00828 0.00201 0 0 0.00000 0.00000 0.00008 0 0 0.00000 0.0 74 912 California Ave 0.01464 18 50 0.26358 0.73217 0.65655 22 61 14.44402 40.04934 0.01172 11 51 0.12897 0.5	71	87 Yellowtail Rd							0	2					3		0.00293
74 912 California Ave 0.01464 18 50 0.26358 0.73217 0.65655 22 61 14.44402 40.04934 0.01172 11 51 0.12897 0.5		·											+· <del></del>				0.03016
		<del></del>											·				0.00000
0.00 CE (EDDUS) I DOCOULU UNDUBLIA O DOCOULU DOCOULU O I DOCOULU I	75	99 Post St	0.00097	0	0	0.00000	0.00000	0.00336	0	1	0.00000	0.00336	0.00097	3	5	0.00292	0.00486

Outdoor ABS Summary_PCME_V2.xls; air data

Table 4-3. Outdoor ABS Air Data - Round 2 (Spring 2008)

			_	Mourine					ROUND :	2	-			Raking		
ABŞ Area	Address	Mowing  N Structures Air Concentration (s/cc)						N Struc	Digging dures	Air Concen	tration (s/cc)		N Struc		Air Concent	ration (s/o
, , , , , , , , , , , , , , , , , ,		Sensitivity (cc) ⁻¹	PCME LA	Total LA	PCME LA	Total LA	Sensitivity (cc) ⁻¹	PCME LA	Total LA	PCME LA	Total LA	Sensitivity (cc) ⁻¹	PCME LA	Total LA	PCME LA	Total LA
	40 P - 1 O					L		<u> </u>			<u> </u>					
1	10 Park St 1016 Nevada Ave	0.00099	<u> </u>	1	0.00000	0.00000	0.00099	0		0.00000	0.00000	0.00099		0	0.00000	0.0000
$-\frac{2}{3}$	1021 Nevada Ave	0.01298	<del></del> 0	<u> </u>	0.00000	0.00000	0.00244	0	0 6	0.00000	0.00000	0.00090 0.00100	<u>0</u>	5	0.00000	0.0000
$-\frac{3}{4}$	1022 Utah Ave	0.00528			0.00000	0.01058	0.00288	<del>-</del> -	9-	0.00000	0.01058	0.00098	<u></u> ¦	1	0.00098	0.0000
	1037 California Ave	0.00028	0		0.00000	0.00000	0.00099	0	0	0.00000	0.00000	0.00097	0	<u>'</u>	0.00000	0.0000
6	1047 Sheldon Flats Rd	0.00095		15	0.00572	0.00000	0.00033		-4	0.00000	0.00000	0.00087	0	0	0.00000	0.0000
7	105 W. Oak St	0.00093	0	0	0.00000	0.00000	0.00232	0	0	0.00000	0.00000	0.00083	0	_ <del></del>	0.00000	0.0000
8	106 Voves Ave	0.00098	— <del>"</del> —	0	0.00000	0.00000	0.00095		0	0.00000	0.00000	0.00083	<del>0</del>	<del>-</del>	0.00000	0.0000
9	109 Post St	0.01024	27	 56	0.27646	0.06096	0.00226	13	27	0.02935	0.06096	0.00092	13	28	0.00000	0.0256
10	120 Manor Dr	0.00095	<del>2,</del>		0.00000	0.00000	0.000220	0	0	0.00000	0.00000	0.00096	2	2	0.00193	0.0230
11	1222 Dakota Ave	0.00524	17	55	0.08908	0.00708	0.00047		15	0.00236	0.00708	0.00047	22	39	0.01032	0.0013
12	1222 Dakota Ave	0.02806	<del>- 17</del>	52	0.47697	0.19121	0.00368	12	52	0.04413	0.19121	0.00095		0	0.00000	0.0000
13	1302 Airth Ave	0.00080	0	0	0.00000	0.00000	0.00083	0	0	0.00000	0.00000	0.00090	4	17	0.00359	0.0152
14	1313 Renwood Dr	0.00051	0	_ <del>-</del>	0.00000	0.00454	0.00045	4	10	0.00182	0.00454	0.00097	<del>_</del>	1	0.00097	0.0009
15	1314 Dakota Ave	0.00045	2	<del>-</del> <del>9</del>	0.00091	0.01234	0.00247		5	0.00494	0.01234	0.00210	<del> :</del>	3	0.00000	0.0062
16	1339 Highway 37 N	0.00530	1	10	0.00530	0.00896	0.00247	2	<u></u>	0.00224	0.00896	0.00210		2	0.00000	0.0054
17	1414 Main Ave	0.00330		4	0.00330	0.00000	0.00098	0	0	0.00000	0.00000	0.00098		0	0.00000	0.0000
18	1455 Cabinet Heights Rd	0.00224	<del>-</del>		0.00000	0.00007	0.00097		<u></u>	0.00000	0.00007	0.00099	<del></del>	0	0.00000	0.0000
19	1455 Cabinet Heights Rd	0.00088	9	9	0.01992	0.00097	0.00097	0	- <u>'</u>	0.00000	0.00097	0.00099	0		0.00000	0.0000
20	156 S. Central Rd	0.00221	0	0	0.00000	0.00093	0.00093	1	- <del> </del> -	0.00000	0.00093	0.00094	<del>- 0</del>	0	0.00000	0.0000
21	1573 Kootenai River Rd	0.00091	0	0	0.00000	0.00141	0.00141	2	7	0.00141	0.00141	0.00099	3	4	0.00000	0.0036
22	1621 Main Ave	0.00065	3	6	0.00345	0.01730	0.00247		<del>'</del>	0.00494	0.01730	0.00092	<u></u>		0.00275	0.0000
23	1761 Highway 2 S	0.00115	2	2	0.00953	0.00000	0.00271		<del></del>	0.00000	0.00000	0.00097	0	0	0.00000	0.0000
24	1915 Kootenai River Rd	0.00476		- 3	0.00000	0.00000	0.00097		<del></del> -	0.00000	0.00000	0.00097	0	3	0.00088	0.0000
25	208 W. Cedar St	0.00272	3	10	0.08016	0.04301	0.00269	6	16	0.00000	0.04301	0.00044	<u>_</u>	- 3	0.00553	0.0013
26	208 W. Cedar St	0.02874	7	11	0.20119	0.04301	0.00269	3	- 10	0.01633	0.04301	0.00117	<del></del>	. 3	0.00000	0.0243
27	208 W. Cedar St	0.02814	1	3	0.02814	0.00311	0.00344	<del>3</del>	<del>-</del>	0.00208	0.04355	0.00117	2	<u>. 3</u>	0.00553	0.0035
28	21 Voves Ave	0.02814	<del>-</del>	3 -	0.00000	0.00085	0.00104	2	- ·- <del>3</del>	0.00208	0.00085	0.00276	2	- 4	0.00000	0.0000
29	22 Evergreen St	0.00088	17	52	0.00000	0.11860	0.00085	9	54	0.00000	0.11860	0.00094	9	52	0.00542	0.0313
30	22 Evergreen St	0.00933	14	18	0.13604	0.00196	0.00220	<u>9</u>	2	0.00196	0.00196	0.00090	<u>9</u>	0	0.00042	0.0000
31	22 Evergreen St	0.00829	12	50	0.08658	0.74552	0.00096	16	58	0.20566	0.74552	0.00090		0	0.00000	0.0000
32	226 Spencer Rd	0.00721	<del></del>	11	0.06474	0.00081	<del></del>	1	1	0.20300	0.00081	0.00510	9	26	0.00500	0.1326
	2293 Kootenai River Rd						0.00081									
33		0.00096	$\frac{0}{2}$	9	0.00000	0.00000	0.00099			0.00000	0.00000	0.00098	0	- <u>0</u> -8	0.00000	0.0000
	2297 Kootenai River Rd	0.00617			0.01234	0.08084	0.02695		3	0.00000	0.08084	0.00607			0.01214	0.0485
35	2375 Kootenai River Rd	0.00099	4	10	0.00396	0.00000	0.00101		0	0.00000	0.00000	0.00101			0.00000	0.0000
36	241 S. Central Rd	0.00278	12	- 27	0.03339	0.14099	0.01085	5	13	0.05423	0.14099	0.00146	9	51	0.01318	0.0746
37	2411 Kootenai River Rd	0.00046	0		0.00000	0.00000	0.00088	0	0	0.00000	0.00000	0.00048	- 1	<u>2</u>	0.00048	0.0009
38	25 Evans Rd	0.00274	0	1	0.00000	0.00000	0.00105	0	0	0.00000	0.00000	0.00098	0	1	0.00000	0.0009
39	2669 Highway 37 N	0.00099	2	11	0.00197	0.00995	0.00099	3	10	0.00298	0.00995	0.00098	<del></del>	0	0.00000	0.0000
40	2669 Highway 37 N	0.00140	66	17	0.00841	0.06038	0.00263	7	23	0.01838	0.06038	0.00100	1	3	0.00100	0.0029
41	269 N. Central Rd	0.00099	0	0	0.00000	0.00095	0.00095	1		0.00095	0.00095	0.00096		0	0.00000	0.0000
42	280 S. Central Rd	0.00099	1	2	0.00099	0.00000	0.00100	0	0	0.00000	0.00000	0.00100	0	0	0.00000	0.0000
43	281 S. Central Rd	0.00097	0		0.00000	0.00000	0.00098	0	0_	0.00000	0.00000	0.00089	0	0	0.00000	0.0000
44	284 Taylor Rd	0.00216	<u> </u>	0	0.00000	0.00175	0.00087	1	2_	0.00087	0.00175	0.00141	0	0	0.00000	0.0000
45	292 Spencer Rd	0.00219	0	3	0.00000	0.00000	0.00480	0	0	0.00000	0.00000	0.00093	2		0.00186	0.0158
46	304 Spencer Rd	0.00097	3	3	0.00290	0.00394	0.00098	3	4	0.00295	0.00394	0.00099	1	1	0.00099	0.0009
47	32 Burr Ave	0.00427	5	8	0.02137	0.00415	0.00104	1 0	4	0.00104	0.00415	0.00097		3	0.00097	0.0029
48	321 Bowen Hill Rd	0.01060	2	2	0.02119	0.00000	0.00082	0	0	0.00000	0.00000	0.00096	0	0	0.00000	0.0000
49	3652 Kootenai River Rd	0.00098	0	0	0.00000	0.03361	0.00280	2	12	0.00560	0.03361	0.02774	16	32	0.44380	0.8876
50	3652 Kootenai River Rd	0.00112	4		0.00448	0.13597	0.00272	20	50	0.05439	0.13597	0.00099	<u>8</u>	17	0.00796	0.0169
51	3796 Highway 2 S	0.00100	00	0	0.00000	0.00000	0.00097	0	0	0.00000	0.00000	0.00100	0	0	0.00000	0.0000
52	3798 Highway 2 S	0.00097	- 0	0	0.00000	0.00096	0.00096	1 6	1	0.00096	0.00096	0.00098	0	1	0.00000	0.0009
53	420 Indian Head Rd	0.00266	5	12	0.01328	0.04967	0.00276	6	18	0.01656	0.04967	0.00100	1	2	0.00100	0.0020
54	45 Rose St W	0.00299		51	0.05685	0.12689	0.00276	18	46	0.04965	0.12689	0.00099	0	0	0.00000	0.0000
55	45 Rose St W	0.00185	0	- 0	0.00000	0.00156	0.00078	0	2	0.00000	0.00156	0.00098	0	2	0.00000	0.0019
56	45 Rose St W	0.00043	- 4	17	0.00171	0.00426	0.00047	3	9	0.00142	0.00426	0.00099	0	0	0.00000	0.0000
57	46 Timber Ln	0.02205			0.06614	0.00000	0.00084	0	0	0.00000	0.00000	0.00093	0		0.00000	0.0000
58	460 Woodland Heights Rd	0.00105	1	2	0.00105	0.00000	0.00276	0	0	0.00000	0.00000	0.00099	0	0	0.00000	0.0000
59	545 Granite Ave	0.00099	0	0	0.00000	0.00099	0.00099	0	1	0.00000	0.00099	0.00096	0	0	0.00000	0.0000
60	545 Granite Ave	0.00096	2	2	0.00192	0.00971	0.00097	2	10	0.00194	0.00971	0.00098	0	0	0.00000	0.0000
61	546 Granite Ave	0.00089	0		0.00000	0.00211	0.00105	0	2	0.00000	0.00211	0.00098	0	0	0.00000	0.0000
62	546 Granite Ave	0.00227	2	6	0.00454	0.00000	0.00087	0	0	0.00000	0.00000	0.00086	0	0	0.00000	0.0000
63	600 Granite Ave	0.00536		12	0.00536	0.00194	0.00097		2	0.00097	0.00194	0.00099		5	0.00099	0.0049
64	610 Granite Ave	0.00093	0	1	0.00000	0.02404	0.00086	8	28	0.00687	0.02404	0.00047	11	39	0.00522	0.0185
65	626 W. 2nd St Ext	0.00100	1	3	0.00100	0.00000	0.00100	0	0	0.00000	0.00000	0.00100	0	0	0.00000	0.0000
66	626 W. 2nd St Ext	0.00100	3	7	0.00300	0.00402	0.00100	3	4	0.00301	0.00402	0.00103		1	0.00103	0.0010
67	6555 Kootenai River Rd	0.00130	15	50	0.01957	0.01086	0.00099	6	11	0.00592	0.01086	0.00100	0	0	0.00000	0.0000
68	6797 Farm to Market Rd	0.00090	0	0	0.00000	0.00085	0.00085	1	1	0.00085	0.00085	0.00094	0	2	0.00000	0.0018
69	813 Wisconsin Ave	0.00099	0	0	0.00000	0.00100	0.00100	1	1	0.00100	0.00100	0.00097	0	0	0.00000	0.0000
70	827 Greers Ferry Rd	0.00164	4	19	0.00655	0.00390	0.00097	2	4	0.00195	0.00390	0.00098	1	1	0.00098	0.0009
71	87 Yellowtail Rd	0.00098	0	1	0.00000	0.00886	0.00098	3	9	0.00295	0.00886	0.00100	0	0	0.00000	0.0000
72	8801 Highway 2 S	0.00088	0	0	0.00000	0.00000	0.00097	0	0	0.00000	0.00000	0.00099	0	1	0.00000	0.0009
73	899 Farm to Market Rd	0.00092	0	0	0.00000	0.00000	0.00090	0	0	0.00000	0.00000	0.00093	0	0	0.00000	0.0000
74	912 California Ave	0.00851	2	3	0.01702	0.00000	0.00138	0	0	0.00000	0.00000	0.00097	0	0	0.00000	0.0000
75	99 Post St	0.00100	0	2	0.00000	0.00299	0.00100	1	3	0.00100	0.00299	0.00077	1	1	0.00077	0.0007

Table 4-4
Between Activity Correlations

	Round 1 (	PCME LA)	Round 2 (	PCME LA)
Comparison	Pearson	Spearman	Pearson	Spearman
Mow vs Rake	0.493	0.558	-0.022	0.227
Mow vs Dig	0.797	0.581	0.331	0.492
Rake vs Dig	0.362	0.550	-0.003	0.392

Table 4-5
Between Rounds Correlations

	Round 1 vs Rou	nd 2 (PCME LA)
Comparison	Pearson	Spearman
Mow vs mow	0.146	0.422
Rake vs rake	0.012	0.220
Dig vs dig	0.163	0.326
Mean vs mean	0.077	0.397

Table 4-6. Summary of Soil Data for Outdoor ABS Areas

		_								_		Visible \	/ermiculite							
ABS		PLM-VE	LA MF Bin As	signment				1 30-pt					d 2 30-pt						2 2-pt	
Area	Address	644	610	D 4 0	Visu	ai insp	ection	Detection		Visu	ial Ins	pection	Detection		Vi	isual Ir	nspecti	оп	Detection	٠
		Round 1 30-pt	Round 2 30-pt	Round 2 2-pt	N	L	м Н	Frequency	Score	N	L	м Н	Frequency	Score	N	L	M	н	Frequency	Score
1	10 Park St	ND	ND	ND ND	30	╗	0 0	0.000	0.000	28	2	0 0	0.067	0.067	2	0	<del></del>	0	0.000	0.000
2	1016 Nevada Ave	Tr	Tr	ND	28		0 0	0.067	0.067	20	4	4 2		1.200	2	0	0	0	0.000	0.000
3	1021 Nevada Ave	ND	ND	ND	30	0	0 0	0.000_	0.000	27	3	0 0	0.100	0.100	0	2	0	0	1.000	1.000
4	1022 Utah Ave	ND	ND .	ND .	30		0_0	0.000	0.000	29	1_	0 0		0.033	2	0	0	0	0.000	0.000
	1037 California Ave	<u>ND</u>	_ <u>ND</u>	ND ND	30	$\overline{}$	0 0	0.000	0.000	30	0	0 0		0.000	2	0	0	0	0.000	0.000
6	1047 Sheldon Flats Rd	- <u>ND</u> -	ND ND	ND ND	26 30	<u> </u>	1 0	0.133	0.200	30 29	0	0 0		0.000	2	0	0	0	0.000	0.000
<del>7</del> -	105 W. Oak St 106 Voves Ave	ND ON	ND ND	ND ND	28		0 0	0.000	0.000	28	1	0 0		0.033	2	$-\frac{0}{0}$	-0 -	0	0.000	0.000
9	109 Post St	Tr	Tr	Tr			0 0	1.000	1.000	21	5	4 0		0.567	6		1	- 0	1.000	2.000
10	120 Manor Dr	ND ND	ND	ND	30		0 0	0.000	0.000	30	ŏ	0 0		0.000	1	1	Ö	<u> </u>	0.500	0.500
11	1222 Dakota Ave	ND	Tr	Tr	27	3	0 0	0.100	0.100	30	0	0 0		0.000	2	0	0	0	0.000	0.000
12	1222 Dakota Ave	<1	11	<1	16		6 2	0.467	1.467	0	9	15 6		3.800	0	1_	1	0	1.000	2.000
13	1302 Airth Ave	ND	_ ND	ND ND	30	0	0 0	0.000	0.000	30	0_	0 0		0.000	2	. 0	0 -	0	0.000	0.000
14	1313 Renwood Dr	ND ND	ND ND	ND ND	30 30	0	0 0	0.000	0.000	27	3_	0 0		0.100	2	0	0	0	0.000	0.000
15 16	1314 Dakota Ave 1339 Highway 37 N	ND ND	ND ND	ND ND	29	1	0 0	0.000	0.000	30	0	0 0		0.000	2	0	0	0	0.000	0.000
17	1414 Main Ave	ND	ND ND	ND ND	30	<del>-</del>	0 0	0.000	0.000	30	0	0 0		0.000	2	- 6	- 0	0	0.000	0.000
18	1455 Cabinet Heights Rd	Tr	Tr	Tr	30	0	0 0	0.000	0.000	28	0	2 0		0.200	2	<u>_</u>	0	0	0.000	0.000
19	1455 Cabinet Heights Rd	ND	Tr	Tr	2		19 5	0.933	3.700	0	2	8 20	1.000	7.533	0	0	2	0	1.000	3.000
20	156 S. Central Rd	ND	ND	ND	30	0	0 0	0.000	0.000	30	0	0 0		0.000	2	0	0	0	0.000	0.000
21	1573 Kootenai River Rd	ND ND	ND ND	ND ND	<del></del> -			I		26	4	0 0		0.133	1	_ 1	0	0	0.500	0.500
22	1621 Main Ave	ND	ND -	ND ND	29 28	1/2	0 0	0.033	0.033	30 23	0	0 0		0.000	1	- 0	0	0_0	0.000	0.000
23	1761 Highway 2 S 1915 Kootenai River Rd	ND ND	ND ND	ND ND	30	0	0 0	0.067	0.067	23	9	0 0		0.300	2	- 1		-0	0.500	0.000
25	208 W. Cedar St	ND ND	ND ND	ND ND	28	2	0 0	0.000	0.067	29	1	0 0		0.033	1	<del>_</del>		- 0	0.500	0.500
26	208 W. Cedar St	ND	ND	ND	24	6	0 0	0.200	0.200	30	0	0 0		0.000	2	0	0	0	0.000	0.000
27	208 W. Cedar St	Tr	Tr	Tr	7	16	7 0	0.767	1.233	13	15	2 0	0.567	0.700	1	0	1	Ó	0.500	1.500
28	21 Voves Ave	ND	ND	ND ND	30	0	0 0	0.000	0.000	28	0	2 0		0.200	2	0	0	0	0.000	0.000
29	22 Evergreen St	<u>&lt;1</u>	<1	<1		25	0 0	0.833	0.833	5		15 0		1.833	0	0	1_	1	1.000	6.500
30	22 Evergreen St	Tr Tr	Tr	<u>1</u> <1	5		16 2	0.867	2.533	26_	7	1 0		0.200 2.967	1	1 0		0	1.000	1.500
31	22 Evergreen St 226 Spencer Rd	ND II	<1 Tr	Tr	30	10	15 0 0 0	0.833	1.833 0.000	5 16	9	14 4 5 0		0.800	10	2	0	-0	1.000	1.000
33	2293 Kootenai River Rd	ND	ND ND	ND ND	30	0	0 0	0.000	0.000	30	0	0 0		0.000	2	0	0	0	0.000	0.000
34	2297 Kootenai River Rd	ND	ND	ND	24	6	0 0	0.200	0.200	24	6	0 0		0.200	2	0	0	0	0.000	0.000
35	2375 Kootenai River Rd	ND	ND	ND	30	0	0 0	0.000	0.000	28	2	0 0		0.067	2	0	0	0	0.000	0.000
36	241 S. Central Rd	ND	Tr	ND	10	15	5 0	0.667	1.000	14	10	6 0		0.933	0	2	0	0	1.000	1.000
37	2411 Kootenai River Rd	ND	ND	ND	30	0	0 0	0.000	0.000	30	0	0 0		0.000	2	0	0	0	0.000	0.000
38	25 Evans Rd	ND	ND	ND ND	30	0	0 0	0.000	0.000	30	0	0 0		0.000	2	0	0	0	0.000	0.000
39 40	2669 Highway 37 N	ND Tr	ND <1	ND Tr	28 8	2 12	0 0	0.067	0.067 1.400	25 16	8	1 0 6 0		0.233 0.867	1	12	0	0	0.500 1.000	1.000
41	2669 Highway 37 N 269 N. Central Rd	ND ND	ND ND	ND ND	30	0	0 0	0.000	0.000	29	1	0 0		0.033	1 2	0	0	0	0.000	0.000
42	280 S. Central Rd	ND	ND	ND	30	<del>.</del>	0 0	0.000	0.000	30	ö	0 0		0.000	1	1	<del>- 0</del>	0	0.500	0.500
43	281 S. Central Rd	ND	ND	ND	30	0	0 0	0.000	0.000	28	2	0 0		0.067	1	1	0	0	0.500	0.500
44	284 Taylor Rd	Tr	Tr	ND	22	6	2 0	0.267	0.400	15	9	4 2	0.500	1.367	2	0	0	0	0.000	0.000
45	292 Spencer Rd	ND .	ND_	ND ND	30	0	0 0	0.000	0.000	30_	0	0 0		0.000	2	0	0	0	0.000	0.000
46	304 Spencer Rd	ND	ND	Tr	30	0	0 0	0.000	0.000	30	0_	0 0		0.000	0	2	0	0	1.000	1.00
47	32 Burr Ave	ND ND	ND ND	ND ND	30	0	0 0	0.000	0.000	30	0	0 0		0.000	2	0 1	<u>0</u> 1	0	1.000	2.00
49	321 Bowen Hill Rd	Tr	Tr	Tr	30		<b>~</b> 1 <b>~</b>	1.000	2.600	16	14	0 0	-1	0.467	1-0		<del>-</del>	-	1.000	2.00
50	3652 Kootenai River Rd 3652 Kootenai River Rd	ND	Tr	ND	8		10 0	0.733	1.400	16	14	0 0		0.467	1 2		- 6	<del>-</del>	0.000	0.00
51	3796 Highway 2 S	ND ND	Tr	ND	24	6	0 0	0.200	0.200	28	0	2 0		0.200	1	1	0	<del>-</del> 0	0.500	0.50
52	3798 Highway 2 S	ND	ND	ND	30	0	0 0	0.000	0.000	30	0	0 0	0.000	0.000	2	0	0	0	0.000	0.000
53	420 Indian Head Rd	ND	Tr	Tr	29	1	0 0	0.033	0.033	18	8	4 0		0.667	0	2	0	0	1.000	1.00
54	45 Rose St W	ND	ND	ND ND	23	4	2 1	0.233	0.667	29	0	1 0		0.100	1-1		0	0	0.500	0.50
55	45 Rose St W	ND ND	ND	ND_	26	4	0 0	0.133	0.133	27	3	0 0		0.100	2	- 0	0-	0	0.000	0.00
<u>56</u> 57	45 Rose St W 46 Timber Ln	ND Tr	<1 Tr	<1 ND	0 20		10 0 10 0	1.000 0.333	1.667	8	9 11	21 0 10 1		2.400 1.700	0	0	2	0	1.000 0.500	3.00 1.50
<u>5/</u>	460 Woodland Heights Rd	ND ND	ND	ND ND	30	0 -	0 0	0.000	0.000	30	0	0 0		0.000	1 1	1	<del>- </del>	- 0	0.500	0.50
59	545 Granite Ave	TR	Tr	Tr		17	8 0	0.833	1.367	17	8	5 0		0.767	10	1	1	0	1.000	2.00
60	545 Granite Ave	<1	Tr	<1	6	21	3 0	0.800	1.000	4	7	18 1		2.367	0	0	1	1	1.000	6.50
61	546 Granite Ave	ND	ND	ND	30	0	0 0	0.000	0.000	29	1	0 0	0.033	0.033	2	0	0	0	0.000	0.00
62	546 Granite Ave	Tr	ND	ND	7		10 0	0.767	1.433	18	5	7 0	- <del> </del>	0.867	0	1_	_1	0	1.000	2.00
63	600 Granite Ave	- ND	ND	ND	30	0	0 0	0.000	0.000	28	2_	0 0		0.067	2		0_	_0	0.000	0.00
64_	610 Granite Ave	ND Te	ND	ND ND	30	0	0 0	0.000	0.000	30	0	0 0		0.000	2	0	0	_0_	0.000	0.00
65 66	626 W. 2nd St Ext 626 W. 2nd St Ext	Tr ND	ND <1	ND Tr	19 6	8 16	3 0 8 0	0.367	0.567 1.333	23 11	7 14	0 0 4 1		1.200	0	2 1	<u>0</u> 1	0	1.000	1.00 2.00
<del>00</del>	6555 Kootenai River Rd	<u> </u>	Tr	Tr	14	12	4 0	0.533	0.800	8	19	3 0		0.933	1		1		0.500	1.50
68	6797 Farm to Market Rd	ND	ND ND	ND ND	30	0	0 0	0.000	0.000	30	0	0 0		0.000	2		<del>,</del>	0	0.000	0.00
69	813 Wisconsin Ave	ND ND	ND	ND	30	0	0 0	0.000	0.000	30	0	0 0		0.000	2	0	0	ō	0.000	0.00
70	827 Greers Ferry Rd	ND	ND	ND	30	0	0 0	0.000	0.000	30	0	0 0	0.000	0.000	2	0	0	0	0.000	0.00
71	87 Yellowtail Rd	Tr	ND	ND	20	8	2 0	0.333	0.467	27	2	1 0		0.167	2	0	0	0	0.000	0.00
72	8801 Highway 2 S	ND	Tr	Tr	19	9	1 1	0.367	0.733	22	6	2 0		0.400	0	1	1_	0	1.000	2.00
73	899 Farm to Market Rd	ND	ND T-	ND T	30	0	0 0	0.000	0.000	30	0	0 0		0.000	2	0	0	0	0.000	0.000
74	912 California Ave	<1	Tr	Tr_	21	9	0 0	0.300	0.300	26	4	0 0		0.133	1	1	0	0	0.500	0.50
75	99 Post St	ND	ND	ND	20	4	6 0	0.333	0.733	30	0	0 0	0.000	0.000	1	1	0	0	0.500	0.50

not collected

Table 4-7. Overview of Soil Data for Outdoor ABS Study Areas

Method	Metric	Result	Round 1	Round 2
PLM-VE		Α	56	49
1	PLM-VE Bin	B1	14	20
(30 point)		B2/C	5	6
	Number of	0	35	27
	inpsection points	1 - 5	11	22
Visible	where vermiculite	6 - 10	6	6
Vermiculite	was observed	> 10	22	20
Inspection	=	0	35	27
(30 point)	Visible Score	0.033 - 0.5	17	29
	A ISIDIE SCOLE	0.5 - 2	19	14
		>2	3	5

Table 4-8
Between Round Variability in PLM-VE Results

			Round 1 PL	M-VE Results	
		Bin A (ND)	Bin B1 (Tr)	Bin B2 (<1%)	Bin C (≥1%)
	Bin A (ND)	46	3	0	0
Round 2 PLM-VE	Bin B1 (Tr)	8	9	3	0
Results	Bin B2 (<1%)	2	2	1	0
	Bin C (≥1%)	0	0	1	0

Restricted to 30-pt composite samples.

Concordant pairs are shaded in dark gray, weakly discordant pairs are shaded in light gray, strongly discordant pairs are not shaded.

N Total	75
Concordant	56 (74.7%)
Weakly Discordant	17 (22.7%)
Strongly Discordant	2 (2.7%)

TABLE 4-9. OUTDOOR ABS "CLEAN FILL" PROPERTY DETAILS FROM ROUND 1

									OUTDO	OR ABS ROUND 1						
	Exterior	Clean Fill	Soil		ABS Area Descript	tion	s	oli Result	8				Air Re			
Address	Removal Dates	Material Source	Contamination Remaining?	Soil				1		ABS Field Logbook	Rai	Ing PCME LA	Digg	Ing PCME LA	Mov	VING
		Source	Kemaining r	Moisture Deficiency	USDA Texture	Ground Cover	PLM-VE LA Result	VV Status	Visible Summary	Notes	Index ID	Cair (s/cc)	Index ID	Cair (s/cc)	index ID	Cair (s/cc)
10 Park St	9/29/06-10/6/06	Libby, Fink	no	50-75%	Silt Loam	70% grass, 30% bare soil	ND	V-	30 none		EX-00602	0.001	EX-00605	0.03	EX-00607	0.01
106 Voves Ave	7/10/03-7/21/03	Libby, Feller	yes [7]	50-75%	Clay loam	100% grass	ND	V+	28 none, 2 low		EX-00690	0.02	EX-00693	0.01	EX-00695	0.04
1302 Airth Ave	9/3/03-9/12/03	Libby, Feller	yes [8]	50-75%	Silty clay loam	100% grass	ND	V-	30 none		EX-00210	0	EX-00215	0	EX-00095	0
1314 Dakota Ave	6/27/05-6/29/05	Libby, Rusinski	no	50-75%	Clay loam	100% grass	ND	٧-	30 none	neighbor was weed-whacking during child digging ABS	EX-00320	0	EX-00365	0	EX-00369	0
1414 Main Ave	7/14/06-7/20/06	Libby, Fink	no	50-75%	Sandy clay loam	100% grass	ND	V-	30 none		EX-00147	0	EX-00152	0	EX-00156	0.0009
156 S. Central Rd	8/7/02-8/14/02	Libby, Boothman	no	50-75%	Clay loam	100% grass	ND	V-	30 none	smoke from nearby forest fire is noted	EX-00506	0.002	EX-00509	0.02	EX-00510	0.005
21 Voves Ave	6/8/06-6/15/06	Libby, Fink	yes [5]	50-75%	Silty loam	100% grass	ND	V-	30 none	nearby removal noted	EX-00066	0	EX-00067	0	EX-00070	0
2293 Kootenai River Rd	6/12/03-7/15/03	Libby, Feller	по	50-75%	Silty loam	100% grass	ND	V-	30 none	wet soil is noted during child digging ABS	EX-00312	0	EX-00315	0	EX-00317	0.002
280 S. Central Rd	6/17/03-6/28/03	Libby, Feller	yes [6]	50-75%	Clay	100% grass	ND	V-	30 none	VV (low) noted in both digging areas > 3*	EX-00358	0.002	EX-00443	0.3	EX-00445	0.08
281 S. Central Rd	8/12/03-8/13/03	Libby, Feller	no	50-75%	Silty loam	50% grass, 50% bare soil	ND	V-	30 none	VV (low) noted in 2 of 3 digging areas	EX-00499	0.01	EX-00541	0.003	EX-00543	0.11
292 Spencer Rd	10/8/04-10/13/04	Eureka	yes [1]	50-75%	Loamy sand	60% grass, 40% bare soil	ND	V-	30 none	VV (low) noted for NSUA zones but NSUA sample indicates 30 "none"	EX-00121	0	EX-00129	0	EX-00131	0
304 Spencer Rd	10/4/04-10/9/04	Eureka	yes [2]	75-100%	Clay loam	70% grass, 30% bare soil	ND	V-	30 none	neighbor was mowing lawn during digging ABS; nearby removal noted	EX-00165	0	EX-00170	0	EX-00174	0.18
3798 Highway 2 S	9/16/03-9/26/03	Libby, Feller	yes [9]	75-100%	Silty loam	80% grass, 20% bare soil	ND	V-	30 none	smoke from nearby forest fire is noted	EX-00297	0	EX-00305	0	EX-00307	0
546 Granite Ave	9/21/05-9/26/05	Libby, Rusinski	yes [3]	50-75%	Clay loam	100% grass	ND	V-	30 none	EXT3 (PLM ND, VV+) also performed at this property	EX-00666	0	EX-00669	0.004	EX-00671	0
813 Wisconsin Ave	7/13/05-7/19/05	Libby, Rusinski	yes [4]	50-75%	Silty loam	100% grass	ND	V-	30 none		EX-00289	0.001	EX-00292	0	EX-00294	0

VV = visible vermiculite (absent = -, present = +)

^[1] Back yard Area F subsection 2 was <1%

^[2] Front yard and southeast portions of back yard (Areas A & B) were <1%

^[3] Multiple Areas in yard and flowerbed were <1% at 6-18" below ground surface (bgs)

^[4] Yard Areas B, C, E, G were <1%

^[5] Front yard (Area A) and back yard (south half of Area G) were <1% at 12-14" bgs

^[6] Bottom of most of excavation, perimeter of excavation - in & on the side of the road

^[7] Under pumphouse & under walkway at 10-12" bgs

^[8] Yard and flowerbed were <1%

^[9] Small amounts contamination remain at bottom of yard excavation between house & trailer

TABLE 5-1
CLEANUP STATUS OF ALL INDOOR ABS PROPERTIES

					Remova	al Activity S	ummary	_
ABS Area	Address	Interior Cleanup Date	Exterior Cleanup Date	VCI Removal	Interior Cleaning	Exterior Soil Removal	Building Materials	Other
1	10 Park St	9/21/2006	9/29/2006	Х	Х	Х		
2	101 Woodland Rd							
3	1016 Nevada Ave							
4	1020 California Ave	6/16/2006	6/29/2006	Χ	Х	Х	Х	
5	1021 Nevada Ave							
6	1022 Utah Ave							
7	1037 California Ave		8/16/2006			Х		
8	104 Granite Ave							
9	1047 Sheldon Flats Rd							
10	105 W Oak St							
11	106 Voves Ave	7/10/2003	7/10/2003	Х	Х	Х		
12	1106 Nevada Ave	5/10/2005	5/9/2005	Х		Х		
13	1118 Montana Ave		8/5/2003			Х	1	
14	112 W Cedar St							
15	118 White Ave			<u> </u>				
16	120 Forest Ave							
17	120 Manor Dr							
18	1203 Louisiana Ave	7/31/2006	7/31/2006		Х	Х		
19	125 Spencer Hill Way	5/12/2005	5/16/2005	Х		Х		X (a)
20	1302 Airth Ave		9/3/2003			Х		
21	1313 Renwood Dr							
22	1314 Dakota Ave	6/28/2005	6/27/2005	Х		X		
23	133 Spencer Rd	5/23/2005	5/23/2005	х		Х		
24	1405 Dakota Ave	8/29/2006	8/31/2006	х		Х		
25	1414 Main Ave	10/18/2006	7/14/2006	Х	<del></del>	Х		
26	1464 E 5th St Ext		j					
27	15 Avenue B	6/16/2003	6/16/2003	Х		Х	1	
28	1525 Lolo Ave		7/17/2006			X	† <del></del> †	
29	156 S Central Rd	8/7/2002	8/7/2002	х	X	Х		
30	1573 Kootenai River Rd		8/13/2003			Х	<u> </u>	
31	1621 Main Ave	1/7/2004	11/17/2003	х	Х	X		
32	1711 Airstrip Rd		<u> </u>					
33	188 Terrace View Rd							
34	191 Farm to Market Rd	10/4/2004	10/4/2004	X	X	Х		
35	1915 Kootenai River Rd				<u> </u>		<u> </u>	
36	21 Voves Ave	6/5/2006	6/8/2006	Х		Х	†	
37	226 Spencer Rd	5/5/2006	5/1/2006	х	Х	х		
38	2293 Kootenai River Rd	6/12/2003	6/12/2003	Х	X	X		_
39	2297 Kootenai River Rd	12/3/2008	6/11/2003	Х	X	X	X	
40	2375 Kootenai River Rd			1				
41	25 Evans Rd							
42	255 Lodgepole Way						†	
43	269 N Central Rd				T		<del>                                     </del>	
44	281 S Central Rd		8/12/2003	1	<u> </u>	Х		
45	292 Spencer Rd		10/8/2004			X		
46	304 Spencer Rd	10/4/2004	10/4/2004	х	X	X		
47	310 W Flower St	4/4/2003		X	†	1		

## TABLE 5-1 CLEANUP STATUS OF ALL INDOOR ABS PROPERTIES

					Remova	al Activity S	ummary	
ABS Area	Address	Interior Cleanup Date	Exterior Cleanup Date	VCI Removal	Interior Cleaning	Exterior Soil Removal	Building Materials	Other
48	32 Shalom Kerry							
49	323 E Cedar St							
50	337 Commerce Way							
51	3518 Highway 2 S							
52	3576 Highway 2 S							
53	3796 Highway 2 S	9/16/2003	9/16/2003	Х	Х	Х		
54	3798 Highway 2 S	9/16/2003	9/16/2003	Х	X	X		
55	38 Spencer Hill Way	7/29/2003	7/29/2003		Х	Х		
56	397 Sheldon Ln	3/9/2006		Х	Х			X (b)
57	4304 Highway 37 N	10/25/2005	10/25/2005		Х	Х		
58	460 Woodland Heights Rd							
59	487 Kootenai Dr					_		
60	515 Minnesota Ave		8/22/2005			Х		
61	546 Granite Ave	9/21/2005	9/21/2005		Х	Х		
62	56 Enders Dr	10/15/2004	10/15/2004	Х		Х		
63	5862 Highway 2 S							
64	5865 Highway 2 S							
65	600 Granite Ave				-			
66	610 Granite Ave							
67	628 Avenue B							
68	660 Reserve Rd							
69	6797 Farm to Market Rd							
70	700 Farm to Market Rd							
71	71 Claire Ave		6/2/2006			X		
72	76 Pine St	4/25/2006	4/20/2006	Х	Х	Х		
73	781 Terrace View Rd		9/5/2002			Х		
74	813 Wisconsin Ave		7/13/2005			Х		
75	817 W Balsam St	9/21/2006	9/22/2006	Х	Х	Х		
76	87 Yellowtail Rd	9/11/2003	9/3/2003		Х	Х		
77	893 Greers Ferry Rd	9/18/2001	9/21/2001		Х	Х		
78	912 California Ave			-				
79	985 Farm to Market Rd							
80	99 Vanderwood Rd							
81	998 Terrace View Rd							

VCI = vermiculite-containing insulation

### Notes:

- (a) interior spot cleaning
- (b) soil excavated from crawl space

Table 5-2. Indoor ABS Air Data

Address  Add		_		Donoise A	ir	ROU	ND 1		Active A:-				Passive	Air	ROL	JND 2	_	Active	Air	
10   10   10   10   10   10   10   10	Address	Sens	N St	Passive A ructures	Air Con	ne (elec)	Sens	N Str	Active Air ructures	Air Co	nc (s/cc)	Sens	N Structures		nc (s/cc)	Sens	N Str	Active a		nc (s/cc)
2011 Woodland Rd   3		(cc) ⁻¹	PCME	Total LA	PCME	Total LA	(cc)-1	PCME		PCME	Total LA	_(cc) ⁻¹	PCME Total LA	PCME	Total LA	(cc)-1	PCME		PCME	Total LA
1016 Nevada Ave		1.98E-04	2	2	3.96E-04	3.96E-04	1.98E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0 0	0.00E+00	0.00E+00	1.97E-04	0	0	0.00E+00	0.00E+00
4 1020 California Ave 5 1021 Nevada Ave 6 1022 Utah Ave 7 1037 California Ave 8 104 Granite Ave 9 1047 Sheldon Flats Rd 10 105 W. Oak St 106 Nevada Ave 12 1106 Nevada Ave 12 1106 Nevada Ave 13 1118 Montana Ave 14 112 W. Cedar St 15 118 White Ave 16 120 Forest Ave 17 120 Manor Dr 18 1203 Louisiana Ave 19 125 Spencer Hill Way 20 1302 Airth Ave 19 125 Spencer Hill Way 21 1313 Remvood Dr 22 1313 Spencer Rd 21 140 Each St 21 141 Main Ave 22 1343 Spencer Rd 24 1405 Dakota Ave 25 1414 Main Ave 26 1464 E. 54h St Ext 27 15 Avenue B 28 1525 Lolo Ave 29 156 S. Central Rd 30 1573 Kootenai River Rd 31 188 Tertace View Rd 31 188 Tertace View Rd 31 191 Farm to Market Rd 31 191 Farm to Market Rd 32 1915 Kootenai River Rd 32 293 Kootenai River Rd 34 2293 Kootenai River Rd 36 21 Voves Ave 37 265 Spencer Rd 48 2293 Kootenai River Rd 49 2375 Kootenai River Rd 40 2375 Kootenai River Rd 41 255 Lodopepole Way 43 269 N. Central Rd 42 255 Lodopepole Way 43 269 N. Central Rd 44 281 S. Central Rd 45 292 Spencer Rd 46 304 Spencer Rd 47 295 Kootenai River Rd 481 281 S. Central Rd 481 398 Highway 2 S 53 7596 Highway 2 S 53 7596 Highway 2 S 54 3798 Highway 2 S 55 38796 Highway 2 S 55 38796 Highway 2 S 56 Gonders Dr 56 Granite Ave 56 Granite Ave 56 Granite Ave 57 Glor Sarve Rd 583 Greers Rd 586 Granite Ave 586 Ger Reserve Rd 586 Fighrway 2 S 586 Righrway 2 S 586 Righrway 2 S 5876 Highway 3 T 587 Relight Rd 588 Greers Forry Rd 583 Greers Forry Rd 583 Greers Forry Rd 583 Greers Forry Rd 583 Greers Forry Rd		1.99E-04	1	1	1.99E-04	1.99E-04	1.51E-03	3	6	4.53E-03	9.07E-03	2.00E-04	0 0	0.00E+00	0.00E+00	1.01E-03	0	3	0.00E+00	3.04E-03
5 1021 Nevada Ave 1 1037 California Ave 1 1037 California Ave 1 1037 California Ave 1 104 Granite Ave 1 105 W. Oak St 1 1106 Voves Ave 1 1106 Nevada Ave 1 1118 Montana Ave 1 112 W. Cedar St 1 118 White Ave 1 120 Forest Ave 1 120 A Louisiana Ave 1 1313 Remvood Dr 1 313 Remvood Dr 1 315 Remvood Dr 1 315 Remvood Dr 1 315 Remvood Dr 1 316 Remvood Dr 1 317 Remvood Dr 1 317 Remvood Dr 1 110 Remvood Dr		1.95E-04 1.87E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	1.90E-04 2.61E-03	0	0	0.00E+00 2.61E-03	0.00E+00 2.61E-03	1.96E-04 1.97E-04	0 0	0.00E+00 1.97E-04	0.00E+00 1.97E-04	2.67E-04 4.90E-04	0	30	0.00E+00 0.00E+00	8.01E-03 0.00E+00
6 1022 Utah Ave 8 104 Grantie Ave 104 Grantie Ave 1047 Sheldon Fials Rd 105 W, Oak St 111 106 Voves Ave 112 1106 Nevada Ave 13 1118 Montana Ave 14 112 W. Cedar St 15 118 White Ave 16 120 Forest Ave 17 120 Manor Dr 18 1203 Louisiana Ave 19 125 Spencer Hill Way 19 1313 Renveod Dr 1302 Airth Ave 21 1313 Renveod Dr 21 313 Renveod Dr 21 313 Renveod Dr 21 313 Renveod Dr 21 313 Spencer Rd 24 1405 Dakota Ave 23 133 Spencer Rd 24 1405 Dakota Ave 24 1405 Dakota Ave 25 1414 Main Ave 26 1464 E. Sth St Ext 27 15 Avenue B 27 15 Avenue B 28 1525 Lolo Ave 29 156 S. Central Rd 30 1573 Kootenai River Rd 31 1621 Main Ave 29 156 S. Central Rd 30 1975 Kootenai River Rd 31 1975 Kootenai River Rd 32 1974 Airstrip Rd 33 188 Terrace View Rd 34 191 Farm to Market Rd 36 21 Voves Ave 37 262 Spencer Rd 38 2293 Kootenai River Rd 39 2297 Kootenai River Rd 30 2297 Kootenai River Rd 31 25 Evans Rd 42 255 Lodgepole Way 43 295 N. Central Rd 43 295 N. Central Rd 44 281 S. Central Rd 592 Spencer Rd 44 281 S. Central Rd 593 Spencer Rd 47 10 V. Central Rd 593 Spencer Rd 594 Spencer Rd 595 Spencer Rd 596 Grantie Ave 597 Spencer Rd 597 Spencer Rd 597 Spencer Rd 598 Greers Dr 598 Spencer Rd 598 Greers Dr 598 Spencer Rd 599 Spenc		1.90E-04	0	0	0.00E+00	0.00E+00	2.94E-04	1	1	2.94E-04	2.94E-04	1.91E-04	0 0	0.00E+00	0.00E+00	1.91E-04	0	0	0.00E+00	0.00E+00
8 104 Granite Ave 10 105 W. Oak St 11 106 Voves Ave 11 106 Voves Ave 12 1106 Nevada Ave 13 1118 Montana Ave 14 112 W. Cedar St 15 118 White Ave 16 120 Forest Ave 17 120 Manor Dr 18 1203 Louisiana Ave 19 125 Spencer Hill Way 19 1332 Remined Ave 19 1332 Remined Ave 19 1333 Remined Ave 19 1333 Remined Dr 1333 Remined Dr 1333 Remined Dr 1334 Remined Ave 19 1345 Remined Ave 19 1352 Remined Ave 19 1352 Remined Ave 19 1365 Remined Ave 19 1365 Remined Remined Ave 19 1365 Remined Remined Ave 19 156 S. Central Rd 19 15 Kootenai River Rd 19 15 Kootenai River Rd 19 19 Farm to Market Rd 19 15 Kootenai River Rd 19 122 Footenai River Rd 19 122 Footenai River Rd 19 123 Footenai River Rd 19 125 Logopelo Way 13 10 W. Flower St 13 158 Highway 2 S 13 37 Central Rd 14 125 Shalom Kerry 13 25 Shalom Kerry 14 25 Shalom Kerry 15 37 Felliphway 2 S 15 376 Highway 3 N 15 4 GWanda Ave 15 6 Grante Ave 15 76 Fire Turn to Market Rd 17 7 Claire Ave 17 7 Fire St 18 7 W. Balsam St 18 7 W. B		2.00E-04	0	0	0.00E+00	0.00E+00	1.99E-04	2	4	3.97E-04	7.94E-04	1.94E-04	0 0	0.00E+00	0.00E+00	1.99E-04	2	2	3.98E-04	3.98E-04
9		1.97E-04	0	1	0.00E+00	1.97E-04	1.96E-04	1	1	1.96E-04	1.96E-04	2.63E-04	0 1	0.00E+00	2.63E-04	2.72E-04	0	0	0.00E+00	0.00E+00
10 105 W. Oak St 1106 Voves Ave 12 1106 Nevada Ave 13 1118 Montana Ave 14 112 W. Cedar St 15 118 White Ave 15 120 Forest Ave 17 120 Manor Dr 18 1203 Louisiana Ave 19 125 Spencer Hill Way 20 1302 Airth Ave 21 1313 Remvood Dr 21 313 Remvood Dr 21 313 Person Hill Way 21 1313 Remvood Dr 21 314 Dakota Ave 22 1314 Dakota Ave 23 133 Spencer Rd 24 1405 Dakota Ave 25 1414 Main Ave 26 1464 E. 5th St Ext 27 15 Avenue B 28 1525 Lolo Ave 27 15 Avenue B 28 1525 Lolo Ave 28 156 S. Central Rd 30 1573 Kootenal River Rd 31 1621 Main Ave 31 1621 Main Ave 32 1711 Airstrip Rd 33 188 Terrace View Rd 34 191 Farm to Market Rd 35 1915 Kootenal River Rd 36 21 Voves Ave 37 226 Spencer Rd 36 293 Kootenal River Rd 37 265 Spencer Rd 40 2375 Kootenal River Rd 41 25 Evans Rd 42 255 Logdepole Way 43 269 N. Central Rd 44 281 S. Central Rd 45 295 Spencer Rd 46 304 Spencer Rd 47 255 Logdepole Way 48 29 Spencer Rd 48 30 Spencer Rd 49 232 F. Cedar St 50 337 Commerce Way 513 518 Hightway 2 S 5376 Hightway 2 S 5376 Hightway 2 S 5376 Hightway 2 S 5376 Hightway 2 S 548 Fightway 2 S 558 Hightway 2 S 558 Hightway 2 S 559 Hightway 2 S 568 CHightway 2 S 568 CHightway 2 S 568 CHightway 2 S 568 CHightway 2 S 569 Goranite Ave 66 G10 Granite Ave 66 G10 Granite Ave 66 G10 Granite Ave 670 70 Farm to Market Rd 770 T Claire Ave 778 Fine St 778 Terrace View Rd 813 Wisconsin Ave 66 G10 Granite Ave 670 70 Farm to Market Rd 770 70 Farm to Market Rd 771 71 Claire Ave 775 R1 Terrace View Rd 813 Wisconsin Ave 860 G60 Reserve Rd 877 Frame to Market Rd 777 Tolaire Ave 778 Fine St 778 Fine St 778 Fine St 778 Fine St 779 R1 Terrace View Rd 879 Farm to Market Rd 779 Tolaire Ave 779 R1 Terrace View Rd 871 W. Balsam St 877 Yellowtali Rd 873 Ferram to Market Rd 771 Tolaire Ave 775 R1 Terrace Firer Fry Rd		1.99E-04	0	1	0.00E+00	1.99E-04	2.00E-04	0	2	0.00E+00	4.00E-04	1.97E-04	0 0	0.00E+00	0.00E+00	1.99E-04	0	0	0.00E+00	0.00E+00
111 106 Nevas Ave 121 1106 Nevada Ave 121 1106 Nevada Ave 131 1118 Montana Ave 141 112 W. Cedar St 141 112 W. Cedar St 151 118 White Ave 161 120 Forest Ave 171 120 Manor Dr 181 20 Sancor Dr 191 225 Spencer Hill Way 191 125 Spencer Hill Way 191 125 Spencer Hill Way 191 1313 Rernwood Dr 1313 Rernwood Dr 1314 Daktota Ave 1313 Spencer Rd 1415 Daktota Ave 1416 Sakota Ave 1417 Sakota Ave 1417 Sakota Ave 1418 Sakota Ave 1418 Sakota Ave 1419 Sakota Ave 1419 Sakota Ave 1419 Sakota Ave 1411 Airstrip Rd 1412 Se Spencer Rd 1412 Se Spencer Rd 1412 Se Spencer Rd 142 255 Lodgepole Way 143 Se Sokotenai River Rd 143 Sakotenai River Rd 144 281 S. Central Rd 145 292 Spencer Rd 146 304 Spencer Rd 147 310 W. Flower St 148 Sakotenai River Rd 149 Sakotenai River Rd 149 Sakotenai River Rd 140 Sakotenai River Rd 141 Airstrip Rd 141 Airstrip Rd 141 Airstrip Rd 142 Se Spencer Rd 143 Sakotenai River Rd 144 281 S. Central Rd 145 Sepencer Rd 146 304 Spencer Rd 147 310 W. Flower St 148 Sakotenai Dr 151 Sinnesota Ave 151 Airstrip Rd 151 Riphway 2 S 151 Riphway 2 S 153 Riphrway 2 S 153 Riphrway 2 S 154 Riphway 2 S 156 Riphrway 2 S 1576 Riphrway 2 S 1576 Riphrway 2 S 158 Riphrway 3 N 158 Riphrway 2 S 158 Riphrway 2		1.96E-04 1.97E-04	0	2	0.00E+00 1.97E-04	0.00E+00 3.94E-04	1.94E-04 5.08E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	2.01E-04 2.01E-04	0 0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	1.98E-04 1.99E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00
122 1106 Nevada Ave 132 1118 Montana Ave 141 112 W. Cedar St 151 118 White Ave 152 120 Jaunisiana Ave 172 120 Manor Dr 120 Jaunisiana Ave 191 125 Spencer Hill Way 201 1302 Airth Ave 201 1313 Rennoco Dr 21 1313 Rennoco Dr 22 1314 Dakota Ave 23 133 Spencer Rd 24 1405 Dakota Ave 25 1414 Main Ave 25 1414 Main Ave 26 156 S. Central Rd 27 156 Avenue B 28 1525 Lolo Ave 27 157 Avontena River Rd 28 156 S. Central Rd 29 156 S. Central Rd 29 156 S. Central Rd 21 162 Hill Ave 21 1711 Airstrip Rd 22 1711 Airstrip		2.00E-04	Ö	0	0.00E+00	0.00E+00	1.99E-04	1	2	1.99E-04	3.97E-04	1.91E-04	0 0	0.00E+00	0.00E+00	1.91E-04	0	0	0.00E+00	0.00E+00
144 I12 W. Cedar SI 154 I18 White Ave 16 120 Forest Ave 17 120 Manor Dr 18 1203 Louisiana Ave 19 125 Spencer Hill Way 120 1302 Arith Ave 19 125 Spencer Hill Way 1313 Renwood Dr 1314 Dakota Ave 1405 Dakota Ave 1414 Main Ave 156 1464 E. 54th SI Est 1525 Lolo Ave 19 156 S. Central Rd 1621 Main Ave 1757 Kootenai River Rd 1621 Main Ave 1711 Airstrip Rd 1712 Airstrip Rd 1711 Airstrip Rd 1711 Airstrip Rd 1712 Airstrip Rd 1712 Airstrip Rd 1713 Airstrip Rd 1714 Airstrip Rd 1715 Airstrip Rd 1715 Airstrip Rd 1715 Airstrip Rd 1716 Airstrip Rd 1716 Airstrip Rd 1716 Airstrip Rd 1717 Airstrip Rd 1717 Airstrip Rd 1718 Airstrip Rd 1		1.99E-04	0	0	0.00E+00	0.00E+00	5.64E-04	5	15	2.82E-03	8.46E-03	1.98E-04	1 2	1.98E-04	3.96E-04	4.85E-03	2	7	9.69E-03	3.39E-02
15		2.00E-04	0	0	0.00E+00	0.00E+00	9.46E-04	0	0	0.00E+00	0.00E+00	1.89E-04	0 0	0.00E+00	0.00E+00	5.49E-04	2	4	1.10E-03	2.20E-03
16         120 Forest Ave           16         120 Forest Ave           17         120 Manor Dr           18         1203 Louisiana Ave           19         125 Spencer Hill Way           10         1302 Arith Ave           11         1313 Renwood Dr           13         133 Spencer Rd           24         1405 Dakota Ave           1414 Main Ave         1414 Main Ave           26         1445 E. 5th St Ext           27         15 Avenue B           28         1525 Lolo Ave           29         156 S. Central Rd           31         1621 Main Ave           21711 Airstrip Rd           33         188 Terrace View Rd           34         191 Farm to Market Rd           357 Scootenal River Rd         229 Kootenal River Rd           36         21 Voves Ave           37         226 Spencer Rd           38         2297 Kootenal River Rd           292 Scootenal River Rd         2375 Kootenal River Rd           292 Sy Kootenal River Rd         2325 Ecolosal Rd           293 Kootenal River Rd         2325 Kootenal River Rd           304 Spencer Rd         304 Spencer Rd           405 Spencer Rd         304		2.00E-04 6.61E-04	15	50	2.00E-04 9.91E-03	2.00E-04 3.30E-02	1.94E-04 9.95E-04	9	50	1.94E-04 8.96E-03	3.89E-04 4.98E-02	1.90E-04 1.98E-04	0 0	0.00E+00 1.98E-04	0.00E+00 1.98E-04	1.98E-04 1.98E-04	3	0 24	0.00E+00 5.95E-04	0.00E+00 4.76E-03
17		1.90E-04	0	0	0.00E+00	0.00E+00	1.98E-04	1	1	1.98E-04	1.98E-04	2.49E-04	0 0	0.00E+00	0.00E+00	2.59E-04	0	0	0.00E+00	0.00E+00
18 1203 Louisiana Ave 19 125 Spencer Hill Way 20 1302 Airth Ave 21 1313 Renwood Dr 21 1313 Renwood Dr 21 1313 Renwood Dr 22 1314 Dakota Ave 23 133 Spencer Rd 24 1405 Dakota Ave 25 1414 Main Ave 26 1464 E. 5th St Est 27 15 Avenue B 28 1525 Lolo Ave 29 156 S. Central Rd 30 1573 Kootenai River Rd 31 1621 Main Ave 31 1621 Main Ave 32 1711 Airstip Rd 33 188 Terrace View Rd 41 1915 Kootenai River Rd 35 1917 Farm to Market Rd 36 21 Voves Ave 37 226 Spencer Rd 38 293 Kootenai River Rd 39 2293 Kootenai River Rd 40 2375 Kootenai River Rd 41 25 Logdepole Way 42 255 Logdepole Way 43 269 N. Central Rd 44 255 Logdepole Way 43 269 N. Central Rd 45 255 Spencer Rd 46 304 Spencer Rd 47 310 W. Flower St 48 32 Shalom Kerry 49 32 Shalom Kerry 49 32 Shalom Kerry 49 32 Shalom Kerry 49 37 Shelighway 2 S 53 376 Highway 2 S 5376 Highway 2 S 5376 Highway 2 S 5476 Highway 2 S 5586 Pilghway 2 S 559 487 Kootenai Dr 558 Highway 2 S 56 600 Grantie Ave 66 10 Grantie Ave 66 10 Grantie Ave 66 10 Grantie Ave 66 10 Grantie Ave 67 628 Avenue B 68 660 Reserve Rd 70 70 Farm to Market Rd 71 71 Claire Ave 75 181 Terrace View Rd 813 Wisconsin Ave 75 817 W. Balsam St 77 Yellowlail Rd 813 Wisconsin Ave 75 817 W. Balsam St 77 Wellowlail Rd 818 Wisconsin Ave 75 817 W. Balsam St 77 Refres Ferry Rd		1.87E-04	0	0	0.00E+00	0.00E+00	2.52E-04	1	7	2.52E-04	1.76E-03	1.97E-04	0 0	0.00E+00	0.00E+00	1.97E-04	0	0	0.00E+00	0.00E+00
20 1302 Airth Ave 21 1313 Renwood Dr 22 1314 Dakota Ave 23 133 Spencer Rd 24 1405 Dakota Ave 25 1414 Main Ave 25 1414 Main Ave 26 1464 E. 5th St Ext 27 15 Avenue B 28 1525 Lolo Ave 29 156 S. Central Rd 30 1573 Kootenal River Rd 31 1621 Main Ave 32 1711 Airstirp Rd 33 188 Terrace View Rd 31 191 Farm to Market Rd 36 21 Voves Ave 37 226 Spencer Rd 38 2923 Kootenal River Rd 39 2297 Kootenal River Rd 40 2375 Kootenal River Rd 41 25 Evans Rd 42 255 Lodgepole Way 43 269 N. Central Rd 44 281 S. Central Rd 45 292 Spencer Rd 46 304 Spencer Rd 47 101 W. Flower St 48 32 Shalom Kerry 48 32 Shalom Kerry 49 323 E. Cedar St 50 337 Commerce Way 513 518 Hightway 2 S 53 576 Hightway 2 S 53 7596 Hightway 2 S 53 7596 Hightway 2 S 54 798 Hightway 37 N 56 86 Woodland Heights F 56 38 Spencer Hill Way 57 Shelonal Liver Sc 56 Enders Dr 56 Seber Hightway 2 S 56 600 Granite Ave 56 10 Granite Ave 56 600 Reserve Rd 576 Farm to Market Rd 77 17 Claire Ave 78 181 Terrace View Rd 813 Wisconsin Ave 58 17 W. Balsam St 77 Wellowtall Rd 813 Wisconsin Ave 58 17 W. Balsam St 77 Fellowtall Rd 813 Wisconsin Ave 81 813 Wrosonis Ave 81 814 W. Balsam St 87 Yellowtall Rd 81 W. Balsam St 87 Yellowtall Rd 81 883 Greers Ferry Rd		2.00E-04	0	1	0.00E+00	2.00E-04	2.53E-04	1	7	2.53E-04	1.77E-03	1.85E-04	0 1	0.00E+00	1.85E-04	1.88E-04	0	1	0.00E+00	1.88E-04
21		2.00E-04	0	2	0.00E+00	4.00E-04	2.01E-04	1	6	2.01E-04	1.20E-03	2.00E-04	0 0	0.00E+00	0.00E+00	1.99E-04	1	2	1.99E-04	3.98E-04
2314 Dakota Ave   2313 Spencer Rd   241 140 Dakota Ave   251 1414 Main Ave   251 1414 Main Ave   252 1414 Main Ave   253 1455 Colo Ave   254 155 S. Central Rd   255 Colo Ave   256 S. Central Rd   257 Sc. Central Rd   258 Sc. Central Rd   258 Sc. Central Rd   259 Sc. Central Rd   251 Sc. Central Rd   251 Sc. Central Rd   252 Spencer Rd   253 Sc. Central Rd   253 Sc. Sentral Rd   254 Sentral Rd   255 Sc. Sentral Rd   256 Sc. Sentral Rd   257 Sc. Sentral Rd   257 Sc. Sentral Rd   258 Spencer Rd   259 Spencer Rd   250 Spencer Rd   251 Sc. Sentral Rd   251 Sc. Sentral Rd   253 Shallom Kerry   252 Spencer Rd   253 Shallom Kerry   253 Spencer Rd   254 Spencer Rd   255 Sc. Sentral Rd   257 Spencer Rd   257 Spencer Rd   258 Spencer Rd   259 Spencer Rd   250 Spencer Rd   250 Spencer Rd   251 Spencer Rd   252 Spencer Rd   253 Spencer Rd   254 Spencer Rd   255 Spencer Rd   256 Spencer Rd   257 Spencer Rd   257 Spencer Rd   258 Spencer Rd   258 Spencer Rd   259 Spencer Rd   250 Spencer Rd   250 Spencer Rd   251 Spencer Rd   251 Spencer Rd   252 Spencer Rd   253 Spencer Rd   254 Spencer Rd   255 Spencer Rd   256 Spencer Rd   257 Spencer Rd   257 Spencer Rd   257 Spencer Rd   258 Spenc		1.89E-04	0	0	0.00E+00	0.00E+00	3.12E-04	8	36	2.49E-03	1.12E-02	2.00E-04	0 1	0.00E+00	2.00E-04	2.46E-04	0	11	0.00E+00	2.71E-03
231 33 Spencer Rd 241 4105 Dakota Ave 241 4105 Dakota Ave 241 4105 Dakota Ave 251 1414 Main Ave 251 1414 Main Ave 252 1464 E. 5th St Ext 271 15 Avenue B 282 1525 Lolo Ave 291 156 S. Central Rd 291 156 S. Central Rd 291 1571 Airstrip Rd 291 1711 Airstrip Rd 291 1711 Airstrip Rd 291 1711 Airstrip Rd 291 1714 Airstrip Rd 292 Facer Rd 293 Kootenal River Rd 294 255 Logdpeole Way 295 Logdpeole Way 297 Kootenal River Rd 295 Spencer Rd 298 N. Central Rd 298 N. Central Rd 298 Spencer Rd 298 N. Central Rd 298 Spencer Rd 298 N. Central Rd 298 Spencer Rd 299 138 Spencer Rd 299 138 Spencer Rd 299 139 158 Highway 2 S 297 676 Highway 2 S 297 676 Highway 2 S 297 686 Grante Ave 298 487 Kootenai Dr 298 158 Highway 2 S 298 660 Grante Ave 299 160 Grante Ave 299 160 Grante Ave 299 160 Grante Ave 299 160 Grante Ave 299 177 Claire Ave 299 177 Vellowtall Rd 298 187 W. Balsam St 298 177 Vellowtall Rd 298 268 Fers Ferry Rd 298 268 1698 Fers Ferry Rd 298 268 678 Fers Ferry Rd 298 268 678 Fers Ferry Rd 298 268 686 Fers Ferry Rd 298 2686 Fers Ferry Rd 298 2686 Fers Ferry Rd		1.99E-04 1.98E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	1.98E-04 1.99E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	2.51E-04 1.97E-04	0 0	0.00E+00 0.00E+00	0.00E+00 1.97E-04	2.59E-04 1.96E-04	0	1 1	0.00E+00 0.00E+00	2.59E-04 1.96E-04
244   Al95 Dakota Ave   245   1444 Main Ave   256   1464 E. 5th St Ext   277   15 Avenue B   289   1565 S. Central Rd   301   1573 Kootenal River Rd   31   1627 Main Ave   32   1711 Airstrip Rd   331   188 Terrace View Rd   34   191 Farm to Market Rd   35   1915 Kootenal River Rd   36   21 Voves Ave   37   226 Spencer Rd   36   2293 Kootenal River Rd   37   226 Spencer Rd   38   2293 Kootenal River Rd   39   2293 Kootenal River Rd   40   2375 Kootenal River Rd   41   25 Evans Rd   42   25 Evans Rd   42   25 Evans Rd   42   25 Evans Rd   43   25 Evans Rd   44   25 Evans Rd   45   292 Spencer Rd   46   293 Spencer Rd   47   310 W. Flower St   48   34 Spencer Rd   48   34 Spencer Rd   49   323 E. Cedar St   50   337 Commercer Way   51   3158 Hightway 2 S   53798 Hightway 37 N   400 Woodland Heights F   487 Kootenai Dr   4304 Hightway 2 S   547 Kootenai Pro   55 Enders Dr   60   515 Minnesota Ave   646 Woodland Heights F   647 Kootenai Pro   658 Enders Dr   660 Granite Ave   678 Farm to Market Rd   700 Farm to Market Rd   717 Claire Ave   75 Fine St   76 Fine St   76 Fine St   77 Fine St   78 Fine St   78 Fine St   79 Fine St   70 Fine S		1.80E-04	0	1	0.00E+00	1.80E-04	2.49E-04	0	7	0.00E+00	1.75E-03	1.93E-04	0 0	0.00E+00	0.00E+00	5.29E-04	3	13	1.59E-03	6.88E-03
26	Ave	1.89E-04	2	2	3.79E-04	3.79E-04	4.08E-04	3	5	1.22E-03	2.04E-03	2.71E-04	0 0	0.00E+00	0.00E+00	2.67E-04	1	2	2.67E-04	5.33E-04
27		1.86E-04	0	0	0.00E+00	0.00E+00	1.97E-04	1	2	1.97E-04	3.95E-04	1.92E-04	0 0	0.00E+00	0.00E+00	1.95E-04	0	1	0.00E+00	1.95E-04
28 1525 Lole Ave 29 156 S. Central Rd 31 1621 Main Ave 31 1621 Main Ave 32 1711 Airstrip Rd 33 188 Terrace View Rd 34 191 Farm to Market Rd 36 21 Voves Ave 37 262 Spencer Rd 38 2293 Kootenai River Rd 38 2293 Kootenai River Rd 39 2297 Kootenai River Rd 40 2375 Kootenai River Rd 41 25 Evans Rd 42 255 Lodgopelo Way 43 269 N. Central Rd 44 281 S. Central Rd 45 292 Spencer Rd 46 304 Spencer Rd 47 310 W. Flower St 48 32 Shalom Kerry 49 323 E. Cedar St 53 376 Flightway 2 S 5376 Hightway 2 S 5376 Hightway 2 S 53796 Hightway 2 S 5478 Hightway 2 S 558 Spencer Hill Way 56 397 Sheldon Ln 400 Woodland Heights F 56 397 Sheldon Ln 515 Minnesota Ave 61 546 Granite Ave 66 610 Granite Ave 67 628 Avenue B 68 660 Reserve Rd 70 76 Farm to Market Rd 71 71 Claire Ave 75 181 Terrace View Rd 813 Wisconsin Ave 75 817 W. Balsam St 77 W. Balsam St 77 W. Balsam St 77 R 187 B 83 Greers Ferry Rd 883 Greers Ferry Rd 883 Greers Ferry Rd 883 Greers Ferry Rd		1.84E-04	0	0	0.00E+00	0.00E+00	2.58E-04	0	1 24	0.00E+00	2.58E-04	1.99E-04	0 0	0.00E+00	0.00E+00	1.99E-04	1	7	1.99E-04	1.99E-04
256 S. Central Rd   30		1.99E-04 1.98E-04	1	2	1.99E-04 1.98E-04	3.97E-04 1.98E-04	2.10E-04 1.94E-04	11	24 0	2.30E-03 0.00E+00	5.03E-03 0.00E+00	2.52E-04 1.38E-04	0 0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	1.98E-04 1.88E-04	0	2	7.94E-04 0.00E+00	1.39E-03 3.77E-04
31 1 1621 Main Ave 32 1711 Airstrip Rd 33 188 Terrace View Rd 34 191 Farm to Market Rd 35 1915 Kootenal River Rd 36 21 Voves Ave 37 226 Spencer Rd 38 2297 Kootenal River Rd 39 2297 Kootenal River Rd 30 2297 Kootenal River Rd 41 25 Evans Rd 42 255 Lodgepole Way 43 269 N. Central Rd 44 281 S. Central Rd 45 292 Spencer Rd 46 304 Spencer Rd 47 310 W. Flower St 48 292 Spencer Rd 49 323 E. Cedar St 37 310 Floren St 49 323 E. Cedar St 31 3796 Highway 2 S 3796 Highway 2 S 3796 Highway 2 S 3796 Highway 2 S 3797 Shelton Ln 4004 Highlyew 37 N 58 460 Woodland Heights F 59 487 Kootenai Dr 515 Minnesota Ave 516 Granite Ave 56 600 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 66 660 Reserve Rd 670 770 Farm to Market Rd 770 770 Farm to Market Rd 770 77 Farm to Market Rd 770 77 Farm to Market Rd 770 77 Farm to Market Rd 770 781 Terrace View Rd 813 Wisconsin Ave 75 817 W. Balsam St 877 Vellowtali Rd 883 Greers Ferry Rd 883 Greers Ferry Rd 883 Greers Ferry Rd		1.99E-04	Ó	0	0.00E+00	0.00E+00	2.00E-04	1	4	2.00E-04	8.02E-04	1.98E-04	0 0	0.00E+00	0.00E+00	2.31E-04	0	0	0.00E+00	0.00E+00
322		1.97E-04	0	0	0.00E+00	0.00E+00	5.40E-04	3	7	1.62E-03	3.78E-03	1.99E-04	0 0	0.00E+00	0.00E+00	1.98E-04	1	1	1.98E-04	1.98E-04
33 188 Terrace View Rd 34 191 Farm to Market Rd 35 1915 Kootenai River Rd 36 21 Voves Ave 37 226 Spencer Rd 38 2293 Kootenai River Rd 38 2293 Kootenai River Rd 40 2375 Kootenai River Rd 41 25 Evans Rd 42 255 Lodgepole Way 43 269 N. Central Rd 44 281 S. Central Rd 45 292 Spencer Rd 46 304 Spencer Rd 47 310 W. Flower St 48 32 Shalom Kerry 49 323 E. Cedar St 53 37 Commerce Way 513 518 Highrway 2 S 5376 Highrway 2 S 5376 Highrway 2 S 5376 Highrway 2 S 54 3798 Highrway 2 S 55 3879 Highrway 2 S 56 397 Sheldon Ln 4304 Highrbay 37 N 58 460 Woodland Heights F 56 Boffens Dr 60 556 Enders Dr 610 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 67 628 Avenue B 68 660 Reserve Rd 70 70 Farm to Market Rd 71 71 Claire Ave 75 R 18 Terrace View Rd 813 Wisconsin Ave 75 817 W. Balsam St 78 TY W. Bals		1.98E-04	0	0	0.00E+00	0.00E+00	1.46E-03	1	2	1.46E-03	2.91E-03	1.70E-04	0 0	0.00E+00	0.00E+00	1.65E-04	0	0	0.00E+00	0.00E+00
34   34   34   34   34   34   34   34		2.00E-04	1	5	2.00E-04	1.00E-03	1.47E-03	1	12	1.47E-03	1.76E-02	3.95E-04	1 1	3.95E-04	3.95E-04	2.51E-04	2	5	5.01E-04	1.25E-03
35 1915 Kootenal River Rd 36 21 Voves Ave 37 226 Spencer Rd 38 2293 Kootenal River Rd 38 2293 Kootenal River Rd 39 2297 Kootenal River Rd 40 2375 Kootenal River Rd 41 25 Evans Rd 42 255 Lodgepole Way 43 269 N. Central Rd 43 245 Lodgepole Way 43 269 N. Central Rd 45 292 Spencer Rd 46 304 Spencer Rd 47 310 W. Flower St 48 32 Shalom Kerry 49 323 E. Cedar St 50 337 Commerce Way 513 515 Hightway 2 S 53 3796 Hightway 2 S 53 3796 Hightway 2 S 53 3796 Hightway 2 S 54 3798 Hightway 37 N 56 397 Sheldon Ln 56 397 Sheldon Ln 515 Minnesota Ave 56 Geners Dr 60 515 Minnesota Ave 66 G10 Granite Ave 67 628 Avenue B 68 660 Reserve Rd 70 70 Farm to Market Rd 71 71 Claire Ave 75 Pines View Rd 813 Wisconsin Ave 81 TW Balsam St 77 W Balsam St 87 Y Followlali Rd 813 Wisconsin Ave 81 TW Balsam St 87 Y Flowlali Rd 813 Wisconsin Ave 81 W Balsam St 87 Y Holowlali Rd 81 W Balsam St 87 Y Holowlali Rd 883 Greers Ferry Rd		2.01E-04 1.92E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	5.81E-04 1.96E-04	0	0	0.00E+00 0.00E+00	5.81E-04 0.00E+00	1.99E-04 2.53E-04	0 1	0.00E+00 0.00E+00	1.99E-04 0.00E+00	5.89E-04 2.46E-04	0	0	0.00E+00 0.00E+00	5.89E-04 0.00E+00
36   21 Voves Ave 37   226 Spencer Rd 38   2297 Kootenal River Rd 39   2297 Kootenal River Rd 2375 Kootenal River Rd 2375 Kootenal River Rd 141   25 Evans Rd 142   255 Lodgepole Way 143   269 N. Central Rd 144   281 S. Central Rd 145   292 Spencer Rd 147   310 W. Flower St 32 Spencer Rd 147   310 W. Flower St 32 Shalom Kerry 149   323 E. Cedar St 337 Commerce Way 151   3518 Highway 2 S 3376 Highway 2 S 3576 Highway 2 S 3796 Highway 2 S 3797 Kootenai Dr 3797 Kootenai Dr 3797 Kootenai Dr 3797 Farm to Market Rd 3797 Farm St Market Rd 3797 Farm to Market Rd 3797 Farm to Market Rd 3797 Farm to Market Rd 3797 Farm St Market Rd 3797 Far		1.98E-04	0	1	0.00E+00	1.98E-04	1.78E-04	0	0	0.00E+00	0.00E+00	1.97E-04	0 0	0.00E+00	0.00E+00	1.94E-04	0	0	0.00E+00	0.00E+00
38   293 Kootenal River Rd 40   2375 Kootenal River Rd 41   25 Evans Rd 41   25 Evans Rd 42   255 Lodgepole Way 43   269 N. Central Rd 44   281 S. Central Rd 45   292 Spencer Rd 46   304 Spencer Rd 47   310 W. Flower St 48   32 Shalom Kerry 49   323 E. Cedar St 50   337 Commerce Way 513   518 Hightway 2 S 5376 Hightway 2 S 5376 Hightway 2 S 5376 Hightway 2 S 5376 Hightway 2 S 54   3798 Hightway 2 S 55   3879 Endiphay 37 N 56   397 Sheldon Ln 56   397 Sheldon Ln 56   480 Woodland Heights F 56   487 Kootenai Dr 515 Minnesota Ave 56   56 Enders Dr 57   560   6797 Farm to Market Rd 77   7 Claire Ave 67   670 Farm to Market Rd 77   7 Claire Ave 78   78   78   78   78   78   78   78		1.55E-04	0	0	0.00E+00	0.00E+00	3.00E-04	0	3	0.00E+00	8.99E-04	2.78E-04	0 0	0.00E+00	0.00E+00	2.71E-04	0	1	0.00E+00	2.71E-04
393   2297 Kootenal River Rd 404   2375 Kootenal River Rd 415 Evans Rd 42   255 Lodgepole Way 43   259 Lodgepole Way 44   281 S. Central Rd 44   281 S. Central Rd 45   292 Spencer Rd 46   304 Spencer Rd 47   310 W. Flower St 48   32 Shalom Kerry 49   323 E. Cedar St 50   337 Commerce Way 51   3518 Highway 2 S 52   3576 Highway 2 S 53   3796 Highway 2 S 54   3798 Highway 2 S 55   38 Spencer Hill Way 56   397 Sheldon Ln 57   4304 Highway 37 N 56   460 Woodland Heights F 56   487 Kootenai Dr 57   487 Kootenai Dr 58   566 Enders Dr 58   568 E Highway 2 S 56   560 Granite Ave 56   566 Reserve Rd 578   566 Reserve Rd 579   767 mm to Market Rd 770   70 Farm to Market Rd 771   71 Cairre Ave 78   71 Cairre Ave 79   71 Cairre Ave 79   71 Cairre Ave 71   72 Cairre Ave 71   72 Cairre Ave 72   73   74 Cairre Ave 74   75   71 Cairre Ave 75   71 Cairre Ave 75   71 Cairre Ave 76   71 Cairre Ave 77   71 Cairre Ave 78   71 Cairre Ave 78   71 Cairre Ave 79   71 Cairre Ave 79   71 Cairre Ave 71   72 Cairre Ave 71   73   74 Cairre Ave 75   74 Cairre Ave 75   74 Cairre Ave 76   75 Cairre Farry Rd		2.01E-04	0	0	0.00E+00	0.00E+00	2.00E-04	1	10	2.00E-04	2.00E-03	1.96E-04	0 1	0.00E+00	1.96E-04	1.94E-04	17	41	3.30E-03	7.96E-03
40 2375 Kootenai River Rd 41 25 Evans Rd 42 255 Lodgepole Way 43 269 N. Central Rd 44 281 S. Central Rd 45 292 Spencer Rd 46 304 Spencer Rd 47 310 W. Flower St 48 32 Shalom Kerry 49 323 E. Cedar St 50 337 Commerce Way 513 515 Highrway 2 S 53 3796 Highrway 2 S 53 3796 Highrway 2 S 53 3796 Highrway 2 S 54 3798 Highrway 37 N 56 397 Sheldon Ln 56 397 Sheldon Ln 56 36 Carlers Dr 60 515 Minnesota Ave 61 546 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 67 628 Avenue B 68 660 Reserve Rd 70 76 Pine St 77 Fine St 78 1 Terrace View Rd 813 Wisconsin Ave 81 77 Vellowal Rd 813 Wisconsin Ave 81 77 Felines View Rd 813 Wisconsin Ave 81 77 Wellowali Rd 81 813 Wisconsin Ave 81 813 Wisconsin Ave 81 813 Greers Ferry Rd		1.95E-04	0	0	0.00E+00	0.00E+00	9.73E-04	0	2	0.00E+00	1.95E-03	2.42E-04	0 0	0.00E+00	0.00E+00	2.39E-04	0	0	0.00E+00	0.00E+00
41 25 Evans Rd 42 255 Lodgepole Way 43 269 N. Central Rd 44 281 S. Central Rd 44 281 S. Central Rd 45 292 Spencer Rd 46 304 Spencer Rd 47 310 W. Flower St 48 32 Shalom Kerry 49 323 E. Cedar St 513 375 Central Rd 49 325 E. Cedar St 513 375 Hightway 2 S 53 3796 Hightway 2 S 53 3796 Hightway 2 S 53 3796 Hightway 2 S 54 3798 Hightway 2 S 54 3798 Hightway 3 N 56 397 Sheldon Ln 7 4304 Hightway 37 N 58 460 Woodland Heights F 59 497 Kootenai Dr 515 Minnesota Awe 54 Granite Ave 56 66 Granite Ave 66 610 Granite Ave 67 628 Avenue B 68 660 Reserve Rd 70 700 Farm to Market Rd 71 71 Claira Ave 73 781 Terrace View Rd 813 Wisconsin Ave 817 W. Balsam St 818 77 Vellowtali Rd 833 Greers Ferry Rd		1.95E-04 1.84E-04	0	0	0.00E+00 1.84E-04	0.00E+00 1.84E-04	2.00E-04 2.45E-04	0	0	0.00E+00 0.00E+00	0.00E+00 2.45E-04	2.00E-04 1.98E-04	0 1	0.00E+00 0.00E+00	2.00E-04 0.00E+00	1.99E-04 1.67E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00
255 Lodgepole Way		1.94E-04	Ó	0	0.00E+00	0.00E+00	9.50E-04	0	Ö	0.00E+00	0.00E+00	2.66E-04	0 0	0.00E+00	0.00E+00	2.65E-04	1	4	2.65E-04	1.06E-03
444 281 S. Central Rd 445 292 Spencer Rd 46 304 Spencer Rd 47 310 W. Flower St 48 32 Shalom Kerry 49 323 E. Cedar St 50 337 Commerce Way 51 3518 Highway 2 S 52 3576 Highway 2 S 53 3796 Highway 2 S 54 3798 Highway 2 S 54 3798 Highway 2 S 55 38 Spencer Hill Way 55 397 Sheldon Ln 577 4304 Highway 37 N 60 515 Minnesota Ave 615 546 Grantie Ave 62 56 Enders Dr 63 5862 Highway 2 S 65 600 Grantie Ave 62 56 Enders Dr 63 5862 Highway 2 S 65 600 Grantie Ave 66 610 Grantie Ave 67 660 Reserve Rd 6797 Farm to Market Rd 71 Claire Ave 76 Pine St 73 781 Terrace View Rd 813 Wisconsin Ave 78 181 W. Balsam St 78 7 Yellowtali Rd 77 78 77 Rd 78 77 Rd		1.90E-04	1	2	1.90E-04	3.80E-04	5.25E-04	1	2	5.25E-04	1.05E-03	1.99E-04	0 0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00E+00
45 292 Spencer Rd 46 304 Spencer Rd 47 310 W. Flower St 48 32 Shalom Kerry 49 323 E. Cedar St 50 337 Commerce Way 51 3518 Highway 2 S 53 3796 Highway 2 S 53 3796 Highway 2 S 54 3798 Highway 2 S 55 38 Spencer Hill Way 56 397 Sheldon Line 57 4304 Highway 37 N 58 460 Woodland Heights F 58 487 Kotonai Dr 60 515 Minnesota Ave 61 546 Granite Ave 61 546 Granite Ave 61 546 Granite Ave 61 610 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 679 7 Farm to Market Rd 77 7 Claire Ave 78 181 Terrace View Rd 813 Wisconsin Ave 78 181 Terrace View Rd 814 Wisconsin Ave 78 181 Terrace View Rd 814 Wisconsin Ave 78 181 Terrace View Rd 814 Wisconsin Ave 78 1814 Serson St Ave 78 1814 Rd 814 Wisconsin Ave 78 1814 Rd 815 Wisconsin Ave 78 1814 Rd 815 Wisconsin Ave 79 181 Terrace View Rd 814 Wisconsin Ave 815 Rd 817 W. Balsam St 817 Yellowlali Rd 818 Terrace Ferry Rd		1.95E-04	0	0	0.00E+00	0.00E+00	1.98E-04	1	2	1.98E-04	3.95E-04	1.99E-04	0 1	0.00E+00	1.99E-04	1.97E-04	3	3	5.91E-04	5.91E-04
46 304 Spencer Rd 47 310 W. Flower St 48 32 Shalom Kerry 49 323 E. Cedar St 51 337 Commerce Way 51 3518 Hightway 2 S 53 3796 Hightway 2 S 53 3796 Hightway 2 S 53 38 Spencer Hill Way 56 397 Sheldon Ln 56 397 Sheldon Ln 57 4304 Hightway 37 N 58 460 Woodland Heights F 59 497 Kootlenai Dr 4304 Hightway 37 N 58 460 Woodland Heights F 59 497 Kootlenai Dr 515 Minnesota Awe 61 546 Granite Ave 61 546 Granite Ave 61 546 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 67 628 Avenue B 68 660 Reserve Rd 70 700 Farm to Market Rd 71 71 Claire Ave 73 781 Terrace View Rd 813 Wisconsin Ave 74 813 Wisconsin Ave 75 817 W. Balsam St 76 87 Yellowlail Rd 883 Greers Ferry Rd 893 Greers Ferry Rd		2.00E-04	0	2	0.00E+00	3.99E-04	1.99E-04	1	4	1.99E-04	7.97E-04	1.99E-04	0 0	0.00E+00	0.00E+00	1.99E-04	2	2	3.97E-04	3.97E-04
47 310 W. Flower St 48 32 Shalom Kerry 49 323 E. Cedar St 50 337 Commerce Way 51 3518 Highway 2 S 52 3576 Highway 2 S 53 3796 Highway 2 S 54 3798 Highway 2 S 55 38 Spencer Hill Way 56 397 Sheldon Ln 57 4304 Highway 37 N 60 Woodland Heights F 60 487 Kotenai Dr 60 515 Minnesota Ave 61 546 Granite Ave 62 Se Enders Dr 63 5862 Highway 2 S 65 600 Granite Ave 64 5865 Highway 2 S 65 600 Granite Ave 66 610 Granite Ave 67 66 610 Granite Ave 67 660 Reserve Rd 6797 Farm to Market Rd 70 700 Farm to Market Rd 71 71 Claire Ave 78 Fine St 78 1 Ferrace View Rd 813 Wisconsin Ave 78 171 W. Balsam St 78 77 Vellowtali Rd 77 77 Pines S 78 71 W. Balsam St 78 77 How All St 78 77 Rd 78 78 78 78 78 78 78 88 36 78 78 78 78 88 36 78 78 78 78 88 36 78 78 78 78 88 36 78 78 78 78 88 36 78 78 78 89 36 78 78 78 78 88 36 78 78 78 78 89 36 78 78 78 78 88 36 68 78 78 78 78 88 36 68 78 78 78 78 88 36 68 78 78 78 78 88 36 78 78 78 78 88 36 78 78 78 78 89 36 78 78 78 78 78 88 36 78 78 78 78 78 88 36 78 78 78 78 78 78 88 36 78 78 78 78 78 78 88 36 78 78 78 78 78 78 78 78 88 36 78 78 78 78 78 78 78 78 78 78 78 78 78		1.94E-04 1.99E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	1.92E-04 5.64E-04	0	1 12	0.00E+00 1.69E-03	1.92E-04 6.77E-03	2.54E-04 1.99E-04	1 2	2.54E-04 0.00E+00	5.08E-04 0.00E+00	2.35E-04 2.59E-04	1	6	0.00E+00 2.59E-04	1.41E-03 2.59E-04
48 32 Shalom Kerry 49 323 E. Cedar St 50 337 Commerce Way 51 3518 Highrway 2 S 5367 Highrway 2 S 5376 Highrway 2 S 5376 Highrway 2 S 5378 Highrway 2 S 54 3798 Highrway 2 S 55 38 Spencer Hill Way 56 397 Sheldon Ln 7 4304 Highrway 37 N 58 460 Woodland Heights F 60 Woodland Heights F 61 546 Granite Ave 61 546 Granite Ave 61 546 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 66 600 Reserve Rd 707 Farm to Market Rd 71 7 Claire Ave 78 FP RS 78 Terrace View Rd 813 Wisconsin Ave 78 18 Terrace View Rd 814 Wisconsin Ave 78 18 TY W. Balsam St 78 TY Vellowtali Rd 818 Wisconsin Ave 78 813 FY W. Balsam St 78 TY Bolsam St 78 78 18 383 Greers Ferry Rd		1.97E-04	0	1	0.00E+00	1.97E-04	2.70E-04	3	19	8.10E-04	5.13E-03	1.99E-04	1 1	1.99E-04	1.99E-04	1.98E-04	1	2	1.98E-04	3.95E-04
49 323 E. Cedar St 50 337 Commerce Way 51 3518 Highway 2 S 52 3576 Highway 2 S 53 3796 Highway 2 S 54 3798 Highway 2 S 55 38 Spencer Hill Way 55 38 Spencer Hill Way 56 397 Sheldon Ln 57 4304 Highway 37 N 84 460 Woodland Heights R 59 487 Kootenai Dr 60 515 Minnesota Ave 61 546 Granite Ave 62 56 Enders Dr 63 5862 Highway 2 S 64 5865 Highway 2 S 65 600 Granite Ave 66 101 Granite Ave 67 660 Reserve Rd 6797 Farm to Market Rd 71 Claire Ave 76 Pine St 73 781 Terrace View Rd 813 Wisconsin Ave 81 Ty W. Balsam St 87 Yellowtali Rd 77 78 77 Rd		2.00E-04	1	1	2.00E-04	2.00E-04	1.99E-04	2	6	3.97E-04	1.19E-03	2.65E-04	0 0	0.00E+00	0.00E+00	5.57E-04	0	0	0.00E+00	0.00E+00
51 3518 Highway 2 S 53 3796 Highway 2 S 53 3796 Highway 2 S 54 3798 Highway 2 S 54 3798 Highway 2 S 55 38 Spencer Hill Way 56 397 Sheldon Ln 57 4304 Highway 3 N 58 460 Woodland Heights F 59 487 Kootenai Dr 60 515 Minnesota Ave 61 546 Granite Ave 62 56 Enders Dr 62 56 Enders Dr 62 56 Enders Dr 62 56 Enders Dr 62 66 Reserve Rd 610 Granite Ave 66 100 Granite Ave 67 628 Avenue B 68 600 Reserve Rd 6797 Farm to Market Rd 71 Claira Ave 72 76 Pins St 73 781 Terrace View Rd 813 Wisconsin Ave 814 Wisconsin Ave 814 Wisconsin Ave 817 Wisconsin Ave 817 Wisconsin Ave 817 Wisconsin Ave 817 Wisconsin Ave 818 Terrace View Rd 817 Wisconsin Ave 817 Wisconsin Ave 818 Greers Ferry Rd		1.98E-04	0	0	0.00E+00	0.00E+00	1.99E-04	1	1	1.99E-04	1.99E-04	1.89E-04	0 0	0.00E+00	0.00E+00	1.91E-04	0	1	0.00E+00	1.91E-04
52 3576 Highway 2 S 53 3796 Highway 2 S 54 3798 Highway 2 S 55 38 Spencer Hill Way 55 397 Sheldon Ln 57 4304 Highway 37 N 58 460 Woodland Heights F 50 487 Kootenai Dr 60 515 Minnesota Ave 61 546 Granite Ave 62 56 Enders Dr 63 5862 Highway 2 S 65 600 Granite Ave 66 610 Granite Ave 67 66 610 Granite Ave 67 660 Reserve Rd 6797 Farm to Market Rd 70 700 Farm to Market Rd 71 71 Claire Ave 72 75 Pine S 73 781 Terrace View Rd 74 813 Wisconsin Ave 75 817 W. Balsam St 77 77 Pine S 77 87 Pine S 77 87 883 Greers Ferry Rd		1.99E-04	0	1	0.00E+00	1.99E-04	1.99E-04	1	2	1.99E-04	3.98E-04	2.02E-04	0 0	0.00E+00	0.00E+00	2.01E-04	0	0	0.00E+00	0.00E+00
53         3796 Highway 2 S           54         3798 Highway 2 S           55         38 Spencer Hill Way           56         39 Spencer Hill Way           56         397 Sheldon Ln           7         4304 Highway 3 N           58         460 Woodland Heights F           9         487 Kootenai Dr           60         515 Minnesota Ave           61         546 Granite Ave           62         56 Enders Dr           63         5862 Highway 2 S           65         600 Granite Ave           66         610 Granite Ave           66         600 Reserve Rd           707 Farm to Market Rd         707 Farm to Market Rd           708 Terrace View Rd         813 Wisconsin Ave           75         817 W. Balsam St           77 Yellowlali Rd         833 Greesr Ferry Rd		2.00E-04 2.00E-04	0	5	0.00E+00 8.00E-04	2.00E-04 1.00E-03	2.00E-04 6.11E-04	3	1 11	0.00E+00 1.83E-03	2.00E-04 6.72E-03	1.97E-04 2.63E-04	0 0	1.97E-04 0.00E+00	1.97E-04 0.00E+00	1.98E-04 2.48E-04	0	3	3.95E-04 0.00E+00	5.93E-04 2.48E-04
54 3798 Highway 2 S 538 Spencer Hill Way 55 387 Sheldon Ln 57 4304 Highway 37 N 58 460 Woodland Heights F 59 487 Kootenai Dr 60 515 Minnesota Ave 61 546 Granite Ave 62 56 Enders Dr 63 5862 Highway 2 S 64 5865 Highway 2 S 65 600 Granite Ave 66 101 Granite Ave 67 628 Avenue B 66 600 Granite Ave 67 600 Reserve Rd 6797 Farm to Market Rd 71 71 Claire Ave 72 76 Pine St 73 781 Terrace View Rd 813 Wisconsin Ave 74 813 Wisconsin Ave 75 817 W. Balsam St 77 78 77 Rd		1.92E-04	0	0	0.00E+00	0.00E+00	9.82E-04	0	0	0.00E+00	0.00E+00	2.00E-04	1 1	2.00E-04	2.00E-04	1.99E-04	2	4	3.99E-04	7.97E-04
56 397 Sheldon Ln 57 4304 Highway 37 N 460 Woodland Heights F 59 487 Kootenai Dr 60 515 Minnesota Ave 61 546 Granite Ave 62 56 Enders Dr 63 5862 Highway 2 S 64 5865 Highway 2 S 64 610 Granite Ave 66 106 Granite Ave 67 628 Avenue B 660 Reserve Rd 679 F Farm to Market Rd 70 700 Farm to Market Rd 71 71 Claira Ave 72 76 Pine St 73 781 Terrace View Rd 813 Wisconsin Ave 75 817 W. Balsam St 87 Yellowtail Rd 77 883 Greers Ferry Rd		1.97E-04	0	0	0.00E+00	0.00E+00	1.91E-04	0	0	0.00E+00	0.00E+00	1.87E-04	0 0	0.00E+00	0.00E+00	2.49E-04	0	1	0.00E+00	2.49E-04
304 Highway 37 N		1.99E-04	0	0	0.00E+00	0.00E+00	1.93E-04	2	2	3.86E-04	3.86E-04	1.92E-04	0 0	0.00E+00	0.00E+00	1.96E-04	0	1	0.00E+00	1.96E-04
58         460 Woodland Heights F           9         487 Kootenai Dr           60         515 Minnesota Ave           61         546 Granite Ave           62         56 Enders Dr           63         5862 Hightway 2 S           64         5865 Highway 2 S           65         600 Granite Ave           66         610 Granite Ave           66         660 Reserve Rd           707 Farm to Market Rd         707 To Claire Ave           72         76 Pine Stiew Rd           4813 Wisconsin Ave         813 Wisconsin Ave           75         817 W. Balsam St           77 Yellowlali Rd         833 Greers Ferry Rd		1.93E-04	0	0	0.00E+00	0.00E+00	1.98E-04	1	1	1.98E-04	1.98E-04	1.93E-04	1 2	1.93E-04	3.85E-04	1.99E-04	1	3	1.99E-04	5.98E-04
59 487 Kootenai Dr 60 515 Minnesota Ave 61 546 Granite Ave 62 56 Enders Dr 62 56 Enders Dr 63 5862 Highway 2 S 64 5865 Highway 2 S 65 600 Granite Ave 66 101 Granite Ave 67 628 Avenue B 68 660 Reserve Rd 679 7 Farm to Market Rd 70 700 Farm to Market Rd 71 71 Claire Ave 72 76 Pine St 73 781 Terrace View Rd 813 Wisconsin Ave 75 817 W. Balsam St 77 87 Yellowtail Rd 77 883 Greers Ferry Rd		2.00E-04 1.99E-04	0	0	0.00E+00 0.00E+00	2.00E-04 0.00E+00	1.99E-04 1.79E-04	0	0	0.00E+00 0.00E+00	0.00E+00 1.79E-04	1.95E-04 1.99E-04	0 0	1.95E-04 0.00E+00	1.95E-04 0.00E+00	3.82E-04 1.81E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00
60 515 Minnesota Ave 615 246 Granite Ave 616 246 Granite Ave 616 256 Enders Dr 63 5862 Highway 2 S 65 600 Granite Ave 610 Granite Ave 610 Granite Ave 666 610 Granite Ave 676 282 Avenue B 68 660 Reserve Rd 700 Farm to Market Rd 71 Claire Ave 72 75 Pine S 74 Terrace View Rd 813 Wisconsin Ave 75 817 W. Balsam St 87 Yellowlail Rd 77 89 37 Yellowlail Rd 77 89 37 Fers Ferry Rd 893 Greers Ferry Rd		1.98E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00E+00	1.86E-04	0 0	0.00E+00	0.00E+00	1.87E-04	1	1	1.87E-04	1.87E-04
62 S6 Enders Dr 53 5862 Highway 2 S 54 5865 Highway 2 S 55 600 Granite Ave 67 628 Avenue B 68 660 Reserve Rd 697 Farm to Market Rd 70 700 Farm to Market Rd 71 Claire Ave 72 76 Pine St 73 781 Terrace View Rd 813 Wisconsin Ave 75 817 W. Balsam St 77 87 187 Rd 813 Visconsin Ave 813 Grees Ferry Rd		2.01E-04	0	0	0.00E+00	0.00E+00	2.00E-04	1	7	2.00E-04	1.40E-03	2.32E-04	0 0	0.00E+00	0.00E+00	1.98E-04	0	1	0.00E+00	1.98E-04
63 5862 Highway 2 S 64 5865 Highway 2 S 65 600 Granite Ave 66 610 Granite Ave 66 610 Granite Ave 68 690 Reserve Rd 70 700 Farm to Market Rd 71 71 Claire Ave 72 75 Pins View Rd 4813 Wisconsin Ave 75 87 Yellowlail Rd 76 87 Yellowlail Rd 883 Grees Ferry Rd		2.00E-04	0	1	0.00E+00	2.00E-04	2.64E-04	0	4	0.00E+00	1.06E-03	2.32E-04	0 1	0.00E+00	2.32E-04	2.43E-04	1	22	2.43E-04	5.35E-03
64 5865 Highway 2 S 65 600 Granite Ave 67 628 Avenue B 68 660 Reserve Rd 697 Farm to Market Rd 70 700 Farm to Market Rd 71 71 Claira Ave 72 76 Pine St 73 781 Terrace View Rd 813 Wisconsin Ave 75 817 W. Balsam St 77 87 791 devrail Rd		1.97E-04 2.00E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	1.92E-04 2.47E-04	3	1 14	1.92E-04 7.41E-04	1.92E-04 3.46E-03	1.99E-04 1.92E-04	0 0	0.00E+00	0.00E+00 3.85E-04	1.99E-04 1.99E-04	0	0	0.00E+00	0.00E+00
65 600 Granite Ave 66 610 Granite Ave 67 628 Avenue B 68 660 Reserve Rd 70 700 Farm to Market Rd 71 71 Claire Ave 72 75 Pine S Terraco View Rd 813 Wisconsin Ave 75 817 W. Balsam St 77 87 883 Greers Ferry Rd 883 Greers Ferry Rd 883 Greers Ferry Rd		5.97E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	1.88E-04	4	5	7.41E-04 7.51E-04	9.39E-04	1.92E-04 2.59E-04	1 2	1.92E-04 0.00E+00	0.00E+00	1.99E-04 1.96E-04	0	1	0.00E+00 0.00E+00	5.96E-04 1.96E-04
66 610 Granite Ave 67 628 Avenue B 68 660 Reserve Rd 69 6797 Farm to Market Rd 70 700 Farm to Market Rd 71 Claira Ave 72 76 Pine St 73 1 Farrace View Rd 813 Wisconsin Ave 75 817 W. Balsam St 77 87 Yellowtail Rd 77 883 Greers Ferry Rd		1.83E-04	0	0	0.00E+00	0.00E+00	1.95E-04	0	0	0.00E+00	0.00E+00	1.99E-04	0 0	0.00E+00	0.00E+00	2.54E-04	0	1	0.00E+00	2.54E-04
688 660 Reserve Rd 696 797 Farm to Market Rd 7070 Farm to Market Rd 71 Claire Ave 72 76 Pine St 73 781 Terrace View Rd 813 Wisconsin Ave 814 W. Balsam St 75 817 W. Balsam St 76 87 Vellowtail Rd 77 893 Greers Ferry Rd	Ave	1.90E-04	0	0	0.00E+00	0.00E+00	1.96E-04	0	0	0.00E+00	0.00E+00	1.81E-04	0 0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.00E+00
69 6797 Farm to Market Rd 700 700 Farm to Market Rd 71 71 Claire Ave 72 76 Pine St 73 781 Terrace View Rd 74 813 Wisconsin Ave 817 W. Balsam St 75 87 Yellowtail Rd 77 893 Greers Ferry Rd		1.98E-04	0	0	0.00E+00	0.00E+00	1.95E-04	1	2	1.95E-04	3.90E-04	BESS 4			DESCRIPTION OF	0.10	67.17.29			Contract of
70 700 Farm to Market Rd 71 71 Claire Ave 2 76 Pine St 73 781 Terrace View Rd 74 813 Wisconsin Ave 817 W. Balsam St 75 817 Yellowtail Rd 77 893 Greers Ferry Rd		2.00E-04	0	1	0.00E+00	2.00E-04	2.00E-04	2	5	4.00E-04 0.00E+00	9.99E-04	2.47E-04	0 0	0.00E+00	0.00E+00	2.49E-04	1	1	2.49E-04	2.49E-04
71 Claire Ave 72 76 Pine St 73 781 Terrace View Rd 74 813 Wisconsin Ave 75 817 W. Balsam St 76 87 Yellowtail Rd 77 893 Greers Ferry Rd		1.96E-04 2.00E-04	0	0	1.96E-04 0.00E+00	1.96E-04 0.00E+00	1.87E-04 1.99E-04	0	3	3.97E-04		1.91E-04 1.91E-04	0 0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	1.98E-04 2.62E-04	0	3	0.00E+00 0.00E+00	5.95E-04 2.62E-04
72 76 Pine St 73 781 Terrace View Rd 74 813 Wisconsin Ave 817 W. Balsam St 76 87 Yellowtail Rd 77 893 Greers Ferry Rd		1.99E-04	0	0	0.00E+00	0.00E+00	1.93E-04	0	0	0.00E+00		2.00E-04	0 0	0.00E+00	0.00E+00	1.98E-04	0	1	0.00E+00	1.98E-04
<ul> <li>74 813 Wisconsin Ave</li> <li>75 817 W. Balsam St</li> <li>76 87 Yellowtail Rd</li> <li>77 893 Greers Ferry Rd</li> </ul>		2.00E-04	2	4	4.01E-04	8.01E-04	2.00E-04	4	15	7.98E-04	2.99E-03	2.32E-04	0 0	0.00E+00	0.00E+00	2.25E-04	1	10	2.25E-04	2.25E-03
75 817 W. Balsam St 76 87 Yellowtail Rd 77 893 Greers Ferry Rd		2.01E-04	0	2	0.00E+00	4.01E-04	2.47E-04	1	9	2.47E-04	2.23E-03	2.00E-04	0 0	0.00E+00	0.00E+00	1.99E-04	0	0	0.00E+00	0.00E+00
76 87 Yellowtail Rd 77 893 Greers Ferry Rd		1.99E-04	0	0	0.00E+00	0.00E+00	1.37E-03	0	0	0.00E+00		1.98E-04	0 0	0.00E+00	0.00E+00	1.99E-04	0	0	0.00E+00	0.00E+00
77 893 Greers Ferry Rd		1.92E-04 1.94E-04	0	0	0.00E+00 0.00E+00	0.00E+00 1.94E-04	2.00E-04 1.96E-04	3	21 0	5.99E-04 0.00E+00	4.19E-03 0.00E+00	1.98E-04 2.00E-04	0 0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	2.42E-04 1.98E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00
		1.94E-04 1.98E-04	0	1	0.00E+00	1.94E-04 1.98E-04	1.96E-04 1.99E-04	2	9	3.98E-04	1.79E-03	1.80E-04	0 0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	1.83E-04	2	2	3.66E-04	3.66E-04
		2.00E-04	0	3	0.00E+00	5.99E-04	1.99E-04	1	2	1.99E-04	3.97E-04	2.47E-04	0 0	0.00E+00	0.00E+00	2.69E-04	1	3	2.69E-04	8.07E-04
79 985 Farm to Market Rd	Market Rd	1.60E-04	0	0	0.00E+00	0.00E+00	1.94E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0 0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00E+00
80 99 Vanderwood Rd 81 998 Terrace View Rd		1.99E-04 1.99E-04	0	0	0.00E+00	0.00E+00 0.00E+00	2.00E-04 2.00E-04	3 2	7 6	6.01E-04 4.00E-04		1.99E-04 2.60E-04	0 0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	2.00E-04 1.35E-03	3	9	5.99E-04 0.00E+00	1.80E-03 0.00E+00

not collected

Table 5-2. Indoor ABS Air Data (cont.)

ABS				Passive Air		ROL	IND 3		Active Air					Passive A	r	ROU	ND 4		Active Air		
Area	Address	Sens	I NI Str	ructures	Air Con	oc (elec)	Sens	I N St	active Air ructures	Air Cor	nc (s/cc)	Sens	I N Str	ructures		nc (s/cc)	Sens	I NS	ructures	Air Co	nc (s/cc)
Area		(cc)-1	PCME	Total LA	PCME	Total LA	(cc)-1	PCME	Total LA	PCME	Total LA	(cc)-1	PCME	Total LA	PCME	Total LA	(cc)-1	PCME		PCME	Total L
1	10 Park St	1.95E-04	0	0	0.00E+00	0.00E+00	1.95E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00E+00	1.99E-04	1	1	1.99E-04	1.99E
2	101 Woodland Rd	1.94E-04	0	0	0.00E+00	0.00E+00	4.48E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00E+00	5.50E-04	0	2	0.00E+00	1.10E
3	1016 Nevada Ave	1.98E-04	0	0	0.00E+00	0.00E+00	1.95E-04	0	0	0.00E+00	0.00E+00	1.95E-04	0	0	0.00E+00	0.00E+00	5.04E-04	0	0	0.00E+00	0.00E
4	1020 California Ave	1.94E-04	0	0	0.00E+00	0.00E+00	2.48E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.00E+00	2.85E-04	0	7	0.00E+00	2.00E
5	1021 Nevada Ave	1.93E-04	0	0	0.00E+00	0.00E+00	1.92E-04	0	0	0.00E+00	0.00E+00	1.97E-04	0	0	0.00E+00	0.00E+00	7.88E-04	0	0	0.00E+00	0.00E
6	1022 Utah Ave	1.90E-04	0	0	0.00E+00	0.00E+00	2.22E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.00E+00	1.99E-04	2	5	3.99E-04	9.96E
7	1037 California Ave	1.97E-04	0	0	0.00E+00	0.00E+00	2.35E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.00E+00	2.43E-04	1	1	2.43E-04	2.43E
8	104 Granite Ave	1.91E-04	0	0	0.00E+00	0.00E+00	1.93E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00E+00	2.48E-04	1	4	2.48E-04	9.90
9	1047 Sheldon Flats Rd	1.92E-04	0	0	0.00E+00	0.00E+00	1.89E-04	0	0	0.00E+00	0.00E+00	1.96E-04	0	0	0.00E+00	0.00E+00	4.37E-04	0	0	0.00E+00	0.00E
10	105 W. Oak St	1.93E-04	0	0	0.00E+00	0.00E+00	4.79E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	1	0.00E+00	1.98E-04	5.64E-04	0	0	0.00E+00	0.00E
11	106 Voves Ave	1.96E-04	0	0	0.00E+00	0.00E+00	1.93E-04	0	0	0.00E+00	0.00E+00	1.99E-04	0	1	0.00E+00	1.99E-04	1.99E-04	0	0	0.00E+00	0.00E
12	1106 Nevada Ave	1.95E-04	0	0	0.00E+00	0.00E+00	1.94E-04	0	2	0.00E+00	3.88E-04	1.98E-04	1	1	1.98E-04	1.98E-04	5.45E-04	1	6	5.45E-04	3.27
13	1118 Montana Ave 112 W. Cedar St	1.89E-04	0	0	0.00E+00	0.00E+00 0.00E+00	1.92E-04 1.96E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	1.98E-04 1.95E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	5.58E-04 1.94E-04	0	0	0.00E+00 0.00E+00	0.00E
14	118 White Ave	1.94E-04 1.91E-04	0	0	0.00E+00 0.00E+00	0.00E+00	4.46E-04	1	1	4.46E-04	4.46E-04	1.99E-04	1	1	1.99E-04	1.99E-04	2.00E-04	6	30	1.20E-03	5.99
16	120 Forest Ave	1.97E-04	0	0	0.00E+00	0.00E+00	4.54E-04	1	2	4.54E-04	9.08E-04	1.94E-04	Ö	Ö	0.00E+00	0.00E+00	2.36E-03	0	0	0.00E+00	0.008
17	120 Manor Dr	1.96E-04	0	0	0.00E+00	0.00E+00	1.95E-04	ó	0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00E+00	5.66E-04	0	1	0.00E+00	5.66
18	1203 Louisiana Ave	1.93E-04	0	0	0.00E+00	0.00E+00	1.94E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	1	0.00E+00	2.00E-04	1.99E-04	0	Ö	0.00E+00	0.000
19	125 Spencer Hill Way	1.79E-04	0	0	0.00E+00	0.00E+00	4.17E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	2	0.00E+00	3.97E-04	1.99E-04	2	4	3.98E-04	7.958
20	1302 Airth Ave	2.00E-04	0	0	0.00E+00	0.00E+00	2.00E-04	2	4	4.00E-04	8.00E-04	1.96E-04	0	0	0.00E+00	0.00E+00	1.98E-04	1	1 7	1.98E-04	1.98
21	1313 Renwood Dr	1.99E-04	0	0	0.00E+00	0.00E+00	1.94E-04	0	0	0.00E+00	0.00E+00	1.93E-04	0	0	0.00E+00	0.00E+00	4.41E-04	Ó	0	0.00E+00	0.00E
22	1314 Dakota Ave	1.97E-04	0	0	0.00E+00	0.00E+00	4.39E-04	0	2	0.00E+00	8.78E-04	1.98E-04	0	0	0.00E+00	0.00E+00	2.43E-04	1	1	2.43E-04	2.43
23	133 Spencer Rd	1.98E-04	0	0	0.00E+00	0.00E+00	1.92E-04	0	0	0.00E+00	0.00E+00	1.99E-04	0	0	0.00E+00	0.00E+00	1.94E-04	Ö	Ö	0.00E+00	0.00
24	1405 Dakota Ave	1.90E-04	0	0	0.00E+00	0.00E+00	2.24E-04	3	20	6.72E-04	4.48E-03	1.88E-04	0	ő	0.00E+00	0.00E+00	2.47E-04	2	3	4.94E-04	7.42
25	1414 Main Ave	1.99E-04	0	0	0.00E+00	0.00E+00	1.99E-04	0	11	0.00E+00	2.19E-03	2.00E-04	0	0	0.00E+00	0.00E+00	1.96E-04	0	0	0.00E+00	0.00
26	1464 E. 5th St Ext	1.95E-04	0	0	0.00E+00	0.00E+00	1.83E-04	0	0	0.00E+00	0.00E+00	1.97E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.008
27	15 Avenue B	2.00E-04	0	0	0.00E+00	0.00E+00	1.95E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	ō	0.00E+00	0.00E+00	4.18E-04	0	0	0.00E+00	0.00
28	1525 Lolo Ave	1.95E-04	0	0	0.00E+00	0.00E+00	4.49E-04	0	0	0.00E+00	0.00E+00	1.90E-04	0	0	0.00E+00	0.00E+00	1.90E-04	1	3	1.90E-04	5.69
29	156 S. Central Rd	1.92E-04	0	0	0.00E+00	0.00E+00	1.96E-04	0	0	0.00E+00	0.00E+00	1.98E-04	1	1	1.98E-04	1.98E-04	2.00E-04	0	0	0.00E+00	0.00
30	1573 Kootenai River Rd	1.81E-04	0	0	0.00E+00	0.00E+00	1.95E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00
31	1621 Main Ave	1.96E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	2	0.00E+00	4.01E-04	1.98E-04	0	0	0.00E+00	0.00
32	1711 Airstrip Rd	1.94E-04	0	0	0.00E+00	0.00E+00	4.60E-04	2	4	9.20E-04	1.84E-03	1.99E-04	0	0	0.00E+00	0.00E+00	2.48E-03	1	8	2.48E-03	1.98
33	188 Terrace View Rd	1.95E-04	0	0	0.00E+00	0.00E+00	1.97E-04	0	1	0.00E+00	1.97E-04	1.94E-04	0	0	0.00E+00	0.00E+00	2.00E-04	3	7	6.00E-04	1.40
34	191 Farm to Market Rd	1.96E-04	0	0	0.00E+00	0.00E+00	1.95E-04	0	0	0.00E+00	0.00E+00	1.86E-04	0	0	0.00E+00	0.00E+00	2.49E-04	1	4	2.49E-04	9.96
35	1915 Kootenai River Rd	1.96E-04	0	0	0.00E+00	0.00E+00	1.99E-04	0	0	0.00E+00	0.00E+00	1.84E-04	0	0	0.00E+00	0.00E+00	2.62E-04	0	10	0.00E+00	2.62
36	21 Voves Ave	1.96E-04	0	0	0.00E+00	0.00E+00	4.53E-04	0	0	0.00E+00	0.00E+00	1.99E-04	0	0	0.00E+00	0.00E+00	7.71E-04	0	0	0.00E+00	0.00
37	226 Spencer Rd	2.00E-04	0	0	0.00E+00	0.00E+00	5.50E-04	2	3	1.10E-03	1.65E-03	1.97E-04	0	2	0.00E+00	3.94E-04	4.97E-04	0	0	0.00E+00	
38	2293 Kootenai River Rd	1.94E-04	0	0	0.00E+00	0.00E+00		. s	ample damaç			1.97E-04	0	0	0.00E+00	0.00E+00	1.99E-04	0	1	0.00E+00	1.99
39	2297 Kootenai River Rd	1.92E-04	0	0	0.00E+00	0.00E+00	1.92E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00E+00	1.98E-04	1	1	1.98E-04	1.98
40	2375 Kootenai River Rd	1.93E-04	0	0	0.00E+00	0.00E+00	1.95E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00E+00	1.97E-04	0	1	0.00E+00	1.97
41	25 Evans Rd	1.96E-04	0	0	0.00E+00	0.00E+00	1.91E-04	0	0	0.00E+00	0.00E+00	1.95E-04	0	0	0.00E+00	0.00E+00	1.09E-03	0	0	0.00E+00	0.00
42	255 Lodgepole Way	1.94E-04	0	0	0.00E+00	0.00E+00	1.94E-04	0	0	0.00E+00	0.00E+00	1.95E-04	0	0	0.00E+00	0.00E+00	1.99E-04	0	0	0.00E+00	0.00
43	269 N. Central Rd	1.99E-04	0	0	0.00E+00	0.00E+00	2.30E-04	1	4	2.30E-04	9.20E-04	1.82E-04	1	1	1.82E-04	1.82E-04	2.39E-04	1	11	2.39E-04	2.63
44	281 S. Central Rd	1.92E-04	0	0	0.00E+00	0.00E+00	1.96E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00E+00	2.00E-04	2	3	4.01E-04	6.01
45	292 Spencer Rd	2.00E-04	0	0	0.00E+00	0.00E+00	2.00E-04	2	4	4.00E-04	8.00E-04	1.90E-04	0	0	0.00E+00	0.00E+00	1.20E-03	0	0	0.00E+00	0.001
46	304 Spencer Rd	1.93E-04	0	0	0.00E+00	0.00E+00	1.95E-04	0	0	0.00E+00	0.00E+00	1.99E-04	1	2	1.99E-04	3.99E-04	8.74E-04	0	1	0.00E+00	8.74
47	310 W. Flower St	1.96E-04	0	0	0.00E+00	0.00E+00	1.89E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	1	0.00E+00	2.00E-04	2.00E-04	0	0	0.00E+00	0.001
48	32 Shalom Kerry	1.99E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.00E+00	1.97E-04	0	0	0.00E+00	0.00E+00	2.55E-04	0	1	0.00E+00	2.55
49	323 E. Cedar St	1.93E-04	0	0	0.00E+00	0.00E+00	2.04E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00E+00	1.72E-04	1	1 1	1.72E-04	1.72
50	337 Commerce Way	1.91E-04	0	0	0.00E+00	0.00E+00	1.96E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.00E+00	1.99E-04	0	1	0.00E+00	1.99
51	3518 Highway 2 S	1.93E-04	0	0	0.00E+00	0.00E+00	2.33E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	1	0.00E+00	2.00E-04	1.99E-04	0	6	1.99E-04	1.19
52	3576 Highway 2 S	1.94E-04	0	0	0.00E+00	0.00E+00	4.09E-04	0	0	0.00E+00	0.00E+00	1.95E-04	0	0	0.00E+00	0.00E+00	1.95E-04	1	3	0.00E+00	0.00
53	3796 Highway 2 S	1.92E-04		0	0.00E+00	0.00E+00	1.94E-04		0	0.00E+00	0.00E+00	2.00E-04			0.00E+00	0.00E+00	1.99E-04	1		1.99E-04	5.98
54 55	3798 Highway 2 S	1.95E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	1.93E-04 1.94E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	1.99E-04 1.99E-04	0	0	0.00E+00 0.00E+00	0.00E+00 0.00E+00	2.00E-04 1.96E-04	0	0	2.00E-04 0.00E+00	0.00
56	38 Spencer Hill Way 397 Sheldon Ln	1.95E-04 1.97E-04	0	0	0.00E+00	0.00E+00	1.94E-04 1.95E-04	0	0	0.00E+00	0.00E+00	1.87E-04	2	3	3.75E-04	5.62E-04	2.30E-04	1	7	2.30E-04	1.61
57	4304 Highway 37 N	1.96E-04	0	0	0.00E+00	0.00E+00	1.93E-04 1.92E-04	0	0	0.00E+00	0.00E+00	2.01E-04	0	0	0.00E+00	0.00E+00	5.70E-04	8	39	4.56E-03	2.22
58	460 Woodland Heights Rd	1.98E-04	0	0	0.00E+00	0.00E+00	1.92E-04	0	0	0.00E+00	0.00E+00	1.85E-04	1	1	1.85E-04	1.85E-04	1.79E-04	0	0	0.00E+00	0.00
59	487 Kootenai Dr	1.91E-04	0	0	0.00E+00	0.00E+00	1.96E-04	0	0	0.00E+00	0.00E+00	1.79E-04	Ö	Ó	0.00E+00	0.00E+00	1.84E-04	0	0	0.00E+00	0.00
60	515 Minnesota Ave	1.83E-04	0	0	0.00E+00	0.00E+00	1.97E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.00E+00	2.00E-04	1	4	2.00E-04	7.99
61	546 Granite Ave	1.89E-04	0	0	0.00E+00	0.00E+00	1.97E-04	o o	ő	0.00E+00	0.00E+00	1.98E-04	1	1	1.98E-04	1.98E-04	1.98E-04	Ö	0	0.00E+00	0.00
62	56 Enders Dr	1.95E-04	0	0	0.00E+00	0.00E+00	1.91E-04	0	0	0.00E+00	0.00E+00	1.97E-04	1	1	1.97E-04	1.97E-04	2.04E-04	2	10	4.08E-04	2.04
63	5862 Highway 2 S	1.96E-04	0	0	0.00E+00	0.00E+00	2.00E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	Ö	0.00E+00	0.00E+00	1.98E-04	0	1	0.00E+00	1.98
64	5865 Highway 2 S	1.96E-04	0	0	0.00E+00	0.00E+00	1.96E-04	0	0	0.00E+00	0.00E+00	1.97E-04	0	0	0.00E+00	0.00E+00	1.99E-04	0	1	0.00E+00	1.99
65	600 Granite Ave	1.95E-04	0	0	0.00E+00	0.00E+00	1.97E-04	0	0	0.00E+00	0.00E+00	1.98E-04	1	1	1.98E-04	1.98E-04	2.19E-03	0	0	0.00E+00	0.00
66	610 Granite Ave	1.97E-04	0	0	0.00E+00	0.00E+00	1.94E-04	0	0	0.00E+00	0.00E+00	1.87E-04	0	0	0.00E+00	0.00E+00	1.98E-04	1	1	1.98E-04	1.98
67	628 Avenue B	250	200	52 Feb. 5	1000		STREET,	365	FE 1000	250520	DV-8081	22000	N. E.	PAY 528	5 300		E200 E3	EL SAU	Section 1	SHEWE	1000
	660 Reserve Rd	1.92E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00		1.99E-04	1	1	1.99E-04	
	6797 Farm to Market Rd	1.88E-04	-4	4	7.52E-04	7.52E-04	4.50E-04	4	6	1.80E-03	2.70E-03	1.85E-04	0	0	0.00E+00		2.39E-04	0	2	0.00E+00	
70	700 Farm to Market Rd	1.98E-04	0	1	0.00E+00	1.98E-04	1.94E-04	0	0	0.00E+00	0.00E+00	1.96E-04	0	0	0.00E+00		4.89E-04	0	0	0.00E+00	
	71 Claire Ave	1.94E-04	0	0		0.00E+00	2.32E-04	0	4	0.00E+00		1.99E-04	0	0	0.00E+00	0.00E+00	1.99E-04	0	0	0.00E+00	0.00
72	76 Pine St	1.90E-04	0	0		0.00E+00	1.94E-04	0	0	0.00E+00		1.98E-04	0	0	0.00E+00		2.00E-04	4	35	8.01E-04	
73	781 Terrace View Rd	1.90E-04	0	0	0.00E+00	0.00E+00	1.94E-04	0	0	0.00E+00		1.83E-04	0	0	0.00E+00		2.31E-04	3	15	6.93E-04	3.46
	813 Wisconsin Ave	2.00E-04	0	0	0.00E+00	0.00E+00	1.97E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	1	0.00E+00		4.78E-04	2	4	9.56E-04	1.91
	817 W. Balsam St	1.94E-04	0	0	0.00E+00	0.00E+00	4.69E-04	3	28	1.41E-03	1.31E-02	1.81E-04	1	1	1.81E-04	1.81E-04	2.35E-04	2	12	4.71E-04	
	87 Yellowtail Rd	1.94E-04	0	0	0.00E+00		1.98E-04	0	0	0.00E+00		1.98E-04	0	0	0.00E+00		2.00E-04	3	6	6.00E-04	
77	893 Greers Ferry Rd	1.27E-04	1	1	1.27E-04	1.27E-04	2.00E-04	0	0	0.00E+00	0.00E+00	1.99E-04	0	0	0.00E+00		5.56E-04	1	1	5.56E-04	
78	912 California Ave	1.97E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00		5.64E-04	1	4	5.64E-04	
	985 Farm to Market Rd	1.94E-04	0	0	0.00E+00	0.00E+00	2.51E-04	0	2	0.00E+00	5.02E-04	1.98E-04	0	0	0.00E+00		1.99E-04	0	0	0.00E+00	
	99 Vanderwood Rd	1.92E-04	0	0	0.00E+00	0.00E+00	1.95E-04	1	1	1.95E-04	1.95E-04	1.99E-04	0	0	0.00E+00		1.99E-04	0	0	0.00E+00	
81	998 Terrace View Rd	1.94E-04	0	0	0.00E+00	0.00E+00	1.96E-04	0	0	0.00E+00	0.00E+00	1.98E-04	0	0	0.00E+00	0.00E+00	1.98E-04	1	4	1.98E-04	7.94

### Table 5-3. Indoor ABS Dust Data

												Round 1								
ABS	Location	Indoor ABS		T		ple #1						mple #2				_		ample #3	_	
Area	Location	Group	Index ID	Sens (cm)		uctures		ling (s/cm²)	Index ID	Sens (cm)		chires		iding (s/cm²)	Index ID	Sens		uctures		iding (s/cm²)
_	40 D-+ Ct	INTA	IN 00740	172	Total LA	PCME LA	Total LA	PCME LA	1	<u> </u>	Total LA	PCME LA	Total LA	PCME LA	<u> </u>	(cm) ⁻²	Total LA	PCME LA	Total LA	PCME LA
.1	10 Park St 101 Woodland Rd	INT4 INT2	IN-00749 IN-00920	17.3 17.3	0	0	0	0	1	ł				ŀ	}			1	ŀ	ł
3	1016 Nevada Ave	INT2	IN-00215	19.2	Ö	0	Ö	٥	IN-00214	19.2	0	0	0	0	-			1		-
4	1020 California Ave	INT3	IN-00482	17.3	0		0	0			1 -		_		1		-	_	<u> </u>	]
5	1021 Nevada Ave	INT2	IN-00256	17.5	0	0	0	Ö	IN-00257	17.5	0	0	0	0			ļ		ļ	
6_	1022 Utah Ave	INT1	IN-00828	17.3	-0-	0 -		0 -	<u> </u>		ļ			<b> </b>						
7 -	1037 California Ave 104 Granite Ave	INT3	IN-00285 IN-00696	17.5	- 0 -	0	0 -	- 0-										<del> </del>	<del> </del> -	
9	1047 Sheldon Flats Rd	INT1	IN-00499	19.2	Ĭ	- š ·	0	0	ţ.	1	1	1	ļ.	<b>†</b>	1		1	l	1	
10	105 W. Oak St	INT1	IN-00491			sample los	4			1				<u> </u>			1			
11	106 Voves Ave	INT3	IN-00438	15.7	0	ō	0	0	IN-00436	18.0	0	0	0	0_	ļ					
12	1106 Nevada Ave	INT4	IN-00707	3. <u>5</u> 17.3	0	0	0	0	ļ	ł	1				-		ļ			
13	112 W. Cedar St	INT3 INT2	IN-00893 IN-00808	19.2	- 0 -	$\frac{0}{0}$	-0 -	<u> 0</u>			ŀ · -							<del> </del> -		
15	118 White Ave	INT2	IN-01022	17.3	0	- <del>0</del>		- ··· <del>0</del> —	<del> </del>	-			l ·—					·	<del> </del>	
16	120 Forest Ave	INT2	IN-00300	17.3	Ō	0	0	0	İ	Ì	1 .	1	1	İ			İ	i .	İ	1
17	120 Manor Dr	INT2	IN-00608	17.3	. 0	0	0	0	I											
18	1203 Louisiana Ave	INT4	IN-00691	17.3	0	0	0	0	<u> </u>						ļ					
19	125 Spencer Hill Way	INT4	IN-00818	17.3	0_	j ë	ō	ō		- 40.5	١ ؍		١ .		1					
20 21	1302 Airth Ave 1313 Renwood Dr	INT3	IN-00251 IN-00263	10.5	0 0	0	0	- 0	IN-00250 IN-00262	10.5	0	0 -	0	0					<u> </u>	
22	1314 Dakota Ave	INT4	IN-00203	19.2	1 0	0	- <del> </del> -	1-6-	114-00202	13.2	} <del>-</del> -	<del></del>	¥—	<u>-</u>				1		
23	133 Spencer Rd	INT4	IN-00613	17.3	0	0	0	<u> </u>	<u> </u>	<u></u>	<u></u>	L ".	1	L		l	<u></u>	1_		1
24	1405 Dakota Ave	INT4	IN-00320	19.8	0	0	0	0	IN-00321	19.8	0	0	0	0	ļ ⁻ -		ļ	ļ	ļ <u>.</u>	
25	1414 Main Ave	INT3	IN-00416	17.3	0	0	0	0		ļ	ļ	ļ	<u> </u>	ļ	<del> </del>	<del> </del> —	l	·	ļ <u></u>	
26 27	1464 E. 5th St Ext 15 Avenue B	INT1 INT4	IN-00635 IN-00944	10.5	· - · <u>0</u> - ·	<u> </u>	$-\frac{0}{0}$	-0-		<del> </del>				1 —		-				f
28	1525 Lolo Ave	INT3	IN-00458	17.3		- <del>0</del>		0	·	·						·- ·			<del> </del>	
29	156 S. Central Rd	INT3	IN-00380	15.7	0	0	0	-0	IN-00383	18.0	0	0	0	0 -	t	i .				l
30	1573 Kootenai River Rd	INT4	IN-00900	17.3	0	0	0	0				I	Ī	1	1 · ·	1	]	I		1
31	1621 Main Ave	INT3	IN-00836	17.3	0	0	0	0	<u> </u>		l				I		l			
32	1711 Airstrip Rd	INT2	IN-00764		ļ <u>0</u>	0	0	0	.	ļ	·}	ļ	l	——						
33 34	188 Terrace View Rd 191 Farm to Market Rd	INT1	IN-00813 IN-00558	17.3 6.3	0 -	0	0 -	0												
35	1915 Kootenai River Rd	INT2	IN-00329	· t ———	<del>                                     </del>	0	17.3	0	IN-00328	17.3	<del></del>		₀						l	
36	21 Voves Ave	INT4	IN-00242	+	0	0	0	0	IN-00241	11.5	0	0	0	0			1			
37	226 Spencer Rd	INT4	IN-00441	15.7	0	0	0	0	<u> </u>	1						<u> </u>				
38	2293 Kootenai River Rd	INT3	IN-00525	19.2	0	0	0	0	ļ	ļ	ļ	<b> </b>	l	<u> </u>	l :	ļ			<b> </b>	l
39	2297 Kootenai River Rd	INT4	IN-00543		0	0	0	0 -		l——	l	<del> </del>	<del> </del> —		l	ļ.—	<b> </b>	<u> </u>	ł	l
40	2375 Kootenai River Rd 25 Evans Rd	INT2 INT1	IN-00681 IN-00356	10.5	0	<u> </u>	0	0	<del> </del>		·				l ——		· —		·	<del> </del>
42	255 Lodgepole Way	INT1	IN-00657	10.5	0	<del> </del>	0 -	- <del>-</del> -	†  —	1	<del> -</del> -	+···								
43	269 N. Central Rd	INT2	IN-00310		0	0		- <del>0</del> -		1 -						l	1			
44	281 S. Central Rd	INT3	IN-00716		0	0	0	0												L
45	292 Spencer Rd	INT4	IN-00304		0	0	0	0	ļ.,		ļ	ļ			<b> </b>	<u> </u>	·	<u> </u>	ļ	l
46	304 Spencer Rd 310 W. Flower St	INT3	IN-00362 IN-00726		0	0	0	0	·	<b>{</b>		<del> </del>	· · ·	{ <b>-</b>	ļ·	<b>{-</b>	<b> </b> -	<u> </u>	· ·	{—
48	32 Shalom Kerry	INT1	IN-00720		0	1 0 -		1-0-	IN-00391	19.7	<del>  0</del>		<u>-</u>				1	<del> </del>	·	∤ ·
49	323 E. Cedar St	INT1	IN-00748	-	0 -	0	0	- <del> </del>	1 , , , , , ,	1	- <u> </u>	<del>-</del>		<u>-</u>	<u> </u>		1		1	
50	337 Commerce Way	INT1	IN-00981	19.8	0	0	0	0					1		I					1
51	3518 Highway 2 S	INT2	IN-00779	17.3	_0_	0	0	0	l	J	<u> </u>					ļ	J	ļ	ļ	
52 53	3576 Highway 2 S	INT1	IN-00949		0	0	0 0	$-\frac{0}{0}$				· · — -	<u> </u>	<u> </u>			·	·	l	·
54	3796 Highway 2 S 3798 Highway 2 S	INT3	IN-00506 IN-00477		<del></del>	0	·   — <del>0</del>			1	1	<del> </del>					+	t	l	
55	38 Spencer Hill Way	INT4	IN-00563		0	0	0		1	<del> </del>	1		I —	<del> </del>	<del> </del>	1	1		1	1
56	397 Sheldon Ln	INT2	IN-00576	10.5	0	0	0	0	<u></u> .	[		<u></u>				I				
	4304 Highway 37 N	INT3	IN-00787	-1	0	0	0	0	J	ļ	1	ļ		<u> </u>		<u> </u>		ļ ·		
58	460 Woodland Heights Rd	INT1	IN-00649		0	0	0	0	ļ	ļ	<u> </u>	ļ	<u> </u>			<u> </u>	-{	<del> </del>	<u> </u>	
59 60	487 Kootenai Dr 515 Minnesota Ave	INT2 INT3	IN-00724 IN-00966		0	0	0 -		<del> </del>	1	<del> </del>	<del> </del>	<b> </b>	J	1		<del> </del>			
61	546 Granite Ave	INT4	IN-00798		1 0	0	0	0	t	1	<del> </del>	1			t	<del> </del>	† ·	· <del> </del>	1	
62	56 Enders Dr	INT3	IN-00569		0	0	0	0				<u> </u>	1				L			
63	5862 Highway 2 S	INT1	IN-00841		0	0	0	0			<u> </u>				1	ļ		ļ		
64	5865 Highway 2 S	INT1	IN-00236		0	0	0	0	IN-00235	11.5	.0	0_	0	. 0	IN-00237	19.2		0	0	0
65 66	600 Granite Ave	INT1	IN-00641		0	0	-0-	$-\frac{0}{0}$	IN-00201	10.0	0			· ₀	IN-00202	16 4		0	0	
67	610 Granite Ave 628 Avenue B	INT2	IN-00203 IN-00871		0	0	0		114-00201	19.2	<del> </del> -			<u>-</u>	114-00202	16.4	- 0 -		1	- <u>-0</u>
68	660 Reserve Rd	INT2	IN-00768		0		0	0	1		1	1	1	1	1	1	1	1	1	
69	6797 Farm to Market Rd	INT1	IN-00417	17.3	0	0	0	0	IN-00419	17.3	0	0	0	0					]	
70	700 Farm to Market Rd	INT2	IN-00821		0	0	0	0			ļ	<u> </u>	ļ	L	ļ				l	
71	71 Claire Ave	INT4	IN-00606		0	0	- 0	- 0 -		1	·	<del> </del>			<del> </del>	ł —			ł	
72 73	76 Pine St 781 Terrace View Rd	INT3	IN-00961 IN-00589		0	0	0	0	<del> </del>	<del> </del>	<del> </del>		<del> </del>	<del> </del>	- <del> </del>	·	1		<del> </del>	
74	813 Wisconsin Ave	INT4	IN-00589		0	0 -		- <del>- 0</del>	- <del> </del> - ·	1	- <b> </b> ·				-	1		-		
75	817 W. Balsam St	INT3	IN-00375		0	0	0	0	IN-00369	17.3	0	Ō	0		1		<del> </del>		t	
76	87 Yellowtail Rd	INT4	IN-00860		0	0	0	0		1							I			I
77	893 Greers Ferry Rd	INT3	IN-00883		0	0	0	0	<u> </u>		1		ļ			<b>↓</b>	J	.	ļ	
78	912 California Ave	INT2	IN-00741		0	0	0 -	0	ļ	ļ	<del> </del>	<del> </del>	<b> </b>		ļ — ···	<b> </b>	ļ ·	. <b>.</b>	<b> </b>	
79 80	985 Farm to Market Rd 99 Vanderwood Rd	INT1	IN-00851 IN-00922		0	0 -	$-\frac{1}{9}$	- 0	<del> </del>	<b> </b> -		·					<b></b>	<del> </del>		—-
		INT1	IN-00922		0	0	- <del>  0</del> -	0		·	1	·			-	<del> - · -</del>			l	·
81	998 Terrace View Rd																			

Indoor ABS Summary PCME_V2.xis

Table 5-3. Indoor ABS Dust Data (cont.)

						Downd 2			Table	, J-J. I			ist Date	a (cont.)				Davind 4		-
ABS		Indoor				Round 2 uctures	Duetles	ading (s/cm²)				Round 3 uctures	Dusting	ading (s/cm²)			Round 4  N Structures Dust Loading			-di (-/2)
Area	Location	ABS Group	Index ID	Sens (cm)	Total LA	PCME LA	Total LA	PCME LA	Index ID	Sens (cm)	Total LA	PCME LA	Total LA	PCME LA	Index ID	Sens (cm)		PCME LA	10.00.00	PCME LA
1	10 Park St	INT4	IN-01466	6.3	0	0	0	0	IN-02297	13.8	0	0	0	O O	IN-02918	20.0	Total LA	0	Total LA	0
2	101 Woodland Rd	INT2	IN-01556	19.8	0	0	0	0	IN-02292	13.8	0	0	0	0	IN-02882	17.5	0	0	0	0
3	1016 Nevada Ave 1020 California Ave	INT2 INT3	IN-01079 IN-01373	19.2 17.3	0	0	0	0	IN-01866 IN-02142	18.5 18.5	0	0	0	0	IN-02407 IN-02639	14.9 13.8	0	0	0	0
5	1021 Nevada Ave	INT2	IN-01119	14.4	0	0	0	0	IN-01417	13.8	0	0	0	0	IN-02427	14.9	0	0	0	0
6	1022 Utah Ave	INT1	IN-01443	12.6	0	0	0	0	IN-02081	18.5	0	0	0	0	IN-02597	18.5	0	0	0	0
7	1037 California Ave 104 Granite Ave	INT3 INT2	IN-01105 IN-01381	6.3 19.2	0	0	0	0	IN-01777 IN-02150	19.9 13.8	0	0	0	0	IN-02445 IN-02677	19.9 13.8	0	0	0	0
9	1047 Sheldon Flats Rd	INT1	IN-01313	19.2	0	0	0	0	IN-02130	13.8	0	0	0	0	IN-02677	18.5	0	0	0	0
10	105 W. Oak St	INT1	IN-01305	20.0	0	0	0	0	IN-01994	18.5	0	0	0	0	IN-02783	20.0	0	0	0	0
11	106 Voves Ave	INT3	IN-01723	7.9	0	0	0	0	IN-02278	13.8	0	0	0	0	IN-02799	17.5	0	0	0	0
12	1106 Nevada Ave 1118 Montana Ave	INT4 INT3	IN-01409 IN-01675	17.3 18.5	0	0	0	0	IN-02059 IN-02269	13.8 13.8	0	0	0	0	IN-02887 IN-02818	17.5 20.0	0	0	0	0
14	112 W. Cedar St	INT2	IN-01434	12.6	0	0	0	0	IN-01977	13.8	0	0	0	0	IN-02736	18.5	0	0	0	0
15	118 White Ave	INT2	IN-01633	19.2	2	1	38.4	19.2	IN-02155	18.5	0	0	0	0	IN-02746	13.8	0	0	0	0
16	120 Forest Ave 120 Manor Dr	INT2	IN-01141 IN-01785	12.6 19.9	0	0	0	0	IN-01731	14.9 13.8	0	0	0	0	IN-02216	14.9 17.5	0	0	0	0
18	1203 Louisiana Ave	INT4	IN-01785	6.3	0	0	0	0	IN-02322 IN-01953	18.5	0	0	0	0	IN-02948 IN-02788	20.0	0	0	0	0
19	125 Spencer Hill Way	INT4	IN-01683	19.2	0	0	0	0	IN-02314	18.5	0	0	0	0	IN-02913	17.5	0	0	0	0
20	1302 Airth Ave	INT3	IN-01071	6.3	0	0	0	0	IN-01703	19.8	0	0	0	0	IN-02200	14.9	0	0	0	0
21	1313 Renwood Dr	INT2	IN-01113	6.3 14.4	0	0	0	0	IN-01760	13.8 18.5	0	0	0	0	IN-02434	14.9	0	0	0	0
22	1314 Dakota Ave 133 Spencer Rd	INT4 INT4	IN-01138 IN-01398	12.6	0	0	0	0	IN-01817 IN-02110	13.8	0	0	0	0	IN-02163 IN-02772	14.9 13.8	0	0	0	0
24	1405 Dakota Ave	INT4	IN-01008	6.3	0	0	0	0	IN-01713	6.3	0	0	0	0	IN-02461	14.9	0	0	0	0
25	1414 Main Ave	INT3	IN-01097	19.8	0	0	0	0	IN-01690	19.8	0	0	0	0	IN-02195	14.9	0	0	0	0
26	1464 E. 5th St Ext	INT1	IN-01355	17.3	0	0	10.2	0	IN-02035	13.8	0	0	0	0	IN-02585	18.5	0	0	0	0
27	15 Avenue B 1525 Lolo Ave	INT4 INT3	IN-01525 IN-01165	19.2 19.2	1 0	0	19.2	0	IN-02125 IN-01908	13.8 13.8	0	0	0	0	IN-02871 IN-02554	13.8 18.5	0	0	0	0
29	156 S. Central Rd	INT3	IN-01326	19.2	0	0	0	0	IN-02261	13.8	0	0	0	0	IN-02354	20.0	0	0	0	0
30	1573 Kootenai River Rd	INT4	IN-01769	14.9	0	0	0	0	IN-02242	13.8	0	0	0	0	IN-02906	17.5	0	0	0	0
31	1621 Main Ave	INT3	IN-01661	13.8	0	0	0	0	IN-02250	13.8	0	0	0	0	IN-02813	17.5	0	0	0	0
32	1711 Airstrip Rd 188 Terrace View Rd	INT2 INT1	IN-01488 IN-01582	15.7 19.8	0	0	15.7	15.7	IN-01961 IN-02388	20.1 19.9	0	0	0	0	IN-02672 IN-02866	13.8 13.8	0	0	0	0
34	191 Farm to Market Rd	INT3	IN-01243	12.6	0	0	0	0	IN-01839	18.5	0	0	0	0	IN-02530	13.8	0	0	0	0
35	1915 Kootenai River Rd	INT2	IN-01086	19.2	0	0	0	0	IN-01755	14.9	0	0	0	0	IN-02482	13.8	0	0	0	0
36	21 Voves Ave	INT4	IN-01041	6.3	0	0	0	0	IN-01739	14.9	0	0	0	0	IN-02178	19.9	0	0	0	0
37 38	226 Spencer Rd 2293 Kootenai River Rd	INT4 INT3	IN-01193 IN-01282	19.2 12.6	0	0	0	0	IN-01588 IN-01916	19.2	0	0	0	0	IN-02168 IN-02589	14.9 18.5	0	0	0	0
39	2297 Kootenai River Rd	INT4	IN-01267	19.8	0	0	0	0	IN-01847	13.8	0	0	0	0	IN-02617	18.5	0	0	0	0
40	2375 Kootenai River Rd	INT2	IN-01216	17.3	0	0	0	0	IN-01969	13.8	0	0	0	0	IN-02655	13.8	0	0	0	0
41	25 Evans Rd	INT1	IN-01236	12.6	1	0	12.6	0	IN-01931	13.8	0	0	0	0	IN-02731	18.5	0	0	0	0
42	255 Lodgepole Way 269 N. Central Rd	INT1 INT2	IN-01337 IN-01226	19.8 14.4	0	0	0	0	IN-02067 IN-01762	13.8 14.9	0	0	0	0	IN-02767 IN-02357	13.8 13.8	0	0	0	0
44	281 S. Central Rd	INT3	IN-01513	19.8	0	0	0	0	IN-02133	18.5	0	0	0	0	IN-02938	17.5	0	0	0	0
45	292 Spencer Rd	INT4	IN-01059	6.3	0	0	0	0	IN-01597	19.8	4	0	79.1	0	IN-02466	19.9	0	0	0	0
46	304 Spencer Rd	INT3	IN-01208	19.2 19.8	0	0	0	0	IN-01855	13.8 13.8	0	0	0	0	IN-02661	18.5	0	0	0	0
47	310 W. Flower St 32 Shalom Kerry	INT2 INT1	IN-01425 IN-01184	6.3	0	0	0	0	IN-02118 IN-01799	19.9	0	0	0	0	IN-02724 IN-02422	13.8 14.9	0	0	0	0
49	323 E. Cedar St	INT1	IN-01450	6.3	1	0	6.3	0	IN-02051	13.8	0	0	0	0	IN-02708	13.8	0	0	0	0
50	337 Commerce Way	INT1	IN-01666	18.5	0	0	0	0	IN-02259	13.8	0	0	0	0	IN-02806	17.5	0	0	0	0
51	3518 Highway 2 S	INT2	IN-01390	6.3	0	0	0	0	IN-02333	18.5	0	0	0	0	IN-02829	17.5	0	0	0	0
52 53	3576 Highway 2 S 3796 Highway 2 S	INT1 INT4	IN-01537 IN-01275	6.3 19.8	0	0	0	0	IN-02226 IN-02011	13.8 13.8	0	0	0	0	IN-02750 IN-02602	18.5 18.5	0	0	0	0
54	3798 Highway 2 S	INT3	IN-01318	19.2	1	0	19.2	0	IN-01944	18.5	0	0	0	0	IN-02713	18.5	0	0	0	0
55	38 Spencer Hill Way	INT4	IN-01198	19.2	0	0	0	0	IN-01889	18.5	0	0	0	0	IN-02579	18.5	0	0	0	0
56 57	397 Sheldon Ln 4304 Highway 37 N	INT2 INT3	IN-00998 IN-01474	19.2 6.3	0	0	0	0	IN-01873 IN-02089	18.5 13.8	0	0	0	0	IN-02529 IN-02695	13.8 18.5	0	0	0	0
58	460 Woodland Heights Rd	INT1	IN-01474	17.3	0	0	0	0	IN-02069	13.8	0	0	0	0	IN-02695	13.8	0	0	0	0
59	487 Kootenai Dr	INT2	IN-01364	17.3	0	0	0	0	IN-02019	18.5	0	0	0	0	IN-02514	18.5	0	0	0	0
60	515 Minnesota Ave	INT3	IN-01637	19.2	0	0	0	0	IN-02234	13.8	0	0	0	0	IN-02837	20.0	0	0	0	0
61 62	546 Granite Ave 56 Enders Dr	INT4 INT3	IN-01645 IN-01298	6.3 19.2	0	0	0	0	IN-02306 IN-02003	13.8 13.8	0	0	0	0	IN-02901 IN-02493	17.5 18.5	0	0	0	0
63	5862 Highway 2 S	INT1	IN-01296	19.2	0	0	0	0	IN-02003	18.5	0	0	0	0	IN-02493	19.9	0	0	0	0
64	5865 Highway 2 S	INT1	IN-00938	6.3	0	0	0	0	IN-01885	18.5	0	0	0	0	IN-02644	18.5	0	0	0	0
65	600 Granite Ave	INT1	IN-01173	6.3	0	0	0	0	IN-01900	13.8	0	0	0	0	IN-02623	13.8	0	0	0	0
66 67	610 Granite Ave 628 Avenue B	INT1 INT2	IN-00990	19.2	0	0	0	0	IN-01792	19.9	0	0	0	0	IN-02477	13.8	0	0	0	0
68	660 Reserve Rd	INT2	IN-01286	19.2	0	0	0	0	IN-01924	18.5	0	0	0	0	IN-02565	18.5	0	0	0	0
69	6797 Farm to Market Rd	INT1	IN-01016	19.2	ő	0	0	0	IN-01747	14.9	0	0	0	0	IN-02303	14.9	0	0	0	0
70	700 Farm to Market Rd	INT2	IN-01506	6.3	0	0	0	0	IN-02097	18.5	0	0	0	0	IN-02754	18.5	0	0	0	0
71	71 Claire Ave	INT4	IN-01152	19.2	0	0	0	0	IN-01617	5.0	0	0	0	0	IN-02401	14.9	0	0	0	0
72 73	76 Pine St 781 Terrace View Rd	INT3 INT4	IN-01653 IN-01401	6.3 17.3	0	0	0	0	IN-02075 IN-02043	13.8 13.8	0	0	0	0	IN-02690 IN-02509	13.8 18.5	0	0	0	0
74	813 Wisconsin Ave	INT4	IN-01257	19.2	0	0	0	0	IN-01831	13.8	0	0	0	0	IN-02549	13.8	0	0	0	0
75	817 W. Balsam St	INT3	IN-01251	19.2	0	0	0	0	IN-01607	6.3	0	0	٥	0	IN-02498	18.5	0	0	0	0
76	87 Yellowtail Rd	INT4	IN-01564	19.8	0	0	0	0	IN-02372	13.8	0	0	0	0	IN-02929	17.5	0	0	0	0
77 78	893 Greers Ferry Rd 912 California Ave	INT3 INT2	IN-01548 IN-01458	27.7 6.3	0	1 0	27.7 0	27.7	IN-02342 IN-02105	19.9 18.5	0	0	0	0	IN-02981 IN-02634	17.5 13.8	0	0	0	0
79	985 Farm to Market Rd	INT1	IN-01686	19.2	0	0	0	0	IN-02380	13.8	0	0	0	0	IN-02854	17.5	0	0	0	0
80	99 Vanderwood Rd	INT2	IN-01479	19.2	1	0	19.2	0	IN-02281	19.8	0	0	0	0	IN-02843	20.0	0	0	0	0
81	998 Terrace View Rd	INT1	IN-01533	12.6	0	0	0	0	IN-02361	13.8	0	0	0	0	IN-02956	19.4	0	0	0	0

not collected

Table 5-4. Outdoor Soil Data at Indoor ABS Properties

BS Area	Address	PLM-VF	PLM-VE Visible Vermiculite			Detect.	Visible	PLM-VE	SUA 30-point Soil Visible Vermiculite				Detect.	Visible	
	Autioss	LA Bin	N	PIDIE V	M	H	Pred.	Score	LA Bin	N	SIDIE VI	M	H	Freq.	Score
1	10 Park St	ND	30	0	0	0	0.00	0.00	ND	30	0	0	0	0.00	0.00
	101 Woodland Rd	ND .	27	- 3 -	0	- 5	0.10	0.10	ND	25	6	0	0	0.19	0.19
3		<del></del>	22	4	4	0	0.10		ND	29					
	1016 Nevada Ave							0.53						0.03	0.03
4	1020 California Ave	ND	30	_0_	0_	0	0.00	0.00	ND	29		0	0	0.03	0.03
5	1021 Nevada Ave	ND.	30	0	0	_0_	0.00	- 0.00	ND ND	26	4	0	0	0.13	0.13
6	1022 Utah Ave	ND -	30	0	. <u>0</u> .	0	0.00	0.00	ND _	29	1_	0	_ 0	0.03	0.03
	1037 California Ave	ND	30	0	0	0	0.00	0.00	ND .	30_	0	_0	C.	0.00	0.00
_8	104 Granite Ave	ND	27	_3_	0	0	0.10	0.10	ND	22	. 8	0	. 0_	0.27	0.27
9	1047 Sheldon Flats Rd	ND	30	0	_ 0	0	0.00	0.00	ND	29	_1 :	_0_	0	0.03	0.03
_10	105 W. Oak St	ND	30	0	0	0	0.00	0.00	ND ND	30	0_	0	0	0.00	0.00
11	106 Voves Ave	ND	_30	0	0	0	0.00	0.00	<u>ND</u>	_30	0	_0	0	0.00	0.00
_12	1106 Nevada Ave	ND	30	0	0	0	0.00	0.00	ND	27	_ 1	2	0	0.10	0.23
13	1118 Montana Ave	ND_	30	0	0	0	0.00	0.00	Tr	30	0	00	0	0.00	0.00
14	112 W. Cedar St	ND_	19	7	4	0	0.37	0.63	ND	9	15	6	0	0.70	1.10
15	118 White Ave	ND	13	12	5	0	0.57	0.90	Tr	15	11	4	0	0.50	0.77
16	120 Forest Ave	ND	30	0	0	0	0.00	0.00	ND	30	0	0	Ô	0.00	0.00
17	120 Manor Dr	ND	28	1	1	0	0.07	0.13	ND	30	0	0	0	0.00	0.00
18	1203 Louisiana Ave	ND	27	3	Ō	0	0.10	0.10	ND	28	2	0	0	0.07	0.07
19	125 Spencer Hill Way	ND	15	15	0	0	0.50	0.50	ND	21	9	0	0	0.30	0.30
20	1302 Airth Ave	ND	30	0	0	0	0.00	0.00	ND	30	0	0	0	0.00	0.00
21	1313 Renwood Dr	ND	30	0	ō	0	0.00	0.00	ND	29	1	0	0	0.03	0.03
22	1314 Dakota Ave	ND	31	0	-ŏ-	0	0.00	0.00	ND	27	3	<u> </u>	- <del>ö</del> -	0.10	0.10
23	133 Spencer Rd	ND ND	29	1	0	0	0.03	0.03	ND	25	5	0	10	0.17	0.17
24	1405 Dakota Ave	ND	30		0	0	0.00	0.00	ND -	30	0	0	0	0.00	0.00
25	1414 Main Ave	ND	30	0	0	0	0.00	0.00	ND	30	0	0	0	0.00	0.00
26	1464 E. 5th St Ext	ND ND	30	0	0	<del> </del>	0.00	0.00	ND ND	30	0	0		0.00	0.00
27	15 Avenue B	Tr	27	2	1	0	0.10	0.00	Tr	28		0	0	0.00	0.00
	<del></del>	ND	30	0	0	0	0.00	0.17	ND ND	30	0	0	0		
28	1525 Lolo Ave 156 S. Central Rd	ND ND	30	0	0	- 0			ND	30	0			0.00	0.00
29							0.00	0.00					0	0.00	0.00
30	1573 Kootenai River Rd	ND_	24	_6_	0	0	0.20	0.20	ND_	26	4_	0_	_0_	0.13	0.13
31	1621 Main Ave	ND	30	0	0	0_	0.00	0.00	ND	30	0	0	0	0.00	0.00
32	1711 Airstrip Rd	ND	30	_0_	0	0	0.00	0.00	ND	30	0	0_	0	0.00	0.00
33	188 Terrace View Rd	ND	30	0	0_	0	0.00	0.00	ND	_30_	0_	0_	0_	0.00	0.00
34	191 Farm to Market Rd	ND	30	0	0_	0	0.00	0.00	ND.	30	0_	_0_	0	0.00	0.00
35	1915 Kootenai River Rd	_ ND	30	0	0	0	0.00	0.00	ND_	30	0	0	0	0.00	0.00
36	21 Voves Ave	ND	28	1	1	_0	0.07	0.13	ND	30	0	0_	0	0.00	0.00
37	226 Spencer Rd	ND	23	7	0	0	0.23	0.23	ND	30	0	0	0	0.00	0.00
38	2293 Kootenai River Rd	ND	28	2	0	0	0.07	0.07	ND	30	0	0	0	0.00	0.00
39	2297 Kootenai River Rd	ND	25	5	0	0	0.17	0.17	ND	28	2	0	0	0.07	0.07
40	2375 Kootenai River Rd	ND	30	0	0	0	0.00	0.00	ND	28	2	0	0	0.07	0.07
41	25 Evans Rd	ND	30	0	0	0	0.00	0.00	ND	30	0	0	0	0.00	0.00
42	255 Lodgepole Way	ND	30	ō	0	0	0.00	0.00	ND	30	0	0	0	0.00	0.00
43	269 N. Central Rd	ND	30	0	0	0	0.00	0.00	Tr	30	0	0	0	0.00	0.00
44	281 S. Central Rd	ND	30	0	0	0	0.00	0.00	ND	27	3	0	0	0.10	0.10
45	292 Spencer Rd	ND	30	ō	Ō	0	0.00	0.00	ND	30	0	10	10	0.00	0.00
46	304 Spencer Rd	ND	29	1	0	ō	0.03	0.03	ND	30	0	0	1- <del>0</del>	0.00	0.00
47	310 W. Flower St	ND	29	1	-	Ô	0.03	0.03	ND	25	5	ō	ō	0.17	0.17
48	32 Shalom Kerry	ND	30	0	<u> </u>	0	0.00	0.00	ND	30	0	0	0	0.00	0.00
49	323 E. Cedar St	ND	29	1	0	0	0.03	0.03	ND	30	0	ő	- <del>ŏ</del> -	0.00	0.00
50	337 Commerce Way	ND	30	0	1-0	0	0.00	0.00	ND	30	ö	-	1 5	0.00	0.00
	<del></del>		1		<del></del>				1		1	1			
51	3518 Highway 2 S	- ND ND	<u>19</u>	1	0	0	0.37	0.57	ND.	28	2	0	0	0.07	0.07
52	3576 Highway 2 S 3796 Highway 2 S	ND ND		0			0.03			28	2		•		
53			30		0	0	0.00	0.00	ND ND	28		0	0	0.07	0.07
54	3798 Highway 2 S	ND ND	30	0	0	0_	0.00	0.00	ND ND	30	0	0	0_	0.00	0.00
55	38 Spencer Hill Way	ND ND	29	1_0	0	0	0.03	0.03	ND	29	1	0	0	0.03	0.03
56	397 Sheldon Ln	ND ND	30	0	0	0	0.00	0.00	ND ND	25	5	0	0	0.17	0.17
57	4304 Highway 37 N	ND ND	29	1	0	0	0.03	0.03	ND ND	30	0	00_	0	0.00	0.00
58	460 Woodland Heights Rd	ND ND	30	0	0_	0	0.00	0.00	ND ND	30	0	0	0	0.00	0.00
59	487 Kootenai Dr	ND	29	1_1_	0	0_	0.03	0.03	ND	30	0	0	0	0.00	0.00
60	515 Minnesota Ave	ND ND	30	0	0	0	0.00	0.00	ND ND	30	0	0	0	0.00	0.00
61	546 Granite Ave	ND	25	5	0	0	0.17	0.17	ND	22	8	0	0	0.27	0.27
62	56 Enders Dr	ND	30	0_	0_	0	0.00	0.00	ND	29	1_1_	0_	0	0.03	0.03
63	5862 Highway 2 S	ND	30	0	0	0	0.00	0.00	ND	32	0	0	_0_	0.00	0.00
64	5865 Highway 2 S	ND	30	0	0	0	0.00	0.00	ND	30	0	0	0_	0.00	0.00
65	600 Granite Ave	ND_	_29_	1_1_	0	0	0.03	0.03	ND	30	0	0	0	0.00	0.00
66	610 Granite Ave	ND	30	0	0	0	0.00	0.00	ND	30_	3	0	0	0.09	0.09
67	628 Avenue B	Tr	28	2	0	0	0.07	0.07	ND	29	1	0	0	0.03	0.03
68	660 Reserve Rd	ND	27	3	0	0	0.10	0.10	ND	30	0	0	0	0.00	0.00
69	6797 Farm to Market Rd	ND	30	0	0	Ō	0.00	0.00	ND	30	0	0	0	0.00	0.00
70	700 Farm to Market Rd	ND	30	0	0	Ō	0.00	0.00	ND	24	6	0	ō	0.20	0.20
71	71 Claire Ave	ND	30	0	0	0	0.00	0.00	Tr	30	7	Ô	Ö	0.19	0.19
72	76 Pine St	ND	30	ō	- <del>ŏ</del>	0	0.00	0.00	ND	30	Ö	0	Ö	0.00	0.00
73	781 Terrace View Rd	ND	28	1	0	1	0.07	0.37	ND	29	1	10	10	0.03	0.03
74	813 Wisconsin Ave	ND	30		0	0	0.00	0.00	ND	28	2	0	0	0.07	0.07
	817 W. Balsam St	ND	30	0	-	0	0.00	0.00	ND	30	0	0	0	•	
75					·		•						+	0.00	0.00
76	87 Yellowtail Rd	ND ND	30	0	-0	0	0.00	0.00	ND ND	28	2	0	0	0.07	0.07
77	893 Greers Ferry Rd	ND	30	0	0	0	0.00	0.00	ND_	30	0_	0	0	0.00	0.00
78	912 California Ave	ND _	30	0	0	0	0.00	0.00	Tr	27	3	0_	0	0.10	0.10
		ND	30	0	10	0	0.00	0.00	ND	30	0	0	10	0.00	0.00
79 80	985 Farm to Market Rd 99 Vanderwood Rd	ND	30	Ō	Ō	0	0.00	0.00	ND	26	4	Ö	10	0.13	0.13

# Table 5-5 Multivariate Regression Analysis Results for Indoor ABS Air During Active Disturbance Scenario

Soil Metric	Best Fit	t Model Para	ameters	% Contribution to Mean Indoo Air Concentration				
	b ₀	b ₁	b ₂	NSUA soil	SUA soil	Other sources		
Visible detection frequency	0.00023	0.00041	0.0011	6%	21%	73%		
Visible score	0.00022	0.000050	0.000031	16%	10%	74%		

NSUA = non-specific use area SUA = specific use area

Table 6-1
Screening-Level Risk Calculations for Outdoor Exposure to ABS Air

Soil			EPC ^a	Ri	sk
Metric	<u>Approach</u>	Value	(PCME s/cc)	CTE	RME
		PLM Bin A	0.094	7E-05	7E-04
	3 Bins	PLM Bin B1	0.042	3E-05	3E-04
		PLM Bin B2/C	0.59	5E-04	4E-03
PLM-VE		Clean fill	0.0094	7E-06	7E-05
	5 Bins	PLM Bin A, Vis -	0.014	1E-05	1E-04
		PLM Bin A, Vis +	0.25	2E-04	2E-03
		PLM Bin B1	0.043	3E-05	3E-04
		PLM Bin B2/C	0.59	5E-04	4E-03
		VisDF = 0	0.013	1E-05	1E-04
	Detection Frequency (bins)	VisDF > 0 - 0.1	0.023	2E-05	2E-04
		VisDF > 0.1 - 0.5	0.18	1E-04	1E-03
	<u></u>	VisDF > 0.5	0.36	3E-04	3E-03
		VisScore = 0	0.013	1E-05	1E-04
	Score	VisScore > 0 - 0.1	0.026	2E-05	2E-04
	(bins)	VisScore > 0.1 - 0.5	0.24	2E-04	2E-03
Visible		VisScore > 0.5	0.26	2E-04	2E-03
Inspection		VisDF = 0	0.0089	7E-06	6E-05
	Detection Frequency	VisDF = 0.05	0.023	2E-05	2E-04
	(fitted eqn)b	VisDF = 0.1	0.04	3E-05	3E-04
		VisDF = 0.5	0.15	1E-04	1E-03_
		VisScore = 0	0.0093	7E-06	7E-05
	Score	VisScore = 0.05	0.020	2E-05	1E-04
	(fitted eqn) ^c	VisScore = 0.1	0.031	2E-05	2E-04
	<u> </u>	VisScore = 0.5	0.12	9E-05	8E-04

^a Exposure point concentration based on the average PCME LA concentration (s/cc) for all rounds for all ABS scenarios unless otherwise specified in the approach as being a fitted equation.

^b The detection frequency model parameters based on MLE fitting to PCME data are: a= 0.0089, b = 0.2764 (see Attachment 1).

^c The visible score model parameters based on MLE fitting to PCME data are: a= 0.0093, b = 0.2118 (see Attachment 1).

Table 6-2. Screening-Level Risk Calculations for Indoor Exposure to ABS Air

				Active			Passive		Com	oined
Soil			EPCa		sk	EPC ^a		sk		sk
Metric	Approach	Bin	(PCME s/cc)	CTE	RME	(PCME s/cc)	CTE	RME	CTE	RME
PLM-VE	2 PLM Bins	ND	0.00027	3E-06	1E-05	0.000030	3E-06	5E-06	6E-06	2E-05
	(NSUA_SUA) ^b	Not ND	0.00063	6E-06	3E-05	0.00038	4E-05	6E-05	5E-05	9E-05
		Bin 1_Bin 1	0.00022	2E-06	1E-05	0.000035	4E-06	5E-06	6E-06	1E-05
		Bin 1_Bin 2	0.00039	4E-06	2E-05	0.000021	2E-06	3E-06	6E-06	2E-05
		Bin 1_Bin 3	0.00014	1E-06	6E-06	0.000028	3E-06	4E-06	4E-06	1E-05
	9 Detection	Bin 2_Bin 1	0.00023	2E-06	1E-05	0.000016	2E-06	2E-06	4E-06	1E-05
	Frequency Bins	Bin 2_Bin 2	0.00033	3E-06	1E-05	0.000050	5E-06	8E-06	8E-06	2E-05
	(NSUA_SUA)°	Bin 2_Bin 3	0.00046	4E-06	2E-05	0.000025	3E-06	4E-06	7E-06	2E-05
		Bin 3_Bin 1	0.0012	1E-05	5E-05	0	0E+00	0E+00	1E-05	5E-05
		Bin 3_Bin 2	0.000066	6E-07	3E-06	0.000016	2E-06	2E-06	2E-06	5E-06
Visible		Bin 3_Bin 3	0.00071	7E-06	3E-05	0.00054	6E-05	8E-05	6E-05	1E-04
Inspection		Bin 1_Bin 1	0.00022	2E-06	1E-05	0.000035	4E-06	5E-06	6E-06	1E-05
		Bin 1_Bin 2	0.00017	2E-06	8E-06	0.000015	2E-06	2E-06	3E-06	1E-05
		Bin 1_Bin 3	0.00066	6E-06	3E-05	0.000040	4E-06	6E-06	1E-05	3E-05
	9 Visible Score	Bin 2_Bin 1	0.00029	3E-06	1E-05	0.000021	2E-06	3E-06	5E-06	2E-05
	Bins	Bin 2_Bin 2	0.00021	2E-06	9E-06	0.000067	7E-06	1E-05	9E-06	2E-05
	(NSUA_SUA) ^c	Bin 2_Bin 3	0.00046	4E-06	2E-05	0.00002	3E-06	4E-06	7E-06	2E-05
		Bin 3_Bin 1	0.00040	4E-06	2E-05	0	0E+00	0E+00	4E-06	2E-05
		Bin 3_Bin 2	0.00024	2E-06	1E-05	0.000020	2E-06	3E-06	4E-06	1E-05
		Bin 3_Bin 3	0.00071	7E-06	3E-05	0.00054	6E-05	8E-05	6E-05	1E-04

^a Exposure point concentration based on the average PCME LA concentration (s/cc) for all rounds.

ABS Risk Calcs v8.xls; Results_Indoor

^b Where-- ND: both SUA and NSUA soils were non-detect, Not ND: SUA and/or NSUA soil was detect

^c Where-- Bin 1: =0, Bin 2: >0 - 0.1, Bin 3: >0.1.

Table 6-3
LA Structure Types Observed in Outdoor ABS Air Samples

Structure Type	Dir	ect	Indi	rect	Indirect	- Ashed
F	288	57%	47	72%	2357	56%
MF	181	36%	13	20%	1119	26%
CF	4	1%	0	0%	3	0%
В	15	3%	4	6%	548	13%
MB	12	2%	1	2%	204	5%
СВ	3	1%	0	0%	0	0%
Total	503		65		4231	

F = single fiber

MF = fiber protruding from matrix

CF = fiber within a cluster

B = bundle

MB = bundle protruding from matrix

CB = bundle within a cluster

Table 7-1. Impact Assessment for Field and Laboratory Modifications


Туре	Number	Effective Date	Description	Impact on Data Evaluation		
SAP Mods	Outdoor ABS SAP Mod 1	8/15/2007	The sample collection procedures for outdoor ABS personal air samples are to be modified to include monitoring the filter condition. If discoloration of the filter is observed, the activity should be stopped immediately and sampling of the next planned activity initiated. These samples will have lower volumes and will require analysis of more grid openings to achieve the target sensitivity.  For outdoor ABS air samples requiring indirect preparation, the TEM analysis stopping rules are as follows: Continue analysis until one of the following conditions is met  1) the target sensitivity (0.001 cc ⁻¹ ) is achieved  2) 100 grid openings (GOs) have been examined  3) 50 LA structures have been recorded	If target sensitivity is achieved or if 50 LA structures are recorded, then there is no impact on data quality. If counting is stopped at 100 GOs and structure count is low (e.g., <10), then there will be increased uncertainty in the estimates of concentration. However, there is no introduction of bias. Also see Note [A]		
	LFO-000113	7/9/2007	The portable meteorological stations used to document weather conditions at each site record data at 60- second intervals, instead of 30-second intervals as prescribed in the SAP.	None.		
	LFO-000114	7/18/2007	The low volume sampling pumps for outdoor air samples were unable to collect samples at the prescribed flow rate of 3.5 L/min. The flow rate was lowered to a target flow of 3.0 L/min to ensure samples were collected over the required sampling period. Additional grid openings would have to be analyzed to achieve the target sensitivity.	None.		
	LFO-000115	7/18/2007	The low volume sampling pumps for indoor air samples were unable to collect samples at the prescribed flow rate of 3.5 L/min. The flow rate was lowered to a target flow of 3.0 L/min to ensure samples were collected over the required sampling period. Additional grid openings would have to be analyzed to achieve the target sensitivity.	None.		
	LFO-000116	7/27/2007	One dust sample will be collected at each house instead of one per living floor.	None.		
	LFO-000117	9/21/2007	If indoor activities are conducted over a two-day period, those days may be split over a weekend to accommodate homeowner schedule.	None.		
		4/21/2008	The procedure detailed in Outdoor ABS SAP Mod 1, implemented 8/16/07 through 8/24/07, will no longer be used. Instead, air sampling will continue, regardless of inorganic particulate loading on filters, until observed flow rates drop below allowable limits or until the required time interval of 2 hours has elapsed.	May increase the need for indirect preparation; see Note [A].		
Field		7/24/2007	ABS SOP does not provide specific guidance to account for time when the mower is not being operated during the two-hour mowing scenario. To clarify for the field teams, the time spent walking to and from the scenario area and time spent refueling the mower should be included in the total 120-minute sampling period.	None.		
Mods	LFO-000128	4/21/2008	In order to characterize the vermiculite and LA content of each child's play location, one composite point will be collected from each of the two child's play locations and combined into a 2-point composite soil sample. These soil samples will help correlate the concentrations of LA observed in the child's play air samples to the larger ABS scenario area sampled as part of the raking and mowing activities.	None.		
		4/21/2008	The current project guidance stipulates that soil sampling equipment will be covered with aluminum foil after being decontaminated. This modification will allow for field teams to place the decontaminated equipment in clear poly bags to protect the equipment during transport.	None.		
		4/21/2008	For the 2008 outdoor ABS sampling event, ABS sampling will not occur if standing water is observed in the scenario area or if rain is observed during sampling. Soil moisture deficiency will be estimated as prescribed, but a lower limit for soil moisture deficiency will not be set for the spring 2008 event.	None.		
		4/21/2008	Photographs of scenario areas will be collected before and after ABS scenarios take place to determine if vegetation and ground cover are significantly altered as a result of the sampling activities.	None.		
		4/21/2008	GPS points will be collected to document the locations of the DataRAM, MET station, and both child's play scenario areas.	None.		
	LFO-000129	7/9/2007	Personal air samples that are collected as part of ongoing health and safety monitoring (for PCM analysis) do not require the same target analytical sensitivity as the ABS samples collected for TEM analysis. Instead, these samples should be collected and analyzed in accordance with the Response Action Sampling and Analysis Plan, Revision 1 (04/09/08).	None.		


Table 7-1. Impact Assessment for Field and Laboratory Modifications

Туре	Number	Effective Date	Description	Impact on Data Evaluation
		7/24/2007	Personnel exchanges coincide with regularly scheduled flow checks and it is not possible to accomplish both tasks within 60 seconds as prescribed in SAP. Mod changes the total time for both actions to be completed to 120 seconds. If it is anticipated that both actions can not be completed within this time frame, the pump and event clocks will be stopped until the activity is re-initiated.	None.
		7/24/2007	Because air flow through the high volume air sampling pumps steadily decreases as the battery looses power, and the high volume pumps are not able to be recalibrated once sample collection begins, more than one high volume pump may need to be used to complete the activity sampling. High volume pumps may be replaced and sampling continued on the same filter cassette any time a pump faults, if flow rates drop below 30% of the originally targeted flow rate, or at the half-way point through the sampling period.	None.
Field Mods (cont.)	LFO-000130	7/9/2007	Instead of shipping both the high volume and low volume air samples to the laboratories after collection, the low volume samples are archived at the CDM project office under COC. The samples will be stored indefinitely until other storage facilities are identified or the samples are requested to be analyzed.	None.
	7/9/2007		In addition to the guidance provided in the SWQAPP, the sampling programs should also reference the Project-specific Guidance for Completion of Field Sample Data Sheets (CDM-Libby-03, Revision 3).	None.
		7/9/2007	The header information will no longer require building information number of the structure on the property. The author will no longer be required to print their name after their signature on the final page.	None.
		7/9/2007	It is no longer necessary to maintain a photographic log in the field logbook. Instead, captions will be entered electronically on the digital photograph as necessary to describe the contents of the photograph.	None.
	LFO-000131	7/9/2007	To more closely model the dust sampling protocols implemented in Troy, MT (OU7), field duplicates will be collected for dust samples at the frequency of 5%.	None.
	LB-000016	4/23/2003	Clarify ISO 10312 counting rules.	None.
	LB-000019	1/21/2003	Standardize the recording format of grid openings where no countable structures are seen ("ND").	None.
	LB-000028	6/17/2003	Standardize the selection of additional grids for reanalysis of TEM samples.	None.
	LB-000029	4/25/2007	Standardize the frequency of preparation of laboratory QC samples by TEM and provide procedures for interpretation of results.	None.
	LB-000030	8/14/2003	Standardize procedure used for recording sketches of asbestos structures.	None.
	LB-000053	12/12/2006	Summarize which samples are considered "investigative" and "non-investigative" (based on the Index ID prefix code). For air, all "investigative" samples shall require ashing as part of indirect preparation procedures. For dust, ashing will be incorporated opportunistically as part of the indirect preparation procedures as determined necessary by the analyst.	Ashing is expected to incease accuracy by eliminating organic debris and making it easier to detect and characterize LA structures. However, see Note [A].
	LB-000066	2/28/2007	Require all laboratories to provide information on the elemental composition of particles classified as LA, with the primary focus on sodium (Na) and potassium (K).	None.
Lab Mods	LB-000070	10/1/2007	Enumeration of chrysotile structures will terminate with the completion of the grid opening containing the 50th chrysotile structure.	None.
IMOGS	LB-000072	12/7/2007	Prior to implementation of this modification, trace "Tr" amounts of LA observed in the PLM-Grav analysis within the coarse fraction were too small to segregate and weigh would not be captured in the database. The data itself is recorded on the laboratory benchsheets.	None (information is captured on the benchsheets).
	LB-000073	11/20/2007	Establishes a standardized interlaboratory program for PLM-VE analyses across all Libby laboratories; also ensures that all results are evaluated in accord with a standard set of criteria.	None.
	LB-000077	10/30/2007	ABS Field Blanks - 30 grid opening stopping rule for all air and dust samples	None.
	LB-000078	8/16/2007	ABS (exterior) samples - overall to have 100 grid opening stopping rule	If 50 LA structures are recorded, then there is no impact on data quality. If counting is stopped at 100 GOs and
	LB-000079	10/24/2007	ABS (interior) samples - overall to have 100 grid opening stopping rule	structure count is low (e.g., <10), then there will be increased uncertainty in the estimates of concentration. However,
	LB-000082	1/22/2008	Analysis of the ten ABS sampleswas terminated at 100 grid openings rather than terminating at the target analytical sensitivity specified in either the ABS SAPs.	there is no introduction of bias.


#### Notes:

[A] For chrysotile, indirect preparation is known to increase structure counts due to dispersion of bundles and clusters. However, for LA, most structures occur as free fibers, and bundles and clusters are not common. Thus, indirect preparation at the Libby site is not believed to be a significant source of bias.

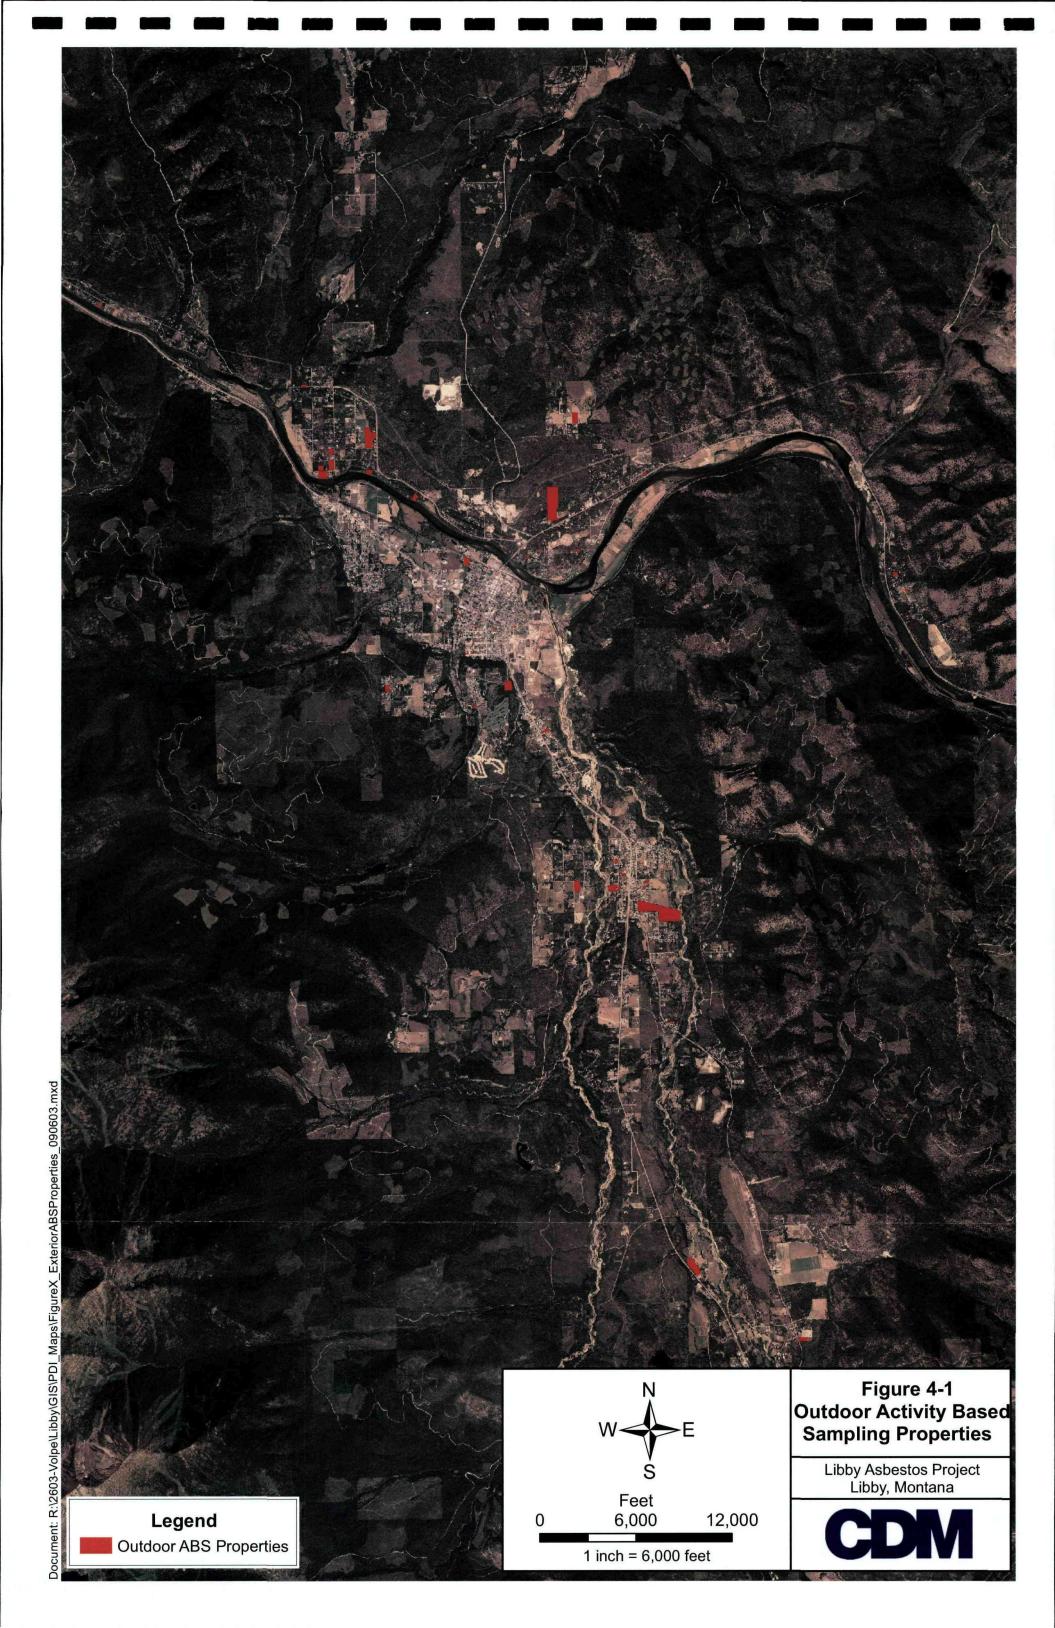

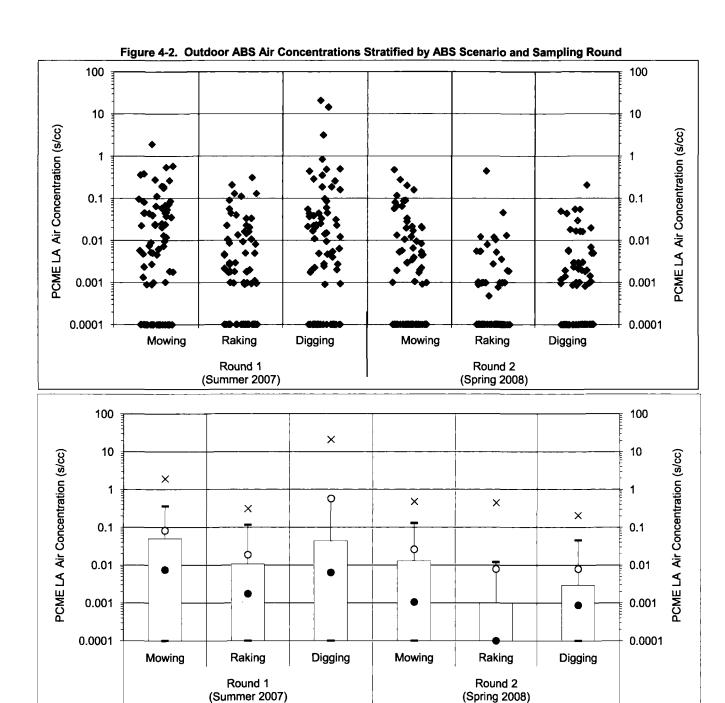


For plotting on a log scale, non-detects are assigned a value of 0.0001 s/cc (the x-axis).

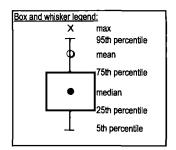


		ABS Air Data												
				Max		Percentile (s/cc)								
Round	Soil Bin	N	DF	(s/cc)	Ave (s/cc)	0.95	0.75	0.5	0.25	0.05				
Round 1	Mowing	75	73%	1.9	0.082	0.36	0.05	0.0075	0	0				
Summer 2007)	Raking	75	61%	0.31	0.019	0.12	0.011	0.0017	0	0				
Summer 2007)	Digging	75	68%	21	0.57	0.6	0.044	0.0064	0	0				
Round 2	Mowing	75	55%	0.48	0.026	0.13	0.013	0.001	0	0				
(Spring 2008)	Raking	75	37%	0.44	0.0079	0.012	0.001	0	0	0				
	Digging	75	53%	0.21	0.0079	0.046	0.003	0.00087	0	0				

Figure 4-3
Between Round Variability in Visible Inspection Data

Panel A: Visible Vermiculite Detection Frequency

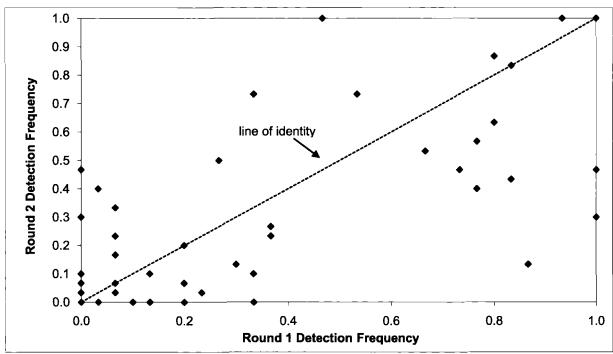

Panel B: Visible Vermiculite Weighted Score

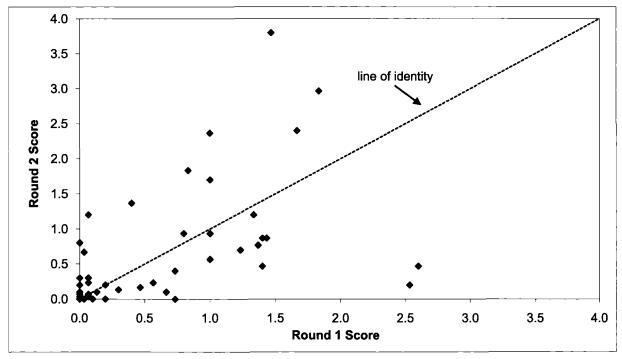


One visible vermiculite weighted score is off-scale (Round 1 = 3.7, Round 2 = 7.5)

Restricted to 30-pt composite samples.

100 100 × X X X 10 10 PCME LA Air Concentration (s/cc) PCME LA Air Concentration (s/cc) × X X X X 0.1 0.1 Ò Q ø Ò 0.01 0.01 0.001 0.001 0.0001 0.0001 В1 **B1** B2/C В1 B2/C Α B2/C Α Α Round 1 Round 2 Round 1 and 2

Figure 4-4. Outdoor ABS Air Concentrations Stratified by PLM-VE Results

For plotting on a log scale, non-detects are assigned a value of 0.0001 s/cc (the x-axis).

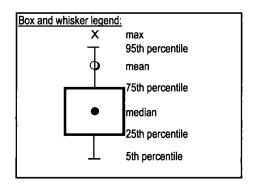


			ABS Air Data										
1						Percentile (s/cc)							
Round	Soil Bin	N _	DF	Max (s/cc)	Mean (s/cc)	0.95	0.75	0.5	0.25	0.05			
	Bin A	168	63%	21	0.17	0.3	0.023	0.0021	0	0			
1	Bin B1	42	81%	0.54	0.065	0.25	0.059	0.016	0.001	0			
	Bin B2/C	15	80%	14	1.2	6.5	0.2	0.04	0.0084	0			
	Bin A	152	41%	0.2	0.0048	0.019	0.0018	0	0	0			
2	Bin B1	55	56%	0.44	0.025	0.1	0.017	0.0021	0	0			
	Bin B2/C	18	83%	0.48	0.057	0.25	0.038	0.0025	0.0011	0			
	Bin A	320	53%	21	0.094	0.11	0.0058	0.00092	0	0			
1 and 2	Bin B1	97	67%	0.54	0.042	0.22	0.029	0.0056	0	0			
	Bin B2/C	33	82%	14	0.59	1.5	0.087	0.014	0.0014	0			

100 100 X Х X X 10 10 PCME LA Air Concentration (s/cc) PCME LA Air Concentration (s/cc) 1 0 X  $\Box$ X X X X X 5 Х X X 0.1 0.1 Ф. Ø. Ó **Q** þ 0.01 0.01 Ò Ò × 0.001 0.001 0 0.0001 0.0001 A (V-) A (V+) B1 A (V-) A (V+) B2/C A (V-) A (V+) B2/C B2/C Round 2 Round 1 and 2 Round 1

Figure 4-5. Outdoor ABS Air Concentrations Stratified by PLM-VE/Visible Vermiculite Ranking

For plotting on a log scale, non-detects are assigned a value of 0.0001 s/cc (the x-axis).

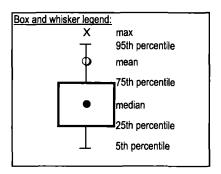

					· -	ABS Air Data	3		•	
		<del>-</del>		T			P	ercentile (s/c	c)	_
Round	Soil Bin	N	DF	Max (s/cc)	Mean (s/cc)	0.95	0.75	0.5	0.25	0.05
	Clean Fill	45	44%	0.29	0.018	0.11	0.0047	0	0	0
	Bin A Vis -	60	63%	0.49	0.021	0.053	0.0076	0.0019	0	0
1	Bin A Vis +	60	75%	21	0.45	0.59	0.072	0.012	0.00074	0
	Bin B1	42	81%	0.54	0.065	0.25	0.059	0.016	0.001	0
	Bin B2/C	15	80%	14	1.2	6.5	0.2	0.04	0.0084	0
	Clean Fili	45	27%	0.0049	0.00055	0.0029	0.00091	0	Ö	0
	Bin A Vis -	57	49%	0.2	0.0065	0.021	0.0019	0	0	0
2	Bin A Vis +	51	47%	0.08	0.0067	0.052	0.0042	0	0	0
	Bin B1	54	56%	0.44	0.025	0.1	0.017	0.002	0	0
	Bin B2/C	18	83%	0.48	0.057	0.25	0.038	0.0025	0.0011	0
	Clean Fill	90	36%	0.29	0.0094	0.035	0.0017	0	0	0
	Bin A Vis -	117	56%	0.49	0.014	0.045	0.0049	0.00095	0	0
1 and 2	Bin A Vis +	111	62%	21	0.25	0.37	0.025	0.002	0	0
	Bin B1	96	67%	0.54	0.043	0.22	0.03	0.0057	0	0
	Bin B2/C	33	82%	14	0.59	1.5	0.087	0.014	0.0014	0

100 100 X × 10 10 PCME LA Air Concentration (s/cc) PCME LA Air Concentration (s/cc) X Х X ♂ X 0.1 0.1 Ó 0.01 0.01 0.001 0.001 0.0001 0.0001 Vis -Vis + Vis -Vis + Vis -Vis +

Round 2

Figure 4-6. Outdoor ABS Air Concentrations Stratified by Visible Vermiculite Ranking^a

For plotting on a log scale, non-detects are assigned a value of 0.0001 s/cc (the x-axis).

Round 1

Box and w	hisker lege	nd:
	Х	max
ļ	Т	95th percentile
	ф	mean
l .		75th percentile
	•	median
) <u> </u>		25th percentile
	1	5th percentile

Round	Vis Rank	ABS Air Data								
		N	DF	Max (s/cc)	Mean (s/cc)	Percentile (s/cc)				
						0.95	0.75	0.5	0.25	0.05
1	Vis -	105	55%	0.49	0.021	0.16	0.005	0.00094	0	0
	Vis+	117	78%	21	0.41	0.55	0.065	0.017	0.0013	0
2	Vis -	93	45%	0.2	0.0053	0.018	0.0019	0	0	0
	Vis+	132	51%	0.48	0.02	0.083	0.0081	0.00085	0	0
1 and 2	Vis -	198	51%	0.49	0.013	0.058	0.0033	0.00062	0	0
	Vis+	249	63%	21	0.2	0.35	0.033	0.0029	0	0


Round 1 and 2

Note: Results from 1573 Kootenai River Rd are not included in Round 1 because visible vermiculite information was not reported.

^a Vis (-) = visible vermiculite was not detected at any sample node.

Vis (+) = visible vermiculite was detected at one or more sampling nodes.

Figure 4-7. Outdoor ABS Air Concentrations Stratified by Visual Vermiculite Detection Status Across Rounds

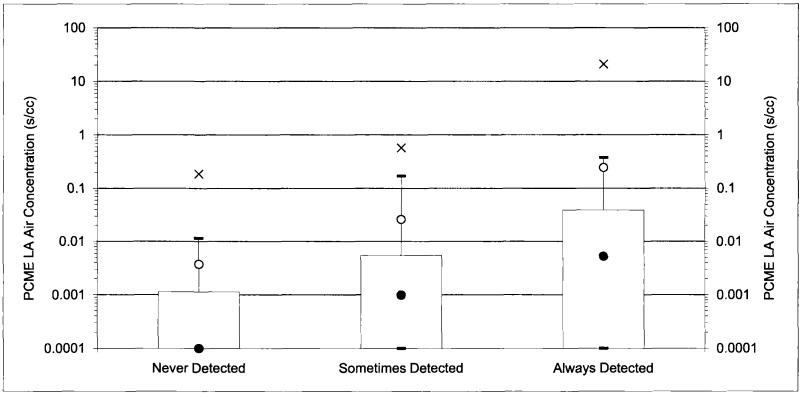

Box and	whisker leger	<u>nd:</u>
1	X	max
	Т	95th percentile
	ф	mean
		75th percentile
	•	median
1		25th percentile
Į į		Zour percentile
		5th percentile

			-	AB	S Air Data											
			Percentile (s/cc)													
Visible Detection Status	<u>N</u>	DF	Max (s/cc)	Mean (s/cc)	0.95	0.75	0.5	0.25	0.05							
Never Detected	96	39%	0.19	0.0038	0.012	0.0011	0	0	0							
Sometimes Detected	144	58%	0.58	0.026	0.17	0.0055	0.001	0	0							
Always Detected	204	67%	21	0.24	0.38	0.039	0.0052	0	0							

Never Detected: Visual vermiculite estimates always rank the ABS area as non-detect for LA.

<u>Sometimes Detected:</u> One of the sampling rounds ranked the ABS area as non-detect by visual vermiculite estimates, but the other round differed.

<u>Always Detected:</u> The ABS area has never been ranked as non-detect by visual vermiculite estimates.

Note: Results from 1573 Kootenai River Rd are not included because visible vermiculite information was not reported in Round 1.

Outdoor ABS Summary_PCME_V2.xls, ND-ND Vis All_4-7

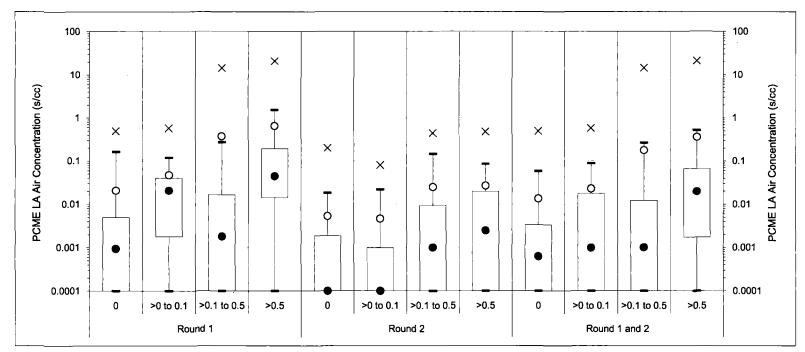


Figure 4-8. Outdoor ABS Air Concentrations Stratified by Visible Detection Frequency Ranking

Box and whisker	X T	max 95th percentile mean 75th percentile median 25th percentile
L	Ι	25th percentile 5th percentile

						ABS Air Da	ita				
	1					Percentile (s/cc)					
Round	Soil Bin_	N	DF	Max (s/cc)	Mean (s/cc)	0.95	0.75	0.5	0.25	0.05	
	0	105	55%	0.49	0.021	0.16	0.005	0.00094	0	0	
4	>0 to 0.1	27	85%	0.58	0.048	0.12	0.041	0.021	0.0018	0	
ı	>0.1 to 0.5	42	57%	14	0.38	0.28	0.017	0.0018	0	0	
	>0.5	48	92%	21	0.65	1.5	0.19	0.045	0.014	0	
	0	93	45%	0.2	0.0053	0.018	0.0019	0	0	0	
2	>0 to 0.1	36	28%	0.08	0.0046	0.022	0.001	0	0	0	
2	>0.1 to 0.5	54	54%	0.44	0.025	0.15	0.0093	0.001	0	0	
	>0.5	42	67%	0.48	0.027	0.086	0.02	0.0025	0	0	
	0	198	51%	0.49	0.013	0.058	0.0033	0.00062	0	0	
1 and 2	>0 to 0.1	63	52%	0.58	0.023	0.089	0.018	0.001	0	0	
1 and 2	>0.1 to 0.5	96	55%	14	0.18	0.27	0.012	0.001	0	0	
	>0.5	90	80%	21	0.36	0.52	0.066	0.02	0.0017	0	

### **Detection Frequency Bins:**

Note: Results from 1573 Kootenai River Rd are not included in Round 1 because visible vermiculite information was not reported.

⁰ no visible vermiculite present

>0 to 0.1 visible vermiculite present in ≤ 10% of visual inspection points

>0.1 to 0.5 visible vermiculite present in ≤ 50% of visual inspection points

>0.5 visible vermiculite present in more than 50% of visual inspection points


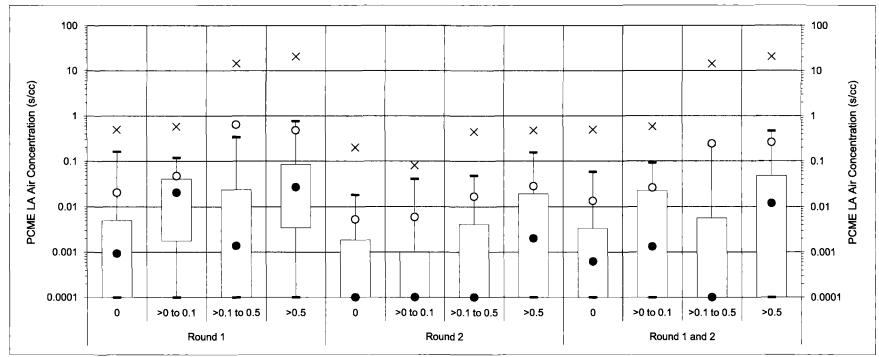


Figure 4-9. Outdoor ABS Air Concentrations Stratified by Visible Vermiculite Weighted Score Ranking

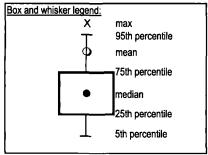

	median 25th percentile 5th percentile

### Weighted Score Bins:

no visible vermiculite present

>0 to 0.1 visible vermiculite weighted score of ≤ 0.1

>0.5 visible vermiculite weighted score higher than 0.5


	T	ABS Air Data									
						Percentile (s/cc)					
Round	Soil Bin	N	DF	Max (s/cc)	Mean (s/cc)	0.95	0.75	0.5	0.25	0.05	
	0	105	55%	0.49	0.021	0.16	0.005	0.00094	0	0	
4	>0 to 0.1	27	85%	0.58	0.048	0.12	0.041	0.021	0.0018	0	
1	>0.1 to 0.5	24	54%	14	0.64	0.34	0.023	0.0014	0	0	
	>0.5	66	83%	21	0.48	0.77	0.085	0.027	0.0035	0	
•	0	93	45%	0.2	0.0053	0.018	0.0019	0	0	0	
2	>0 to 0.1	28	36%	0.08	0.0059	0.041	0.001	0	0	0	
2	>0.1 to 0.5	42	40%	0.44	0.017	0.048	0.0041	0	0	0	
	>0.5	62	65%	0.48	0.028	0.16	0.019	0.002	0	0	
	0	198	51%	0.49	0.013	0.058	0.0033	0.00062	0	0	
1 and 2	>0 to 0.1	55	60%	0.58	0.026	0.092	0.023	0.0013	0	0	
1 and 2	>0.1 to 0.5	66	45%	14	0.24	0.23	0.0056	0	0	0	
	>0.5	128	74%	21	0.26	0.46	0.048	0.012	0	0	

Note: Results from 1573 Kootenai River Rd are not included in Round 1 because visible vermiculite information was not reported.


>0.1 to 0.5 visible vermiculite weighted score of  $\leq$  0.5

Figure 4-10. Outdoor ABS Air Concentrations as a Function of Visible Detection Frequency


Panel A: Average of all Air Concentrations Across Scenarios for Round 1

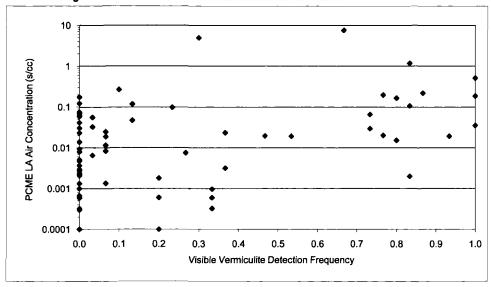

Panel B: Average of all Air Concentrations Across Scenarios for Round 2

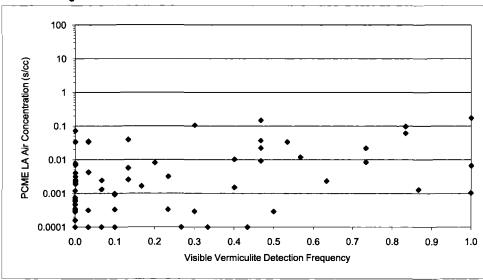


Panel C: Average of all Air Concentrations Across Scenarios For Both Rounds

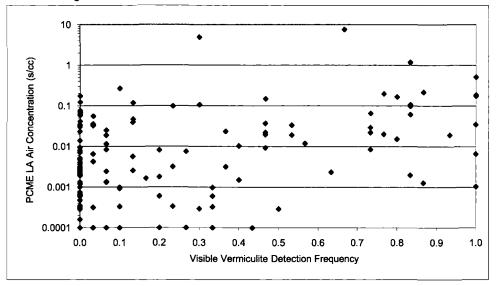


For plotting on a log scale, non-detects are assigned a value of 0.0001 s/cc (the x-axis). Average air concentrations are plotted vs. the visible detection frequency from the 30-pt soil sample.

Figure 4-11. Outdoor ABS Air Concentrations as a Function of Visible Vermiculite Weighted Score


Panel A: Average of all Air Concentrations Across Scenarios for Round 1

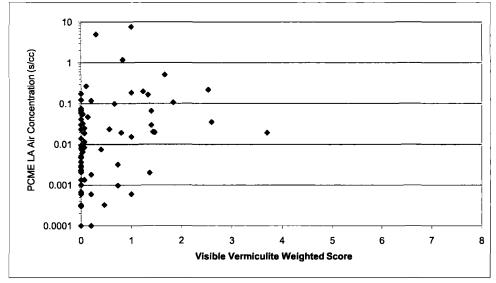

Panel B: Average of all Air Concentrations Across Scenarios for Round 2

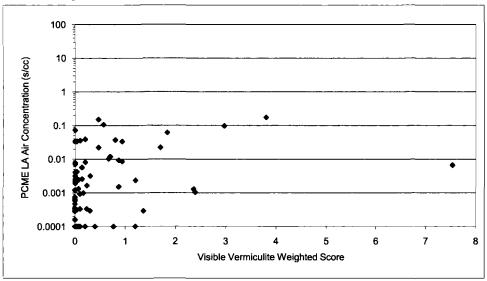


Panel C: Average of all Air Concentrations Across Scenarios For Both Rounds

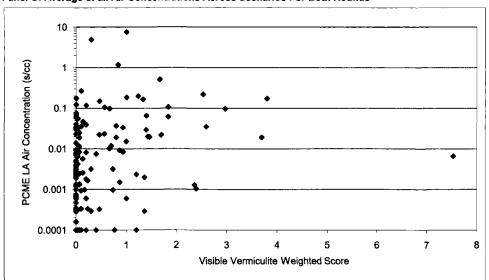

For plotting on a log scale, non-detects are assigned a value of 0.0001 s/cc (the x-axis). Average air concentrations are plotted vs. the visible detection frequency from the 30-pt soil sample.

Figure 4-12. Outdoor ABS Data for Clean Fill Locations

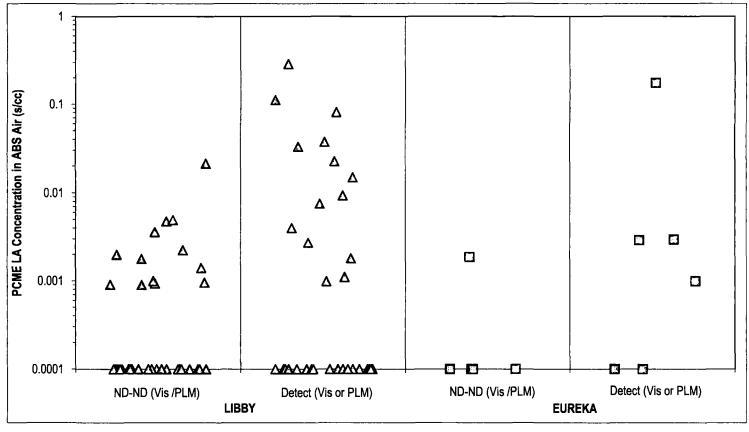


Non-detects are shown at 0.0001 s/cc.

ſ	Clean Fill	Soil Status		N				
L	Source	Sul Status	properties	samples	Conc (s/cc)			
ſ	Libby	ND-ND	7	42	1.1E-03			
L	Libby	Detect	6	36	1.7E-02			
Γ	Eureka	ND-ND	1	6	3.1E-04			
L	Luieka	Detect	1	6	3.0E-02			

Fig 4-12_Clean Fill Summary R1R2_PCME.xls

Figure 4-13. Comparison of High Volume and Low Volume Samples

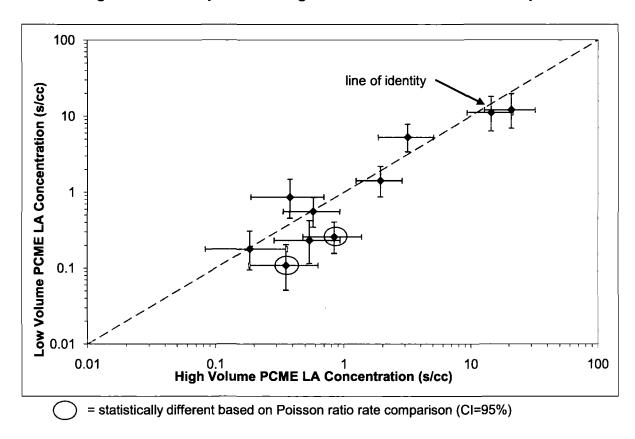



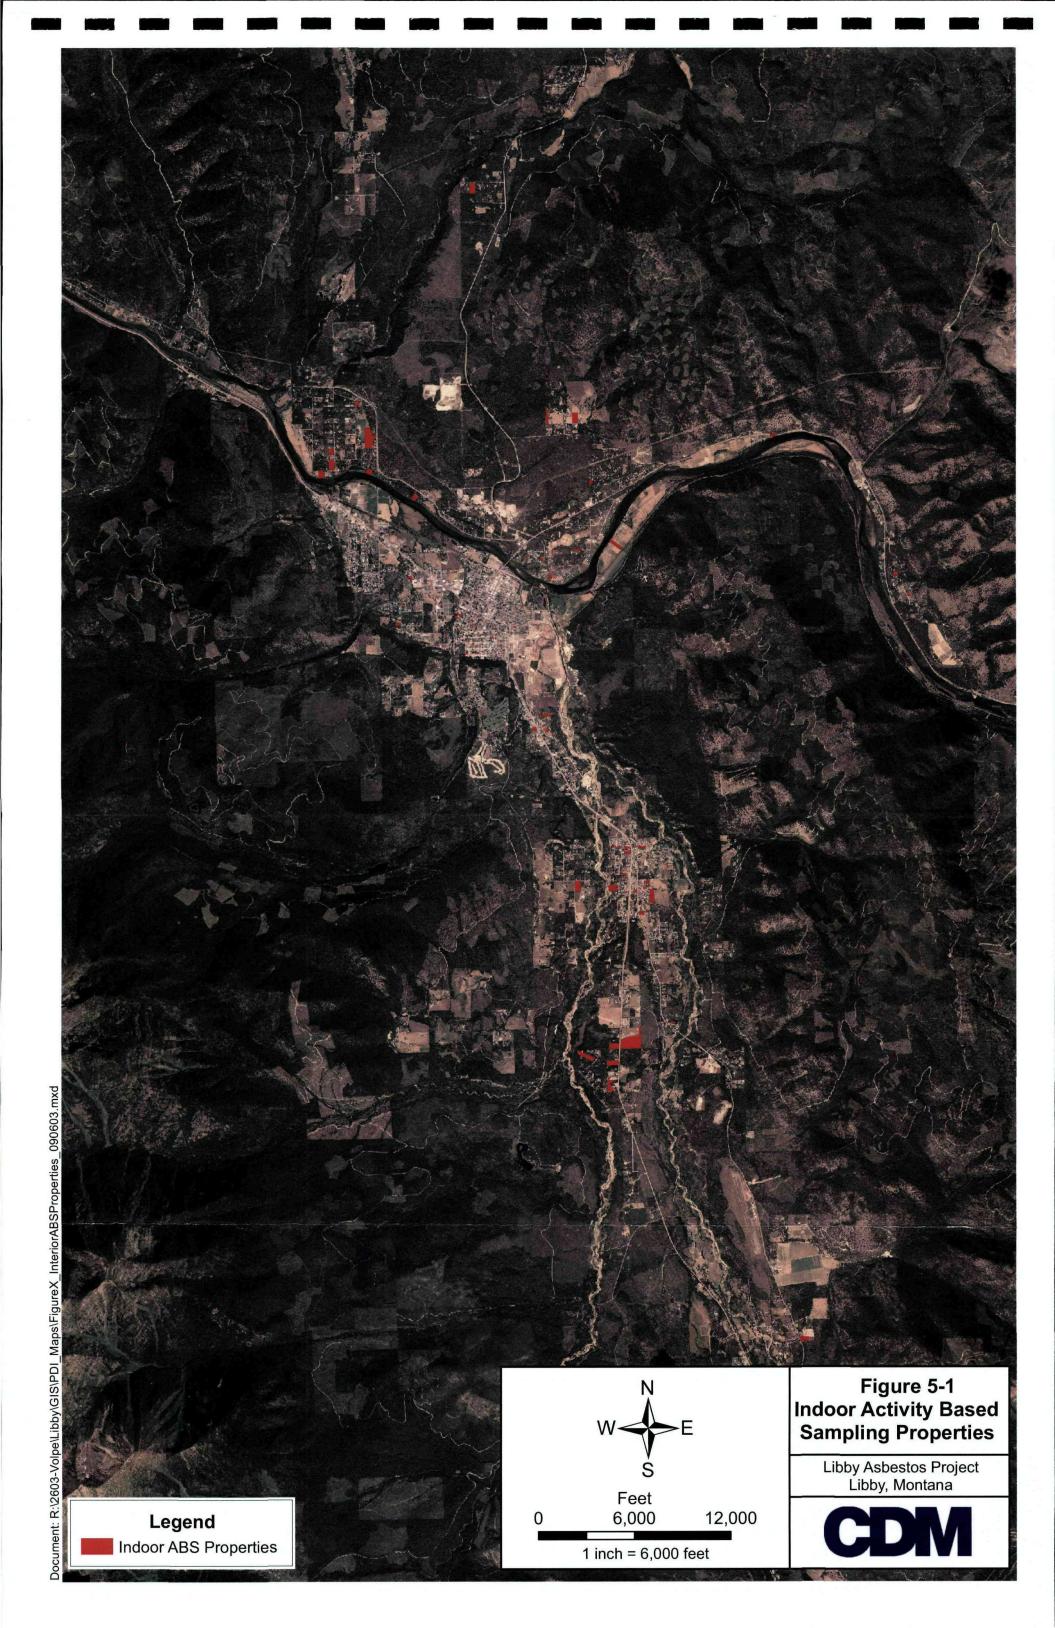



Figure 5-2. Indoor ABS Air Concentrations Stratified by ABS Scenario and Sampling Round

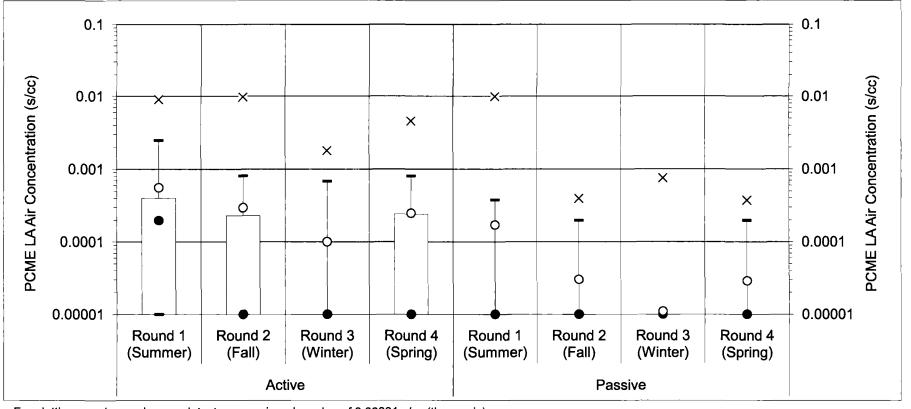

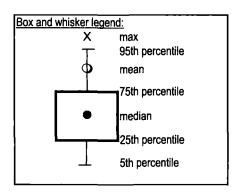

						ABS Air Dat	a				
	i [	N		Ī		Percentile (s/cc)					
Scenario	Round		DF	Max (s/cc)	Mean (s/cc)	0.95	0.75	0.5	0.25	0.05	
	Round 1	81	58%	0.009	0.00056	0.0025	0.0004	0.0002	0	0	
A akirra	Round 2	80	34%	0.01	0.0003	0.00081	0.00023	0	0	0	
Active	Round 3	80	14%	0.0018	0.0001	0.00068	0	0	0	0	
	Round 4	80	44%	0.0046	0.00025	0.00081	0.00024	0	0	0	
	Round 1	81	19%	0.01	0.00017	0.00038	0	0	0	0	
Passive	Round 2	80	14%	0.00039	0.00003	0.0002	0	0	0	0	
Passive	Round 3	80	3%	0.00075	0.000011	0	0	0	0	0	
	Round 4	80	14%	0.00037	0.000029	0.0002	0	0	0	0	

Figure 5-3. Indoor ABS Air Concentrations Stratified by Interior Category

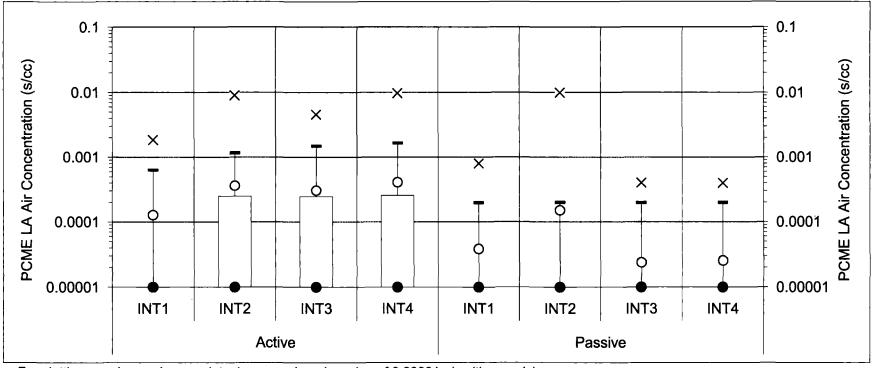


Вох а	nd whisker l	egend:
	X	max
	Т	95th percentile
	ф	mean
١.		75th percentile
		,
1 1	•	median
		25th percentile
		Zour porcontaio
		5th percentile


			ABS Air Data									
	Interior			Max	Mean		P	ercentile (s/	cc)			
Scenario	Category	N	DF	(s/cc)	(s/cc)	0.95	0.75	0.5	0.25	0.05		
	INT1	76	24%	0.0018	0.00013	0.00064	0	0	0	0		
Antivo	INT2	84	44%	0.009	0.00036	0.0012	0.00025	0	0	0		
Active	INT3	79	42%	0.0046	0.0003	0.0015	0.00025	0	0	0		
	INT4	80	39%	0.01	0.00041	0.0017	0.00026	0	0	0		
	INT1	76	12%	0.0008	0.000038	0.0002	0	0	0	0		
Dannius	INT2	84	15%	0.01	0.00015	0.0002	0	0	0	0		
Passive	INT3	80	11%	0.0004	0.000024	0.0002	0	0	0	0		
	INT4	80	10%	0.0004	0.000025	0.0002	0	0	0	0		

Figure 5-4. Indoor ABS Air Concentrations Stratified by PLM-VE Results

Panel A: Based on SUA Data

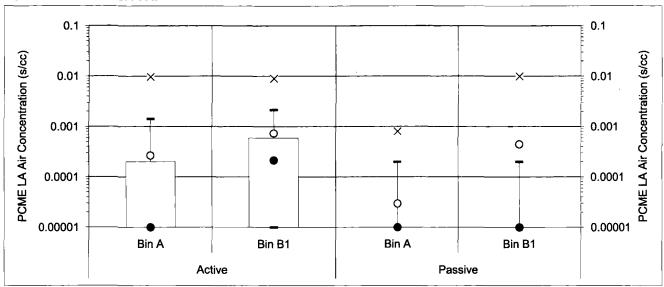

Panel B: Based on NSUA Data

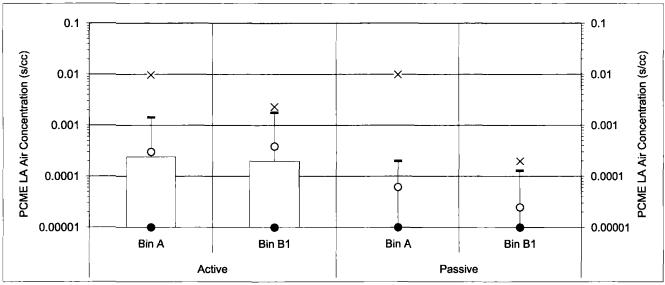


Вох а	nd whisker le	egend:
	Х	max
ļ	Т	95th percentile
	ф	mean
Ι,		75th percentile
	•	median
1		25th percentile
'		- 2001 percentale
		5th percentile


·			ABS Air Data									
				Max		Percentile (s/cc)						
Scenario	Soil Bin	N	N DF	(s/cc)	Mean (s/cc)	0.95	0.75	0.5	0.25	0.05		
SUA			<del>.</del>									
Antivo	Bin A	295	36%	0.01	0.00027	0.0014	0.0002	0	0	0		
Active	Bin B1	24	58%	0.009	0.00074	0.0021	0.00059	0.00021	0	0		
Deseive	Bin A	296	11%	0.0008	0.00003	0.0002	0	0	0	0		
Passive	Bin B1	24	21%	0.01	0.00045	0.0002	0	0	0	0		
NSUA		•										
Active	Bin A	311	38%	0.01	0.0003	0.0014	0.00024	0	0	0		
Acuve	Bin B1	8	25%	0.0023	0.00039	0.0018	0.0002	0	0	0		
Deseive	Bin A	312	12%	0.01	0.000062	0.0002	0	0	0	0		
Passive	Bin B1	- 8	13%	0.0002	0.000025	0.00013	0	0	0	0		

Figure 5-5. Indoor ABS Air Concentrations Stratified by Visible Detection Frequency

Panel A: Based on SUA Data

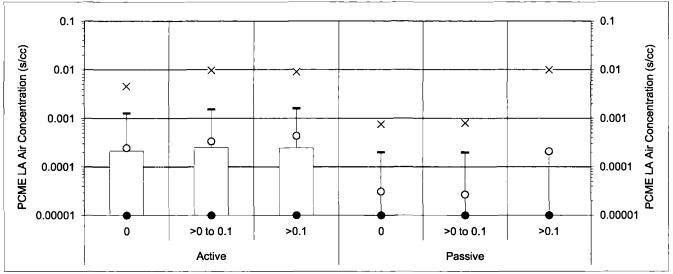

Panel B: Based on NSUA Data

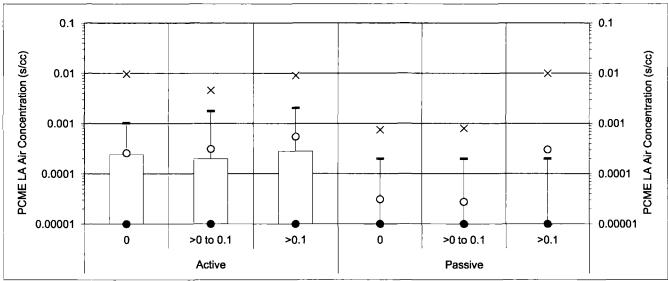


Box and v	whisker lege	nd:
	Х	max
ì	Т	95th percentile
	ф	mean
		75th percentile
ļ	•	median
		054
'		■25th percentile
1	1	5th percentile
1		


_		ABS Air Data								
			[	1 1			Percentile (s/cc)			
Scenario	DF Bin	N	DF	Max (s/cc)	Mean (s/cc)	0.95	0.75	0.5	0.25	0.05
SUA										
	0	175	37%	0.0046	0.00024	0.0013	0.00021	0	0	0
Active	>0 to 0.1	88	35%	0.01	0.00033	0.0015	0.00025	0	0	0
	>0.1	56	43%	0.009	0.00043	0.0016	0.00024	0	0	0
	0	176	12%	0.00075	0.000031	0.0002	0	0	0	0
Passive	>0 to 0.1	88	10%	0.0008	0.000027	0.0002	0	0	0	0
	>0.1	56	16%	0.01	0.00021	0.0002	0	0	0	0
NSUA										
	0	212	38%	0.01	0.00026	0.001	0.00024	0	0	0
Active	>0 to 0.1	71	31%	0.0046	0.00031	0.0018	0.0002	0	0	0
	>0.1	36	47%	0.009	0.00055	0.002	0.00028	0	0	0
	0	212	12%	0.00075	0.000031	0.0002	0	0	0	0
Passive	>0 to 0.1	72	10%	0.0008	0.000028	0.0002	0	0	0	0
L	>0.1	36	17%	0.01	0.0003	0.0002	0	0	0	0

Figure 5-6. Indoor ABS Air Concentrations Stratified by Visible Vermiculite Weighted Score

## Panel A: Based on SUA Data

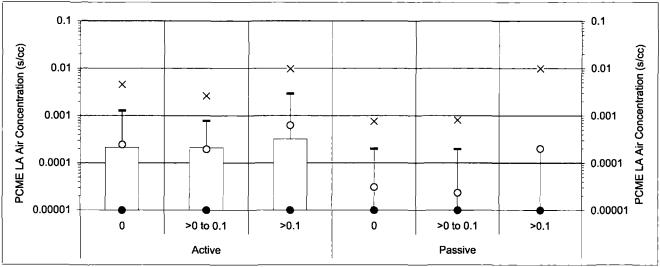

Panel B: Based on NSUA Data

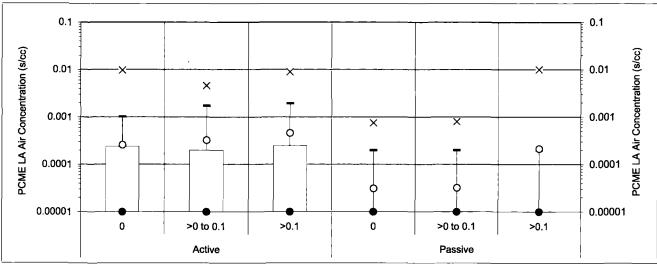


For plotting on a log scale, non-detects are assigned a value of 0.00001 s/cc (the x-axis).

Box and	Box and whisker legend:							
	X	max						
	T	95th percentile						
	ф	mean						
		75th percentile						
	•	median						
	<u> </u>	25th percentile						
		•						
		5th percentile						
1								

		ABS Air Data								
							Percentile (s/cc)			
Scenario	Score Bin	N	DF	Max (s/cc)	Mean (s/cc)	0.95	0.75	0.5	0.25	0.05
SUA							<del></del>			
	0	175	37%	0.0046	0.00024	0.0013	0.00021	0	0	0
Active	>0 to 0.1	84	33%	0.0026	0.00019	0.00078	0.00021	0	0	0
	>0.1	60	45%	0.01	0.00062	0.0029	0.00032	0	0	0
	0	176	12%	0.00075	0.000031	0.0002	Ö	0	0	0
Passive	>0 to 0.1	84	8%	0.0008	0.000024	0.0002	0	0	0	0
	>0.1	60	18%	0.01	0.0002	0.0002	0	0	0	0
NSUA										
	0	212	38%	0.01	0.00026	0.001	0.00024	0	0	0
Active	>0 to 0.1	55	31%	0.0046	0.00032	0.0017	0.0002	0	0	0
	>0.1	52	42%	0.009	0.00046	0.0019	0.00025	0	0	Ö
	0	212	12%	0.00075	0.000031	0.0002	0	0	0	0
Passive	>0 to 0.1	56	11%	0.0008	0.000032	0.0002	0	0	0	0
	>0.1	52	13%	0.01	0.00021	0.0002	0	0	0	0

Figure 5-7. Mean PCME LA Air Concentration Stratified by NSUA and SUA Visual Detection Frequency Bins

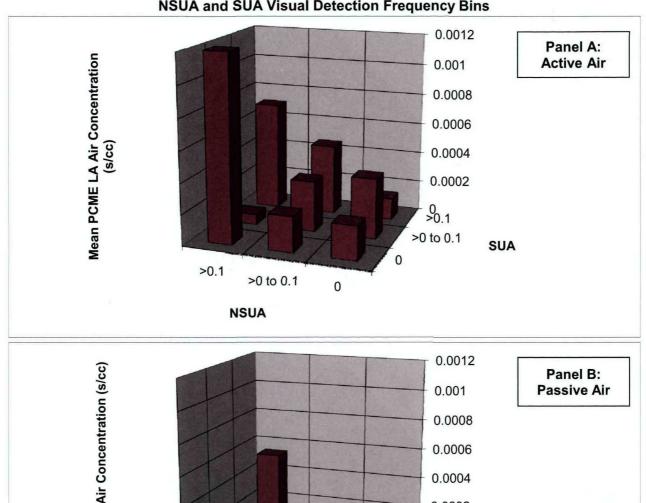


on (s/cc)			0.001	Panel B: Passive Air
iratio			0.0008	
ncent			0.0006	
S S			0.0004	
Ā Š			0.0002	
Mean PCME LA Air Concentration (s/cc)	>0.1		0 > 0.1 ) to 0.1	SUA
_	>0 to 0.1	0		
	NSUA			

Active Mean PCME LA Concentration (s/cc)		SUA				
		0	>0 to 0.1	>0.1		
NSUA	0	0.00022	0.00039	0.00014		
	>0 to 0.1	0.00023	0.00033	0.00046		
	>0.1	0.0012	0.000066	0.00071		

Passive Mean PCME LA		SUA			
Concentration (s/cc)		0	>0 to 0.1	>0.1	
	0	0.000035	0.000021	0.000028	
NSUA	>0 to 0.1	0.000016	0.00005	0.000025	
	>0.1	0	0.000016	0.00054	

Count of Samples		SUA				
		0	>0 to 0.1	>0.1		
NSUA	0	136	56	20		
	>0 to 0.1	35	20	16		
	>0.1	4	12	20		

Figure 5-8. Mean PCME LA Air Concentration Stratified by NSUA and SUA Visual Score Bins

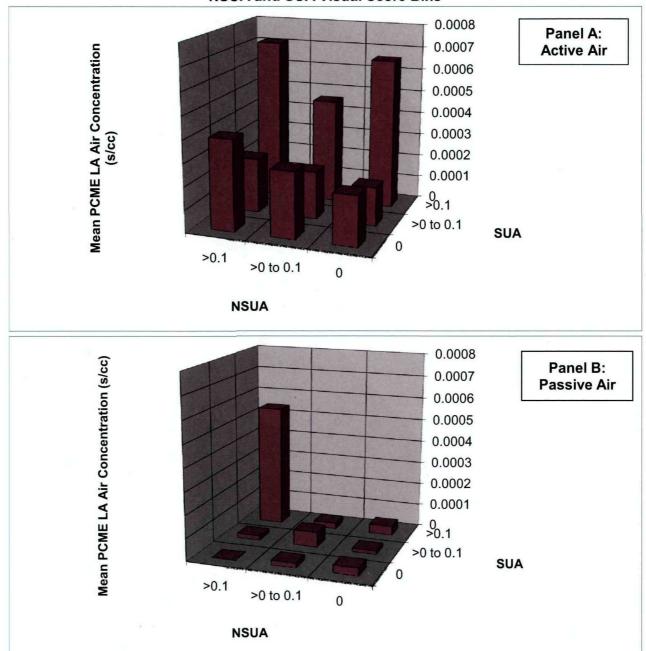

Active Mean PCME LA		SUA				
Concentration (s/cc)		0	>0 to 0.1	>0.1		
	0	0.00022	0.00017	0.00066		
NSUA	>0 to 0.1	0.00029	0.00021	0.00046		
	>0.1	0.0004	0.00024	0.00071		

Passive Mean PCME LA Concentration (s/cc)		SUA			
		0	>0 to 0.1	>0.1	
	0	0.000035	0.000015	0.00004	
NSUA	>0 to 0.1	0.000021	0.000067	0.000025	
	>0.1	0	0.00002	0.00054	

Count of Samples		SUA				
		0	>0 to 0.1	>0.1		
	0	34	13	6		
NSUA	>0 to 0.1	7	4	4		
	>0.1	3	5	5		

Figure 6-1. Distribution of Screening Level Risk Estimates at Outdoor ABS Areas

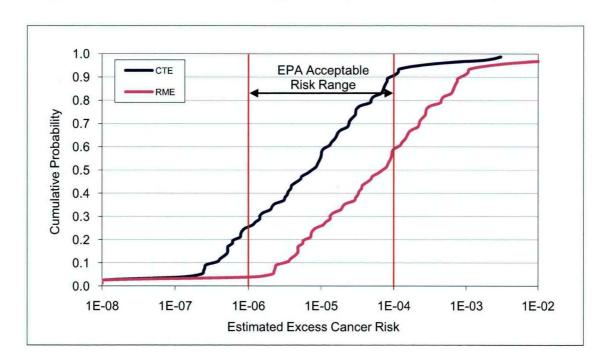


Figure 6-2. Distribution of Screening Level Risk Estimates (Active Plus Passive) at Indoor ABS Properties


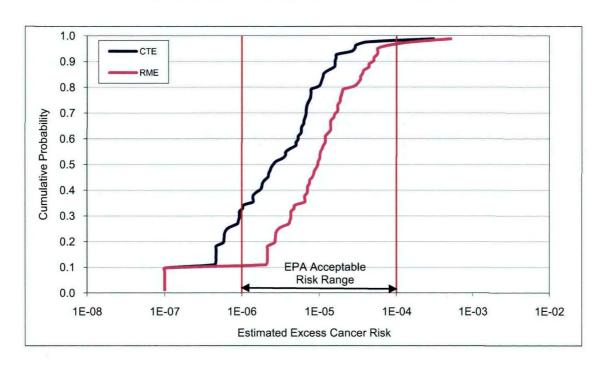



Figure 6-3. Distribution of Screening Level Total Risk Estimates^a at Properties with Both Indoor and Outdoor ABS Data

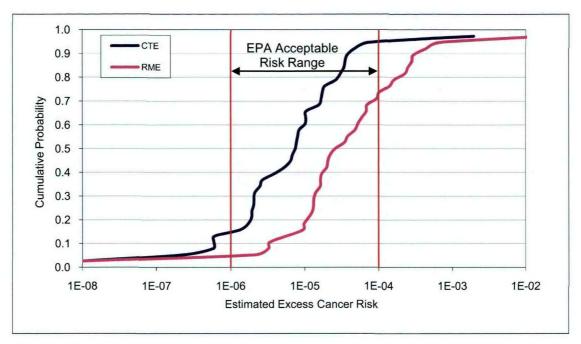


^a Total Risk = Outdoor ABS Risk + Indoor, active ABS Risk + Indoor, passive ABS Risk

Figure 6-4. Comparison of Direct and Indirect TEM Results for 31 Air Samples from Libby

Panel A: All Samples

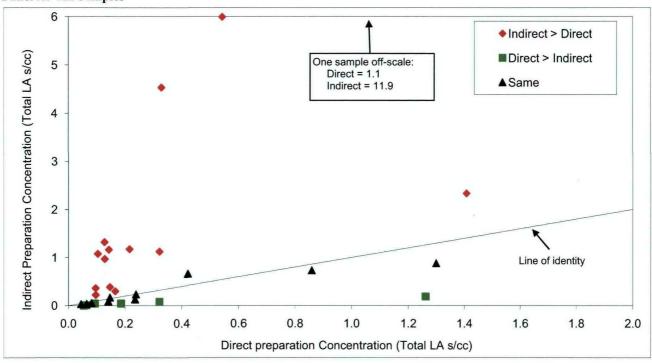

Panel B: Indirect > Direct Samples Only

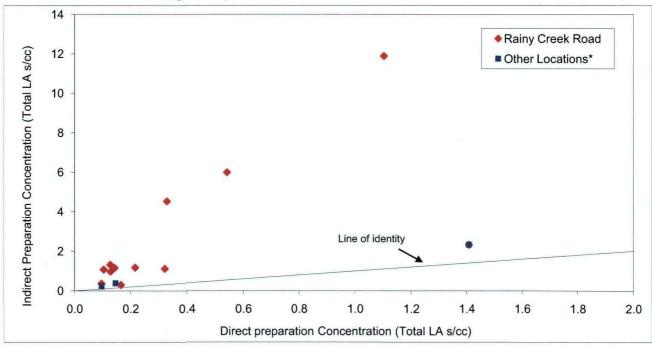

^{*} All locations that do not have "Rainy Creek Road" in the property description for the sample.

400 347 350 300 Number of Samples 250 200 150 100 36 34 50 16 17 0 ≥ 120 min 60 - < 120 min 30 - < 60 min 15 - < 30 min <15 min **Sample Duration** 

Figure 7-1. Sample Durations for Outdoor ABS Air Samples

# Attributes of Short Duration (<1 hour) Samples

Sample	N Samples by ABS Scenario						
Duration	Total	Mowing	Digging	Raking			
≥ 120 min	347	115	114	118			
60 - < 120 min	36	11	11	14			
30 - < 60 min	16	4	5	7			
15 - < 30 min	34	14	12	8			
<15 min	17	6	8	3			
	450	150	150	150			

Sample	N Samples by Outdoor ABS Category					
Duration	Total	EXT1	EXT2	EXT3	EXT4	EXT5
≥ 120 min	347	72	66	68	69	72
60 - < 120 min	36	9	8	5	6	8
30 - < 60 min	16	5	4	6	0	1
15 - < 30 min	34	2	7	8	9	8
<15 min	17	2	5	3	0	7
	450	90	90	90	84	96

Figure 7-2. Analytical Sensitivities Achieved for Outdoor ABS Air Samples


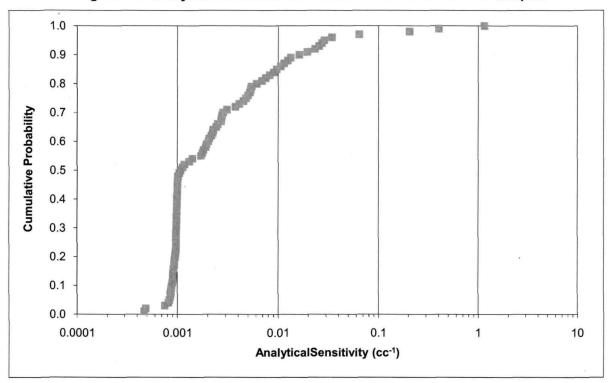


Figure 7-3. Number of LA Structures Observed in Outdoor ABS Air Samples†

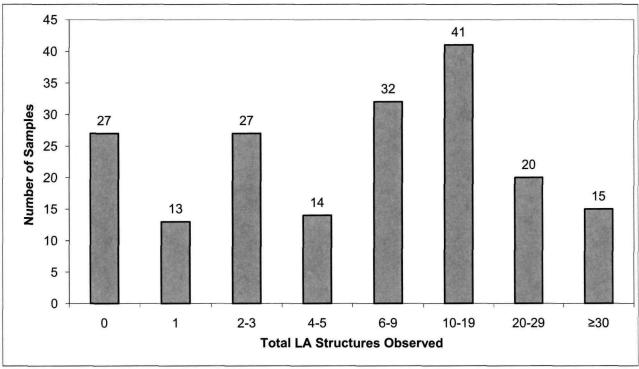

† For samples where analysis was stopped based on maximum number of grid openings counted of 100.

Figure 7-4. Sample Durations for Indoor ABS Air Samples


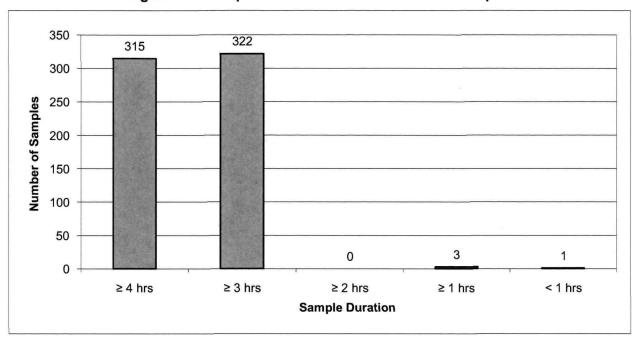


Figure 7-5. Analytical Sensitivities Achieved for Indoor ABS Air Samples

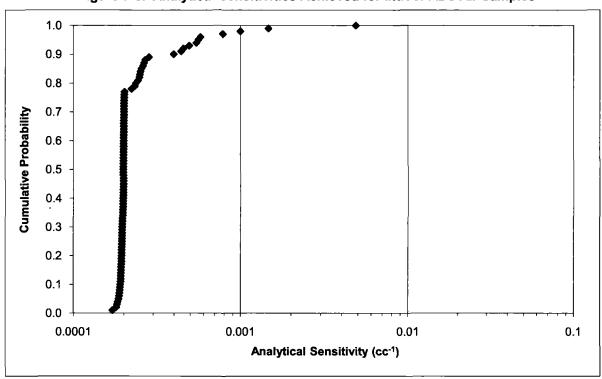

Number of Samples 2-3 4-5 6-9 10-19 20-29 ≥30

**Total LA Structures Observed** 

Figure 7-6. Number of LA Structures Observed in Indoor ABS Air Samples†

† For samples where analysis was stopped based on maximum number of grid openings counted of 100.

# **TARGET SHEET**

# EPA REGION VIII SUPERFUND DOCUMENT MANAGEMENT SYSTEM

DOCUMENT NUMBER: 1167263

SITE NAME:LIBBY ASBESTOS
DOCUMENT DATE: 06/02/2010
DOCUMENT NOT SCANNED
Due to one of the following reasons:
□ PHOTOGRAPHS
☐ 3-DIMENSIONAL
□ OVERSIZED
☑ AUDIO/VISUAL
☐ PERMANENTLY BOUND DOCUMENTS
□ POOR LEGIBILITY
□ OTHER
□ NOT AVAILABLE
☐ TYPES OF DOCUMENTS NOT TO BE SCANNED (Data Packages, Data Validation, Sampling Data, CBI, Chain of Custody)
DOCUMENT DESCRIPTION:
2 CDs - ACTIVITY-BASED SAMPLING SUMMARY REPORT, APPENDIX A DISC 1 and 2